



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2204827

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 05/08/2022
Reference CC6/CTI21012385/Rpa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMN 7067J
Insured Veh. SMV 6130Z
Claim No. SNM21D207065/C02
Policy No. DMPCSNA00225492100
Accident Date 04/12/2021
Inspection Date 13/12/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21012385/Rpa3q2 Date: 05/08/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SMV 6130Z	Veh. Inspected	SMN 7067J
	Policy No.	DMPCSNA00225492100	Coverage (\$)	0.00
	Claim No.	SNM21D207065/C02	Excess (\$)	0.00
	Assign From		Assign Date	13/12/2021
2. Vehicle Particulars & Condition				
	Make & Model	MERCEDES BENZ GLA180 URBAN	c.c	1595
	Engine No.	HIDDEN	Year of Reg.	2019
	Chassis No.	WDC1569422J646554	Colour	RED
	Odometer	40520 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	FAIR		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	235/50 R18	DUNLOP	6 mm
	L/H Front Tyre	235/50 R18	DUNLOP	6 mm
	R/H Rear Tyre	235/50 R18	DUNLOP	6 mm
	L/H Rear Tyre	235/50 R18	DUNLOP	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	04/12/2021	Inspection Date	13/12/2021
	Survey held at	BIS AUTOMOBILES PTE LTD 30 TEBAN GARDENS CRESCENT, SINGAPORE 608927		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 6

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMN 7067J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	SUNDRIES (SN)	NECESSARY	150.00	150.00
1	TRIM ,BUMPER FRONT (SN)	DEFORMED	1,398.43	1,328.51
1	TOWING EYE COVER (SN)	NOT NECESSARY	176.17	-
1	BASIC CARRIER FOR BUMPER ,FRONT (SN)	NOT NECESSARY	169.60	-
5	COMBI-FILLISTER HD ,SCREW (SN)	NOT NECESSARY	17.30	-
1	IMPACT ABSORBER CENTER (SN)	NOT NECESSARY	156.50	-
4	TAPPING SCREW (FENDER) (SN)	NOT NECESSARY	13.44	-
4	SPRING NUT (FENDER) (SN)	NOT NECESSARY	14.32	-
8	EXPANSION RIVET (SN)	NOT NECESSARY	18.32	-
1	COVER ,BUMPER AREA ,CENTER (SN)	NOT NECESSARY	965.48	-
1	BRACING ,LOWER BUMPER COVER (SN)	NOT NECESSARY	350.83	-
1	COVER ,BUMPER AREA ,CENTER (SN)	NOT NECESSARY	157.67	-
1	COMPANY SIGN BUMPER (SN)	NECESSARY	66.66	63.33
2	FASTENING GROMMET (SN)	NECESSARY	5.28	5.02
1	ELECTRICAL WIRING HARNESS (SN)	NOT NECESSARY	453.37	-
4	DISTANCE SENSOR (SN)	NOT NECESSARY	766.36	-
6	DECOUPLING RING (SN)	NOT NECESSARY	41.82	-
1	TRIM BUMPER (LOWER REAR) (SN)	DEFORMED	1,052.97	1,000.33
1	MOUNTING RAIL LEFT (SN)	NOT NECESSARY	21.52	-
1	MOUNTING RAIL RIGHT (SN)	NOT NECESSARY	21.52	-
2	PLASTIC NUT OPNE (SN)	NOT NECESSARY	2.32	-
1	TAPPING SCREW (LEFT SIDE WALL) (SN)	NOT NECESSARY	3.02	-
1	TAPPING SCREW (RIGHT SIDE WALL) (SN)	NOT NECESSARY	3.02	-
1	SPRING NUT (LEFT SIDE WALL) (SN)	NOT NECESSARY	3.58	-
1	SPRING NUT (RIGHT SIDE WALL) (SN)	NOT NECESSARY	3.58	-
2	SPRING NUT (BUMPER,BOTTOM) (SN)	NOT NECESSARY	7.16	-
2	TAPPING SCREW (BUMPER LOWER PART) (SN)	NOT NECESSARY	6.04	-
4	TAPPING SCREW (BUMPER BOTTOM SECTION) (SN)	NOT NECESSARY	12.08	-
1	BASIC CARRIER FOR BUMPER ,CENTER REAR (SN)	NOT NECESSARY	73.29	-
1	BASIC CARRIER FOR BUMPER ,LEFT REAR (SN)	NOT NECESSARY	65.12	-
1	BASIC CARRIER FOR BUMPER ,RIGHT REAR (SN)	NOT NECESSARY	64.74	-

Report Ref No. CC6/CTI21012385/Rpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	PLASTIC NUT OPEN ,LEFT CARRIER (SN)	NOT NECESSARY	2.32	-
2	PLASTIC NUT OPEN ,RIGHT CARRIER (SN)	NOT NECESSARY	2.32	-
2	PLATE (SN)	NOT NECESSARY	14.70	-
2	SEALING DISK (SN)	NOT NECESSARY	5.28	-
1	BRACKET (LEFT REAR -END CENTER) (SN)	NOT NECESSARY	56.04	-
1	BRACKET (RIGHT REAR -END CENTER) (SN)	NOT NECESSARY	54.50	-
4	NUT AND WASHER ASSEMBLY (BRACKET TO TAIL) (SN)	NOT NECESSARY	14.56	-
2	PLASTIC NUT OPEN (BASIC CARRIER ,CENTER) (SN)	NOT NECESSARY	2.32	-
2	NUT AND WASHER ASSEMBLY (BASIC CARRIER,CENTER) (SN)	NOT NECESSARY	15.20	-
1	STEP PLATE (SN)	CRACKED	217.60	206.72
1	DAMPING SIDE WALL ,LEFT PANEL (SN)	NOT NECESSARY	45.80	-
1	DAMPING SIDE WALL ,RIGHT PANEL (SN)	NOT NECESSARY	45.80	-
1	TRIM BUMPER LOWER (SN)	DEFORMED	1,000.33	1,000.33
1	BUMPER HOLDER LEFT LOWER (SN)	NECESSARY	66.38	63.07
2	TAPPING SCREW (BRACKET TO COVERING) (SN)	NOT NECESSARY	5.40	-
2	SPRING NUT (SN)	NOT NECESSARY	2.90	-
1	TAIPIPE TRIM LEFT (SN)	SCRATCHED	283.61	269.43
1	TAIPIPE TRIM RIGHT (SN)	NOT NECESSARY	283.61	-
1	BRACKET ,LEFT (SN)	NECESSARY	165.17	165.17
1	BRACKET RIGHT (SN)	NECESSARY	110.39	104.88
4	FILLISTER HEAD SCREW (EXHAUST TIP) (SN)	NOT NECESSARY	10.32	-
4	FILLISTER HEAD SCREW (COVERING) (SN)	NOT NECESSARY	10.32	-
8	EXPANSION RIVET (SN)	NOT NECESSARY	47.76	-
6	BLIND RIVET (SN)	NOT NECESSARY	28.86	-
1	ELECTRICAL WIRING HARNESS (SN)	NOT NECESSARY	123.05	-
6	DISTANCE SENSOR (SN)	NOT NECESSARY	1,149.54	-
6	DECOUPLING RING (SN)	NOT NECESSARY	41.82	-
4	LINE FASTENER (SN)	NOT NECESSARY	43.48	-
1	COVER ,BUMPER AREA ,LEFT (SN)	NOT NECESSARY	64.93	-
1	COVER ,BUMPER AREA ,RIGHT (SN)	NOT NECESSARY	64.93	-
2	RETAINING RING (SN)	NOT NECESSARY	5.02	-
1	MERCEDES STAR SIGN (SN)	NECESSARY	140.01	133.01

Report Ref No. CC6/CTI21012385/Rpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	GRILLE CARRIER (SN)	CRACKED	118.93	118.93
1	RADIATOR GRILLE ,CARRIER (SN)	CRACKED	298.09	283.19
1	CARRIER ,MERCEDES STAR (SN)	NECESSARY	169.13	169.13
1	AIRFLOW SERRATION LEFT (SN)	NOT NECESSARY	75.24	-
1	AIRFLOW SERRATION RIGHT (SN)	NOT NECESSARY	75.24	-
1	RADAR SENSOR (SN)	NOT NECESSARY	1,205.98	-
1	MOUNT SENSOR (SN)	NOT NECESSARY	42.82	-
1	UPPER CARRIER (SN)	BENT	344.38	344.38
1	LOWER CARRIER (SN)	BENT	344.12	344.12
2	CONDENSER (SN)	BENT	2,370.76	1,126.12
2	PARTS KIT ,HOLDER (SN)	NOT NECESSARY	290.58	-
2	REFRIGERANT DRIER (SN)	NOT NECESSARY	549.00	-
1	LAMP UNIT ,LEFT (SN)	NOT NECESSARY	2,594.23	-
1	LAMP UNIT ,RIGHT (SN)	NOT NECESSARY	2,594.23	-
1	REAR DOOR (SN)	BENT	2,191.75	2,082.17
2	STOP PLUG (SN)	NECESSARY	4.58	4.36
2	INTERMEDIATE LAYER (SN)	NOT NECESSARY	9.86	-
1	SEALING REAR END DOOR (SN)	NOT NECESSARY	233.31	-
2	ADHESIVE FILM CUTTING (SN)	NOT NECESSARY	17.16	-
1	HINGE LEFT REAR PANEL DOOR (SN)	NOT NECESSARY	92.89	-
1	HINGE RIGHT REAR PANEL DOOR (SN)	NOT NECESSARY	92.89	-
4	NUT AND WASHER ASSEMBLY (SN)	NOT NECESSARY	15.84	-
4	FILLISTER HEAD SCREW (SN)	NOT NECESSARY	23.12	-
1	PNEUMATIC SPRING RIGHT (SN)	NOT NECESSARY	287.38	-
1	DRIVE SPINDLE (SN)	NOT NECESSARY	679.89	-
1	CLAMP (20MM) (SN)	NOT NECESSARY	3.27	-
2	TRAVEL LIMITER (SN)	NOT NECESSARY	27.08	-
2	WINDOW (SN)	NOT NECESSARY	11.94	-
1	RELEASE HANDLE (SN)	NOT NECESSARY	170.52	-
1	DOOR LOCK (SN)	NOT NECESSARY	296.42	-
1	STRIKER (SN)	NOT NECESSARY	35.47	-
1	DRIVE (SN)	NOT NECESSARY	181.45	-
1	REAR END CENTER SECTION (SN)	NOT NECESSARY	1,341.79	-

Report Ref No. CC6/CTI21012385/Rpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RADIATOR (SN)	NOT NECESSARY	895.20	-
2	ELASTOMER BEARING (SN)	NOT NECESSARY	42.66	-
2	BEARING RADIATOR TOP (SN)	NOT NECESSARY	55.10	-
2	PLUG IN FASTENER (SN)	NOT NECESSARY	13.58	-
1	BRACKET ,RADIATOR LEFT (SN)	NOT NECESSARY	34.96	-
1	BRACKET ,RADIATOR RIGHT (SN)	NOT NECESSARY	34.96	-
1	AIR DUCTING FOR RADIATOR ,LEFT (SN)	NOT NECESSARY	17.43	-
1	AIR DUCTING FOR RADIATOR ,RIGHT (SN)	NOT NECESSARY	18.75	-
1	AIR DUCTING FOR RADIATOR ,BOTTOM (SN)	NOT NECESSARY	66.44	-
1	RADIAL BLOWER ,MECHANICAL (SN)	NOT NECESSARY	475.80	-
1	REAR WINDOW (SN)	NOT NECESSARY	759.45	-
1	CABLE LUG ,SPECIAL FOAM (SN)	NOT NECESSARY	4.74	-
1	MERCEDES STAR (SN)	NECESSARY	49.98	47.49
3	FASTENING GROMMET (SN)	NOT NECESSARY	7.92	-
1	MODEL PLATE (SN)	NECESSARY	92.04	87.44
1	EXHAUST LINE ,FRONT (SN)	NOT NECESSARY	3,601.36	-
1	MULTI-HOLE SEAL (SN)	NOT NECESSARY	14.06	-
1	BRACKET ,EXHAUST PIPE (SN)	NOT NECESSARY	48.75	-
2	SCREW ,ROUND HEXAL HEAD (M8X20) (SN)	NOT NECESSARY	14.02	-
1	PROFILE CLAMP ,EXHAUST SYSTEM (SN)	NOT NECESSARY	46.96	-
1	EXHAUST GAS LINE ,CENTER (SN)	NOT NECESSARY	671.34	-
1	PIPE CLAMP (D=60MM) (SN)	NECESSARY	121.98	115.89
1	EXHAUST SYSTEM (SN)	BENT	1,226.51	1,165.19
2	BRACKET REAR EXHAUST SYSTEM (SN)	NOT NECESSARY	36.12	-
1	BRACKET ,CENTER EXHAYST SYSTEM (SN)	NOT NECESSARY	18.06	-
3	HEXALOBULAR BOLT (M8X16) (SN)	NOT NECESSARY	5.64	-
2	SUSPENSION ,EXHAUST GAS LINE (SN)	NOT NECESSARY	83.00	-
1	SUSPENSION RING (SN)	NOT NECESSARY	18.06	-
1	LAMDA SENSOR (UPSTREAM) (SN)	NOT NECESSARY	427.95	-
1	LAMDA SENSOR (DOWNSTREAM) (SN)	NOT NECESSARY	689.29	-
1	REAR LAMP COMBINATION ,LEFT (SN)	NOT NECESSARY	776.82	-
1	REAR LAMP COMBINATION ,RIGHT (SN)	NOT NECESSARY	776.82	-
1	REAR LAMP COMBINATION ,LEFT INSIDE (SN)	NOT NECESSARY	525.42	-

Report Ref No. CC6/CTI21012385/Rpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR LAMP COMBINATION ,RIGHT INSIDE (SN)	NOT NECESSARY	525.42	-
2	LICENSE PLATE LAMP (SN)	NOT NECESSARY	55.98	-
1	PARTS KIT ,RADIATOR GRILLE (SN) (ADDITIONAL)	CRACKED	766.73	766.73
1	TRIM,BUMPER REAR (SN) (ADDITIONAL)	CRACKED	1,378.45	1,378.45
1	TRUNK LID FINISHER (SN) (ADDITIONAL)	CRACKED	142.50	142.50
			41,715.37	12,665.89
	LABOUR			
	TO REPLACE AIR CON CONDENSER AND AIR CON HOSES INCLUDE VACUUM SYSTEM ,TOP UP FREON GAS AND CONDUCTING CHECKS FOR LEAK AND PROPER FUNCTION.(ADDITIONAL)		720.00	720.00
	TO REPLACE FRONT BUMPER AND ATTACHMENTS ,REAR BUMPER AND ATTACHMENTS TAIL END PANEL ,TRUNK FLOOR PLATE ,BOOT LID ,BONNET,INCLUDE PULLING AND STRAIGHTENING ON ACCIDENT AREAS AND KNOCKING OUT DENTS CAUSED BY THE ACCIDENT.		7,200.00	2,160.00
	TO SPRAY PAINT FRONT BUMPER ,REAR BUMPER ,TAIL END PANEL,TRUNK FLOOR PLATE AND BOOT LID .		3,575.00	2,000.00
	TO REPLACE LH HIGH INTENSITY HEADLIGHT INCLUDE FUNCTIONALITY PROGRAMMING AND CONDUCTING CHECKS FOR PROPER FUNCTION.	NOT NECESSARY	450.00	-
	TO REPLACE RH HIGH INTENSITY HEADLIGHT INCLUDE FUNCTIONALITY PROGRAMMING AND CONDUCTING CHECKS FOR PROPER FUNCTION.	NOT NECESSARY	450.00	-
	TO REPLACE RADIATOR ASSEMBLY INCLUDING PRESSURE TESTS,BLEEDING COOLING SYSTEM AND CONDUCTING CHECKS FOR LEAK AND PROPER FUNCTION.	NOT NECESSARY	900.00	-
	TO REMOVE AND INSTALL REAR WINDSCREEN GLASS TO FACILITATE REPAIRS INCLUDING WATER LEAK TESTS.		720.00	576.00
	TO TRANSFER LOCK MECHANISM FROM OLD TO NEW BOOT LID INCLUDE CONDUCTING CHECKS ON NEW BOOT LID CENTRAL LOCKING SYSTEM AND SENSOR FOR PROPER FUNCTION.		450.00	360.00
	TO REPLACE REAR EXHAUST SILENCER INCLUDE ALIGNMENT AND CONDUCTING CHECKS FOR LEAK AND PROPER FUNCTION .		450.00	360.00
	TO REMOVE AND INSTALL REAR BOOT COMPARTMENT CARPET AND GARNISH TO FACILITATE REPAIRS.		225.00	204.00

Report Ref No. CC6/CTI21012385/Rpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:6 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO TRANSFER PDC ASSEMBLY FROM OLD TO NEW BUMPER INCLUDE RECONNECTING TO NEW BUMPER AND CONDUCTING CHECK FOR PROPER FUNCTION.		300.00	200.00
	TO RECONNECT ALL ELECTRICAL COMPONENTS AND WIRINGS AT THE REAR SECTION INCLUDE CONDUCTING CHECKS FOR PROPER FUNCTION (FOR CUT PANEL).	NOT NECESSARY	360.00	-
	TO CARRY OUT BODY CAVITY PRESERVATION (FOR CUT PANEL) .	NOT NECESSARY	900.00	-
	TO CARRY OUT BODY CAVITY PRESERVATION.		100.00	80.00
	TO SUPPLY FRONT AND REAR EMBOSS NUMBER PLATE.		175.00	140.00
	TO CARRY OUT VEHICLE DIAGNOSIS -ABL.		500.00	360.00
			17,475.00	7,160.00
GRAND TOTAL			59,190.37	19,825.89
RECOMMENDED COST OF REPAIRS				19,825.89

Report Ref No. CC6/CTI21012385/Rpa3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMN 7067J

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

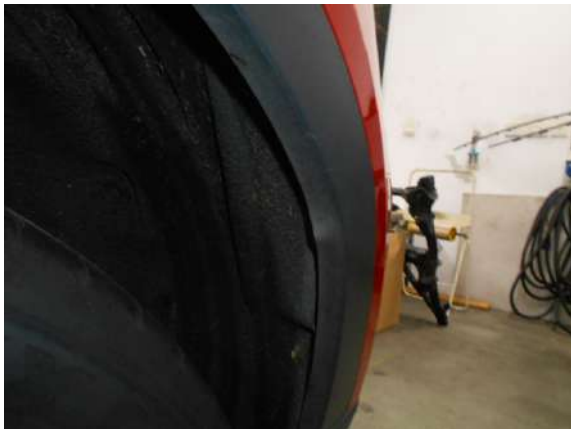



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

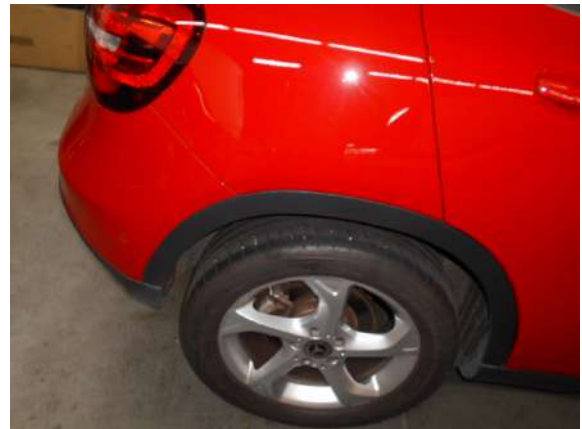



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMN 7067J

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

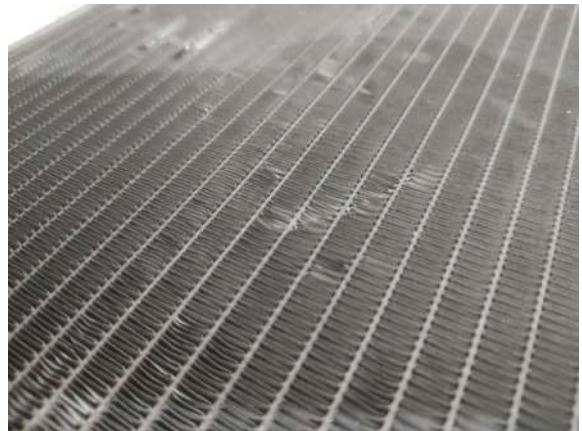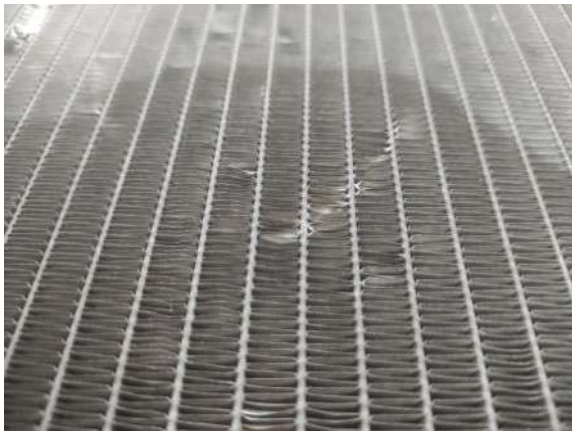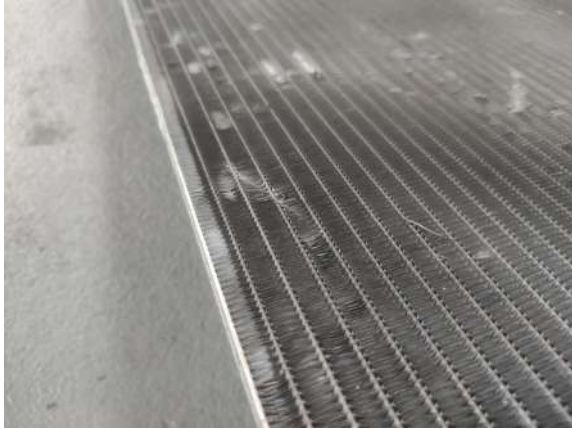



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

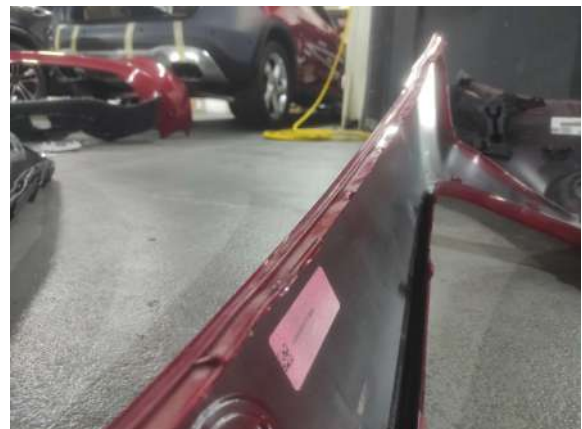



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

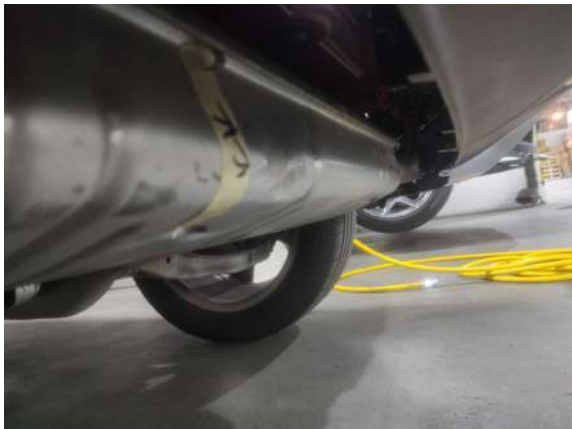



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

