

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/CTI21012393/GVY3N2**Date:** 16/12/2021**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMCVSNW00059592103	
Claimant Vehicle No :	JME5040	Insured Vehicle No :	GBH4168H	
Date of Loss:	23/11/2021	Nature of Claim:	TP	Claim No: SNM21D206816/C02/THAMYL

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	JME5040		Engine No:	G372EE008256
Make & Model:	YAMAHA FZ150I, 150cc		Chassis No:	PMYKG0250A0008256
Reg. Date:	18/05/2010 (Man. Year: 2010)		Odometer:	73387 km
Colour:	Red			
Engine Capacity:	150 cc			
Market Value/New Car Price:	N/A			
Sum Insured (\$\$):	Market Value/New Car Price			

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	90/80-17	Rear Tyre Size:	90/80-17
Front Left Side:	Timsun 5 mm	Rear Left Side:	Maxxis 5 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (\$\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	07/12/2021		Ong Motor Trading (MACPHERSON RD)
Date Inspected:	08/12/2021	Inspected At:	No. 464 Macpherson Road
Estimated Period of Repair:	3.0 days		Singapore 368182

Adjuster: XING GUO QIANG**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$1,500.00
-\$2,500.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 16 Dec 2021)	
Parts:	N/A	YAMAHA FZ150I 150cc (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for JME5040)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >