







WG APPRAISAL SERVICES

Blk 224B, Compassvale Walk, #07-647. Singapore 542224
Email: winsongkk@hotmail.com Contact: 9747 0063
Company Register No. 53326249J

ACCIDENT DAMAGED VEHICLE INSPECTION REPORT

M/S : SEET KIM LIAN KATHRYN
C/O MAX MOTORS
1 Kakit Bukit Ave 6, #01-98
Autobay @ Kakit Bukit .Singapore 417883.

Date : 29 June 2021
Our Ref : WG/TP/2021-109

REFERENCE PARTICULARS

Date of Accident : 14 June 2021
Date of Inspection : 14 June 2021

Type of Inspection : Third Party Claim
Date of Re-Inspn : 18 June 2021

VEHICLE PARTICULARS

Registration No : SLZ8974H
Make : HYUNDAI
Model : ACCENT (RB) 1.4 CVT
Year : 2018

Engine No : G4LCJU989055
Chassis No : KMHCU41BTJU430103
Odometer : 22026km
Colour : Silver

CONDITION OF VEHICLE (STATIC CHECKS AT TIME OF INSPECTION ONLY)

Engine condition : Good
Foot Brake : Serviceable
Hand Brake : Serviceable

General Body Work : Good
Steering : Serviceable
Lightings : Serviceable

TYRE CONDITION (Remaining estimated life of tyre in mm)

	<u>Make</u>	<u>Size</u>	<u>Thread Balance</u>
Front Near side	: Kumho	185/65R15	5 mm
Front Off Side	: Kumho	185/65R15	5 mm
Rear Near Side	: Kumho	185/65R15	5 mm
Rear off Side	: Kumho	185/65R15	5 mm

GENERAL DESCRIPTION OF DAMAGES

The vehicle sustained damage at the rear portions..
For details, refer to assessment for repairs and photographs attached.

ASSESSMENT SUMMARY

Our assessment of the repair costs to pre-accident condition was **S\$13,000.00** nett at lump sum basis.(Subject to GST if applicable)

Under normal circumstances, estimated period required for repairs : Fourteen (14) working days.

Enclosed One hundred and Seventy (170) photographs depicting damage to the vehicle.

Inspection conducted at : MAX MOTORS
1 Kakit Bukit Ave 6, #01-98 . Autobay @ Kakit Bukit .

In accordance to your instruction, we have **not** authorise repairs and inspection was conducted strictly on a "**WITHOUT PREJUDICE BASIS**".

VEHICLE NO : SLZ8974H
MODEL : ACCENT (RB) 1.4 CVT

Our Ref : WG/TP/2021-109

ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS

DESCRIPTION OF PARTS AND NATURE OF REPAIRS

A)	SPARE PARTS	QTY PC/SET	ASSESSED CONDITION		ORIGINAL QUOTATION	REVISED QUOTATION
01	BOOTLID	1	DENTED	\$	1,523.00	\$ 1,589.00
02	BOOTLID LOCK	1	JAMMED	\$	366.00	\$ 366.00
03	BOOTLID LOCK GARNISH	1	GRAZED	\$	70.00	\$ 70.00
04	BOOTLID CHROM MOULDING	1	CRACKED	\$	55.00	\$ 55.00
05	BOOTLID EMBLEM - ACCENT	1	NECESSARY	\$	43.00	\$ 43.00
06	BOOTLID EMBLEM LOGO	1	NECESSARY	\$	36.00	\$ 36.00
07	BOOTLID INSULATOR	1	DEFORMED	\$	104.00	\$ 104.00
08	BOOTLID HINGE	2	BENT	\$	119.00	\$ 119.00
09	BOOTLID STOPPER	2	NECESSARY	\$	40.00	\$ 40.00
10	BOOTLID WEATHERSTRIP	1	DEFORMED	\$	109.00	\$ 109.00
11	REAR BUMPER	1	CRACKED	\$	643.00	\$ 643.00
12	REAR BUMPER RETAINER	2	NECESSARY	\$	56.00	\$ 56.00
13	REAR BUMPER BRACKET	2	NECESSARY	\$	86.00	\$ 86.00
14	REAR BUMPER REINFORCEMENT	1	DENTED	\$	476.00	\$ 476.00
15	REAR BUMPER REFLECTOR LH	1	CRACKED	\$	64.00	\$ 64.00
16	REAR BUMPER REFLECTOR RH	1	CRACKED	\$	64.00	\$ 64.00
17	REAR LOCK SENSOR	1	CRACKED	\$	155.00	\$ 155.00
18	PDC SENSOR	4	MALFUNCTION	\$	420.00	\$ 420.00
19	SENSOR WIRE HARNESS	1	MALFUNCTION	\$	291.00	\$ 291.00
20	TAILLAMP LH	1	CRACKED	\$	428.00	\$ 428.00
21	TAILLAMP INNER SEAL LH	1	NECESSARY	\$	35.00	\$ 35.00
22	TAILLAMP RH	1	CRACKED	\$	428.00	\$ 428.00
23	TAILLAMP INNER SEAL RH	1	NECESSARY	\$	35.00	\$ 35.00
24	TAILLAMP PANEL LH	1	DENTED	\$	278.00	\$ 278.00
25	TAILLAMP PANEL RH	1	DENTED	\$	278.00	\$ 278.00
26	REAR FENDER LH	1	REPAIR	\$	2,010.00	\$ -
27	REAR FENDER RH	1	DENTED	\$	2,010.00	\$ 2,010.00
28	REAR FENDER INNER WHEELHOUSE PANEL	1	REPAIR	\$	890.00	\$ -
29	REAR FENDER INNER TRIM LH	1	TORN/DEFORMED	\$	118.00	\$ 118.00
30	REAR FENDER INNER TRIM RH	1	TORN/DEFORMED	\$	118.00	\$ 118.00
31	REAR FENDER INNER SHIELD LH	1	CRACKED	\$	153.00	\$ 153.00
32	REAR FENDER INNER SHIELD RH	1	CRACKED	\$	153.00	\$ 153.00
33	REAR WINDSCREEN MOULDING	1	NECESSARY	\$	57.00	\$ 57.00
34	END PANEL	1	DENTED	\$	699.00	\$ 699.00
35	END PANEL TOP GARNISH	1	DEFORMED	\$	155.00	\$ 155.00
36	FLOOR PANEL COMPARTMENT	1	DENTED	\$	533.00	\$ 533.00
37	SPARE TYRE TOP BOARD	1	DEFORMED	\$	429.00	\$ 429.00
38	REAR EXHAUST ASSY	1	BENT	\$	728.00	\$ 728.00
39	REAR EXHAUST HEAD SHIELD	1	DENTED	\$	74.00	\$ 74.00
40	REAR EXHAUST MOUNTING	2	NECESSARY	\$	60.00	\$ 60.00
41	REAR NUMBER PLATE LAMP	2	NOT NECESSARY	\$	98.00	\$ 98.00
42	REAR FENDER AIR VENT RH	1	CRACKED	\$	78.00	\$ 78.00
43	REAR TOOL BOX SPONGE	1	CRACKED	\$	159.00	\$ 159.00
				\$	14,724.00	\$ 11,890.00
				Less 20%	\$ 2,944.80	\$ 2,378.00
					\$ 11,779.20	\$ 9,512.00

B) S/NETT ITEM

44	REAR NUMBER PLATE	1	BENT	\$	90.00	\$	80.00
45	REAR BUMPER CLIP	1 SET	NECESSARY	\$	40.00	\$	30.00
46	BOOTLID INSULATOR CLIP	1 SET	NECESSARY	\$	30.00	\$	20.00
47	FENDER INNER TRIM CLIP	1 SET	NECESSARY	\$	40.00	\$	30.00
48	JOINT SELANT	1	NECESSARY	\$	120.00	\$	100.00
49	WINDSCREEN SEALANT	1	NECESSARY	\$	120.00	\$	100.00
50	FLOOR INSULATOR	1	NECESSARY	\$	120.00	\$	100.00
				\$	560.00	\$	460.00

Parts Total :

\$	12,339.20	\$	9,972.00
-----------	------------------	-----------	-----------------

C) LABOUR CHARGES & MISC

51	CHECK REAR WIRING AND LIGHTING SYSTEM	\$	90.00	\$	80.00
52	REMOVE AND RENEW REAR REVERSE SENSOR	\$	120.00	\$	100.00
53	REMOVE, REFIT REAR LINING , TRIM AND GARNISH	\$	200.00	\$	180.00
54	REMOVE AND RENEW REAR EXHAUST ASSY	\$	150.00	\$	130.00
55	REMOVE AND REFIT FUEL TANK	\$	150.00	\$	130.00
56	REMOVE AND RENEW FLOOR INSULATOR	\$	120.00	\$	100.00
57	REMOVE AND REFIT REAR WINDSCREEN	\$	150.00	\$	13.00
58	TRANSFER PARTS, ATTACHMENT FROM OLD BOOTLID TO NEW	\$	250.00	\$	200.00
59	PANEL BEATING AND RENEW DAMAGE PARTS ON AFFECTED AREAS	\$	3,500.00	\$	3,000.00
60	SPRAY PAINTING ON AFFECTED AREAS	\$	2,500.00	\$	2,200.00
61	APPLY ANTI RUST ON AFFECTED AREAS	\$	120.00	\$	100.00

Labour Total :

\$	7,350.00	\$	6,233.00
-----------	-----------------	-----------	-----------------

Total Parts and Laboure :

\$	19,689.20	\$	16,205.00
-----------	------------------	-----------	------------------

FINAL LUMP SUM ADJUSTMENT

\$	13,000.00
-----------	------------------

POINT OF IMPACT

The impact was confined to the rear portion of the vehicle.
The damages appeared to be consistent as per the accident report statement.
Please refer the attached schedule and photographs for details.

ADJUSTMENT/RECOMMENDATIONS

We have thoroughly inspected each and every item on the repairer's estimates against the actual damaged found on the vehicle. We have listed the breakdown of our findings and recommendations as per assessment above.

CONCLUSION

The repairer has agreed to undertake repair the vehicle at a lump sum basis of **S\$13,000 nett** corresponding to replacement of parts, spray painting and labour charges. We now revert for your decision on the above claim.

Yours faithfully

WG APPRAISAL SERVICES



Winson Goh
Automotive Appraiser

WG APPRAISAL SERVICES

Blk 224B, Compassvale Walk, #07-647.Singapore 542224

Email: Winsongkk@hotmail.com Contact: 9747 0063

Company Register No. 53326249J

Our Ref: WG/TP/2021-109
Invoice No: TP/MAX/2021-109 Date 29 June 2021
Vehicle No: SLZ8974H
Attn: SEET KIM LIAN KATHRYN
Company: MAX MOTORS
Address: 1 Kaki Bukit Ave 6, #01-98.Autobay @ Kakit Bukit .Singapore 417883

Invoice

Surveyor Fee:	S\$605
Re-inspection Fee:	S\$80
Transport:	S\$60
Photographs:	S\$170/- (@ \$1 per photo, total 170 photos)
Total:	S\$915

Surveyor:
Signature:
Date:

Winsong Goh

29 June 2021



RECORD MANAGEMENT CENTRE

GENERAL INSURANCE ASSOCIATION OF SINGAPORE

RECORDS MANAGEMENT CENTRE

6 Raffles Quay #18-00, Singapore 048580

Phone: +65 6224 0010 Fax: +65 6224 0030

Operating Hours: Monday to Friday 9am to 5pm

GST Registration No: M400017735

TAX INVOICE

Date of Request: 16/07/2021

Your Ref No: YSP8821001

Dear Sir/Madam,

Date of Accident: 14/06/2021 00:00 (SGT)

Vehicle No: SLZ8974h

Place of Accident: Upper Serangoon Rd, Singapore

With reference to your application for the accident report, we have attached the following accident report as requested:

DOCUMENTS	ACCIDENT LOCATION	PER DOC (\$)	QTY	AMOUNT (\$)
SLU5300Z	Upper Serangoon Rd, Singapore	(29.00)	1	(27.10)
GST Amount				(1.90)
Total Amount Due (GST Inclusive)				(29.00)

The images provided to you are taken from the original reports forwarded to the centre by the members of the General Insurance Association of Singapore and we take no responsibility for their accuracy or contents and shall be under no liability whatsoever for any loss or damage arising out of or in connection with the reports or their images.

Thank you.

This is a computer generated document and requires no signature.



Thank you

Chung Yee Shen has successfully logged out.

Your last login date and time was 16 Jun 2021, 15:50:07.

To return to ONE.MOTORING, please [click here](#)

For security reasons, please **CLEAR YOUR CACHE** after each session.

Session Transaction History

S/No. 	Asset Type 	Asset ID 	Asset Owner ID 	Transaction Type 	Transaction Amount(S\$) 
1	Vehicle	SLU5300Z	-	18.19 Enquire Veh Owner Info (Others) by Law Firm	7.49

