



ASS. REC. BY:

REF: UTZ/21012428/kny3

Kenneth

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
QD/TP/WS/TP RES/QD RES/EVA/INV/MY
 To Inspect Vehicle No: _____
 at Workshop m/s Thian Heq Heng
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

Veh No: XD 6284C Yr Regn: 12/10/2012
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 (Truck) Trailer or _____
 Make: Mit c.c. 12882
 Colour: Gold A/C: Insured / Std / NI / NA
 Sp. Reading: 572057 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: PV51TJA 00909
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Mod: Mil / S/Rim / STD A/Rim or

(Policy Condition)
 Remark: The veh had commenced its
 repair at the time of inspection.

N/S	O/S

Tyre Size: F: 295/80R22.5
 R: _____
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / TOY / SU / PIR / SUMI
 TOYO / YOKO or Fullrun

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: 01 days Res.: Yes or No
 Lum Sum: 20 % 3 Val.: Yes or No

Front R/Bal: 8 mm
 L/Bal: 8 mm
 D.O.A. 30/11/21
 Rear R/Bal: 88 mm
 L/Bal: 99 mm
 D.O.I. 7/3/2022

CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Survey held at _____
 Des. of Damages : Frt / Rear / O/S / N/S / UIC / Rooftop or
RM o/s dca mine
 The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
<u>16/5/23</u>	<u>WAS NOT ready</u>
	<u>85% Cab (Red, \$6480, 88%)</u>

Date/Time, File Pass 10? : Prell. Report
 : Final Report

Days Of Repair: 1
 Resurvey No. of Trip: 1

Add Fee: : Site Insp (\$)
 : Interview (\$)
 : Tech Invs (\$)
 : Weekend (\$)

Survey Fee:	_____
Transportation:	_____
S - RS - SI	_____
Fixes	_____
Others	_____
TOTAL	_____

Report Format :
 ump Sum / I.B.I: (\$

Thiam Heng Huat Pte Ltd


176 Sin Ming Drive #05-14 Sin Ming Autocare Singapore 575721

Mobile: (65) 8263 6295 Email: thiamhenghuat@gmail.com

Make/Model: MITSUBISHI FUSO
 Engine/Chassis No.: FV51JJA00909
 Date of accident:
 Damaged area: O/S

Date: 07/03/2022
 Claim Type: TP
 VRN: XD6284C

NOT Notified
11 Pk @ 8500
Return After Paint
1 day

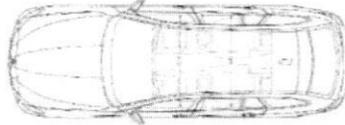

List items					
S/N	Parts description	QTY	UNIT PRICE	AMOUNT	
1	Wing mirror assy o/s <i>981-cu CM</i>	1	\$ 3,800.00	\$	3,800.00 ✓
2	Wing mirror assy motor o/s	1	\$ 3,200.00	\$	3,200.00 X
3	Wing mirror assy glass o/s	1	\$ 200.00	\$	200.00 X
Subtotal				\$	7,200.00
List discount					10.00%
Total				\$	6,480.00

Labour			
No.	Description	Work unit	Amount
1	To dismantle / renew accident damaged portion. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	2	\$ 400.00 <i>1000</i>
2	To disconnect rear wire harness of electrical components to facilitate repairs, reconnect and check functions.	0.25	\$ <i>an</i> 50.00 X
3	Supply spray paint material and necessary items to respray affected area / panel.	2	\$ 400.00 <i>800</i>
Total labour			\$ 850.00

Estimate Grand Total	\$	7,330.00
-----------------------------	----	-----------------

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date: