

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/CTI21012648/T1VY3N2**Date:** 16/12/2021**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMCVSNW00123992100	
Claimant Vehicle No :	FR2269M	Insured Vehicle No :	GBJ9287D	
Date of Loss:	06/12/2021	Nature of Claim:	TP	Claim No: SNM21D207100/C02/TANCHC

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	FR2269M		Engine No:	NC42E1402624
Make & Model:	HONDA CB400, 399cc		Chassis No:	NC421902616
Reg. Date:	31/12/2018 (Man. Year: 2018)		Odometer:	45963 km
Colour:	White/Red			
Engine Capacity:	399 cc			
Market Value/New Car Price:	N/A			
Sum Insured (\$\$):	Market Value/New Car Price			

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	130/70R17	Rear Tyre Size:	160/60R17
Front Left Side:	Michelin 5 mm	Rear Left Side:	Michelin 5 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (\$\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	14/12/2021		
Date Inspected:	14/12/2021	Inspected At:	H L Cycle Pte Ltd (HQ) 1 Kaki Bukit Avenue 6, #02-58 Autobay Singapore 417883
Estimated Period of Repair:	5.0 days		

Adjuster: MOHD TAUFIKH BIN HAMID**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000.00
-\$5,000.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 16 Dec 2021)	
Parts:	N/A	HONDA CB400 399cc (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FR2269M)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >