



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SFR 5087B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	FRONT BUMPER	CUT	550.00	550.00
1	SET FRONT BUMPER CLIPS	NECESSARY	30.00	30.00
1	FRONT HEADLAMP LH	CRACKED	680.00	680.00
1	FRONT FOG LAMP LH	CRACKED	293.10	212.60
1	FRONT COWLING LH	CUT	119.20	119.20
1	FRONT FENDER LH	TO REPAIR SEE LABOUR	539.30	-
1	FRONT WHEEL HOUSE LH	TO REPAIR SEE LABOUR	485.00	-
1	STEERING RACK AND PINION	BENT	2,812.70	1,820.00
1	FRONT DRIVE SHAFT LH	SERVICEABLE	290.00	-
1	FRONT SHOCK ABSORBER LH	SERVICEABLE	288.40	-
1	FRONT KNUCKLE ARM LH	DISTORTED	394.10	394.10
1	FRONT KNUCKLE ARM BEARING LH	NECESSARY	141.40	141.40
1	FRONT ANTI-ROLL BAR LH	SERVICEABLE	220.00	-
1	FRONT STEERING CROSS MEMBER	SERVICEABLE	2,719.70	-
1	FRONT ANTI-ROLL BAR LINK LH	BENT	91.70	91.70
1	FRONT ANTI-ROLL BAR BUSH LH	NECESSARY	30.20	30.20
1	FRONT LOWER ARM LH	BENT	298.40	298.40
	LESS 20% DISCOUNT		-1,996.64	-873.52
			7,986.56	3,494.08
<b><u>SPECIAL NETT ITEMS</u></b>				
1	FRONT WHEEL RIM LH (SN)	TO REPAIR SEE LABOUR	580.00	-
1	SIDE SKIRT LH (SN)	DISTORTED	800.00	400.00
1	FRONT WHEEL TYRE LH (SN)	CUT	380.00	160.00
			1,760.00	560.00

Report Ref No. CS3/ASM21012296/Vqy3e2-1



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>LABOUR</b>			
	PANEL BEAT FRONT LEFT WHEELHOUSE. STRAIGHTEN FRONT LEFT CHASSIS. REMOVE AND REPLACE ALL DAMAGED PARTS. INCLUSIVE OF THE REPAIR OF FRONT FENDER LH, FRONT WHEEL HOUSE LH AND FRONT WHEEL RIM LH.		1,000.00	400.00
	COMPUTERISE WHEEL ALIGNMENT.		150.00	60.00
	REMOVE AND REINSTALL FRONT LEFT UNDERCARRIAGE.		380.00	100.00
	CHECK LIGHTINGS AND WIRING.		50.00	20.00
	MOUNT VEHICLE ON MEASURING BENCH TO CORRECT CHASSIS ALIGNMENT.	NOT NECESSARY	380.00	-
	RUST PROOFING TREATMENT ON AFFECTED AREA.		160.00	40.00
	SPRAY PAINTING ON AFFECTED AREA.		1,000.00	500.00
	TOWING CHARGE.		120.00	60.00
			3,240.00	1,180.00
	<b>GRAND TOTAL</b>		<b>12,986.56</b>	<b>5,234.08</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>4,200.00</b>

Report Ref No. CS3/ASM21012296/Vqy3e2-1

THEVAN THOMAS KARTHIKESAVAN

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.