

# LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CS3/AIG21012725/BTF3E2

**Date:** 21/01/2022

### REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd.

Policy No:

**Claimant Vehicle No :** SKJ7972R

**Insured Vehicle No :** SJZ8838S

Date of Loss: 10/12/2021

Nature of Claim: TP

Claim No: 2644018738SG

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SKJ7972R**

Make & Model: TESLA MODEL 3, 2.0 E (A)

Engine No: HIDDEN

Reg. Date: 22/09/2021 (Man. Year: 2021)

Chassis No: LRW3F7EL9MC282941

Colour: Blue

Odometer: 2140 km

Engine Capacity: 0 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification:

No Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size: 235/35 R20

Rear Tyre Size: 235/35 R20

Front Left Side: Pirelli 6 mm

Rear Left Side: Pirelli 6 mm

Front Right Side: Pirelli 6 mm

Rear Right Side: Pirelli 6 mm

*The above values represent the remaining tyre treads depth*

| COST OF CLAIMS           | Repairer's  | Adjuster's  | Difference  | Diff % |
|--------------------------|-------------|-------------|-------------|--------|
| Parts                    | 0.00        | 0.00        | 0.00        |        |
| Miscellaneous Items      | 0.00        | 0.00        | 0.00        |        |
| Labour                   | 0.00        | 0.00        | 0.00        |        |
| Paintwork Labour         | 0.00        | 0.00        | 0.00        |        |
| Towing                   | 0.00        | 0.00        | 0.00        |        |
| <b>Nett Amount (S\$)</b> | <b>0.00</b> | <b>0.00</b> | <b>0.00</b> |        |

### INSPECTION

Date of Assignment: 16/12/2021

Date Inspected: 16/12/2021

Inspected At:

Assure Auto (HQ)  
B14 AMK BLK B 569116  
Singapore 569116

Estimated Period of Repair: 4.0 days

**Adjuster:** Lim Teow Guan

**Manager:** DENISE TAY KWEE CHENG

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

MARKET VALUE: \$194,000.00 (EST)

THIS IS AN ELECTRICAL VEHICLE.

# REPAIR DETAILS

## Recommended Parts

| No.                | Qty | Part No. | Particulars                  | Condition     | Repairer's | Amount |
|--------------------|-----|----------|------------------------------|---------------|------------|--------|
| 1                  | 1   |          | *REAR BUMPER                 | Broken        | 0.00 F     | *- F   |
| 2                  | 1   |          | *REAR BUMPER SIDE RETAINER   | Necessary     | 0.00 F     | *- F   |
| 3                  | 1   |          | *REAR RH FENDER              | Dented        | 0.00 F     | *- F   |
| 4                  | 1   |          | *REVERSE SENSOR              | Short Circuit | 0.00 F     | *- F   |
| 5                  | 1   |          | *REAR RH FENDER INNER SHIELD | Torn          | 0.00 F     | *- F   |
| F=Franchise part.  |     |          |                              |               |            |        |
| Total Parts (\$\$) |     |          |                              |               | 0.00       | 0.00   |

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

There are no labour items selected.

|   |
|---|
| Report was unsubmitted during this print-out. |
|---|

< END OF ESTIMATES >