

ASS. REC. BY:

Tang JH

REF:

CT1

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____

4116K

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

WP O/S

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: _____

SSM 3014

Yr Regn: _____

2018 / July

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: _____

Toyota Hawker G. c.c. 1998

Colour

Black

A/C: Insured / Std / NI / NA

Sp. Reading

73694

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: _____

JTEKRS36H00J002598

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size: _____

F: 235/55R18

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MID / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

6

mm

Rear

6

mm

R/Bal. _____

R/Bal. _____

L/Bal. _____

mm

L/Bal. _____

mm

D.O.A. _____

D.O.I. _____

15/12/21

Survey held at

Ryder Auto.

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Frt + N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐ : Prel. Report☐ : Final Report

1)

Date/Time, File Return to?

2)

Report Format: _____

Lump Sum / L.B.H. (?) _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: ☐

Site Insp (\$ _____)

☐

Interview (\$ _____)

☐

Tech. Invs (\$ _____)

☐

Weekend (\$ _____)

Survey Fee: _____

Transportation: _____

S + RS. \$ _____

Photos _____

Others _____

TOTAL



2 Kaki Bukit Ave 2, #02 19/22 AutoHub @ Kaki Bukit, Singapore 417921

Email: ryderautoworkshop@gmail.com

Tel: 67418277 Fax: 67468277

ESTIMATE OF REPAIR

Veh# : SJM301U
Accident Date : 15/12/2021
Location : DEFU LANE 10 CARPARK

Model: TOYOTA HARRIER
(30/7/2018)
ERV: S\$65,012
3P: PC6568J (China Taipei)

S/Nos.	Qty	Description	List \$	S/Nett \$	Nett \$
1	1 pc	Front bumper <i>de</i>	1,186.00		
2	10 pcs	Front bumper clips <i>ne</i>		50.00	<i>30</i>
3	1 pc	Front bumper n/s sponge	40.30		
4	1 pc	Front bumper n/s retainer <i>de</i>	109.00		
5	1 pc	Front n/s fender <i>ht</i>	1,446.30		
6	1 pc	Front n/s day time running light	922.30		
7	1 pc	Front n/s fender wheel guard	523.40		
8	6 pcs	Front n/s fender wheel guard clips		30.00	
9	1 pc	Front n/s head lamp <i>mt</i>	6,714.50		
		Sub Total:	10,941.80	80.00	0.00
			25%	0%	10%
		After Less %:	8,206.35	80.00	0.00
		Labour			
1		To dismantle damaged parts, straighten & welding.	800.00	<i>450</i>	
2		To spray painting.	700.00	<i>600</i>	
3		To check for fault code and resetting	280.00	<i>180</i>	
4		To check wiring.	80.00	<i>30</i>	
5		To re seal anti rust.	100.00	<i>30</i>	
		Sub Total:	1,960.00		
		Total:	10,246.35		
		After Less 20%:	8,197.08		

Chan San Choon
Director
Dip.Lng, AAE MIMI, NSAC (Aust)



AL 8778 1999



LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Tan/ku 97415749
up' 15/12/21 @ 5:15pm
HS Resurvey after repair
Tan/ku @ lkkauto.com
3-4 days