

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI21012758/UTY3N2**Date:** 06/01/2022**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMCVSNW00083412101	
Claimant Vehicle No :	SLX4941P	Insured Vehicle No :	XE5790J	
Date of Loss:	13/12/2021	Nature of Claim:	TP	Claim No: SNM21D207262/C02/THAMYL

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLX4941P		Engine No:	D4FDJH550864
Make & Model:	KIA CARENS, 1.7 (A)		Chassis No:	KNAHU815VJ7203631
Reg. Date:	29/03/2018 (Man. Year: 2018)		Odometer:	312077 km
Colour:	Grey			
Engine Capacity:	1685 cc			
Market Value/New Car Price:	N/A			
Sum Insured (S\$):	Market Value/New Car Price			

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55R16	Rear Tyre Size:	205/55R16
Front Left Side:	DURATURN 6 mm	Rear Left Side:	DURATURN 6 mm
Front Right Side:	DURATURN 6 mm	Rear Right Side:	DURATURN 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	23,334.50	15,327.30	8,007.20	34.31
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,520.00	3,660.00	860.00	19.03
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	27,854.50	18,987.30	8,867.20	31.83
Approved Total (Overridden) (S\$)		15,000.00		
(S\$)	27,854.50	15,000.00	12,854.50	46.15
+ GST 7.00/7.00% (S\$)	1,949.82	1,050.00	899.82	46.15
Nett Amount (S\$)	29,804.32	16,050.00	13,754.32	46.15

INSPECTION

Date of Assignment:	22/12/2021		
Date Inspected:	15/12/2021	Inspected At:	Tan Lim Motor Pte Ltd (Defu) 1 Defu Lane 6 Singapore 539365
Estimated Period of Repair:	14.0 days		

Adjuster: MARCUS CHUA**Manager:** DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 06 Jan 2022)
Parts:	M1-MPV	KIA CARENS 1.7 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLX4941P)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Distorted	452.00 FL	*452.00 FL
2	8		*REAR BUMPER CLIP	Necessary	40.00 FL	*40.00 FL
3	1		*REAR BUMPER LOWER	Grazed	190.00 FL	*190.00 FL
4	1		*N/S REAR BUMPER REFLECTOR	Serviceable	104.00 FL	*- FL
5	1		*N/S REAR BUMPER SIDE RETAINER	Bent	23.00 FL	*23.00 FL
6	1		*REAR BUMPER PARKING SENSOR	Shorted	147.00 FL	*147.00 FL
7	1		*REAR BUMPER DIFFUSER	Repair	162.00 FL	*- FL
8	1		*REAR BUMPER BEAM	Cracked	331.00 FL	*331.00 FL
9	3		*REAR BUMPER BRACKET-LOWER	Not Necessary	30.00 FL	*- FL
10	1		*N/S TAILLAMP	Not Necessary	321.00 FL	*- FL
11	1		*TAILGATE LID	Dented	1,219.00 FL	*1,218.00 FL
12	1		*N/S TAILGATE REFLECTOR	Not Necessary	193.00 FL	*- FL
13	1		*TAILGATE CARENS LETTERING	Necessary	32.00 FL	*32.00 FL
14	1		*TAILGATE CRDI LETTERING	Necessary	26.00 FL	*26.00 FL
15	1		*N/S REAR FENDER	Repair	1,349.00 FL	*- FL
16	1		*N/S REAR FENDER STICKER	Scratched	12.00 FL	*12.00 FL
17	1		*REAR AXLE	Bent/Twisted	1,161.00 FL	*1,160.00 FL
18	1		*N/S REAR RIM	Cut	546.00 FL	*546.00 FL
19	1		*N/S REAR DOOR	Repair	978.00 FL	*- FL
20	1		*N/S FRONT DOOR	Repair	1,098.00 FL	*- FL
21	1		*N/S FRONT FENDER INNER COWLING	Missing	68.00 FL	*68.00 FL
22	1		*N/S FRONT KNUCKLE ARM	Bent	311.00 FL	*311.00 FL
23	1		*N/S FRONT LOWER ARM	Bent	387.00 FL	*387.00 FL
24	1		*N/S FRONT WHEEL BEARING	Damaged	214.00 FL	*214.00 FL
25	1		*N/S FRONT LOWER ARM BALL JOINT	Not Necessary	85.00 FL	*- FL
26	1		*N/S FRONT ABSORBER	Bent	302.00 FL	*302.00 FL
27	1		*N/S FRONT DRIVE SHAFT	Not Necessary	838.00 FL	*- FL
28	1		*N/S FRONT ANTI ROLL BAR LINKAGE	Not Necessary	85.00 FL	*- FL
29	1		*N/S FRONT RIM	Cut	546.00 FL	*546.00 FL
30	1		*O/S SIDE MIRROR	Damaged	589.00 FL	*589.00 FL
31	1		*O/S FRONT DOOR	Distorted	1,098.00 FL	*1,098.00 FL
32	1		*O/S FRONT DOOR OUTER HANDLE	Broken	176.00 FL	*176.00 FL
33	1		*O/S FRONT DOOR OUTER HANDLE EXTENSION	Broken	24.00 FL	*24.00 FL
34	1		*O/S FRONT DOOR KEY LOCK	Damaged	85.00 FL	*85.00 FL
35	1		*O/S FRONT DOOR OUTER CHROME MOULDING	Bent	43.00 FL	*43.00 FL
36	1		*O/S FRONT DOOR LOCK	Jammed	239.00 FL	*239.00 FL
37	1		*O/S FRONT DOOR HINGE-TOP	Serviceable	30.00 FL	*- FL
38	1		*O/S FRONT DOOR HINGE-BOTTOM	Serviceable	30.00 FL	*- FL
39	1		*O/S FRONT DOOR CHECKER	Serviceable	45.00 FL	*- FL
40	1		*O/S FRONT DOOR WEATHERSTRIP	Necessary	95.00 FL	*95.00 FL
41	1		*O/S FRONT DOOR INNER TRIM BOARD	Deformed/Torn	873.00 FL	*873.00 FL
42	1		*O/S FRONT DOOR GLASS	Broken	174.00 FL	*174.00 FL
43	1		*O/S FRONT DOOR GLASS WEATHERSTRIP	Bent	106.00 FL	*106.00 FL
44	1		*O/S FRONT DOOR GLASS POWER WINDOW MOTOR	Bent	280.00 FL	*280.00 FL
45	1		*O/S FRONT DOOR GLASS POWER WINDOW REGULATOR	Jammed	207.00 FL	*207.00 FL
46	1		*O/S FRONT DOOR FRAME STICKER-FRONT	Necessary	15.00 FL	*15.00 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
47	1		*O/S FRONT DOOR FRAME STICKER-TOP	Necessary	15.00 FL	*15.00 FL
48	1		*O/S FRONT DOOR FRAME STICKER-REAR	Necessary	15.00 FL	*15.00 FL
49	1		*O/S FRONT DOOR FRAME WEATHERSTRIP	Not Necessary	126.00 FL	*- FL
50	1		*O/S FRONT DOOR KEY PLATE	Not Necessary	24.00 FL	*- FL
51	1		*O/S REAR DOOR	Distorted	978.00 FL	*975.00 FL
52	1		*O/S REAR DOOR OUTER HANDLE	Cut	48.00 FL	*48.00 FL
53	1		*O/S REAR DOOR OUTER CHROME MOULDING	Bent	53.00 FL	*53.00 FL
54	1		*O/S REAR DOOR LOCK	Jammed	207.00 FL	*207.00 FL
55	1		*O/S REAR DOOR WEATHERSTRIP	Necessary	104.00 FL	*104.00 FL
56	1		*O/S REAR DOOR INNER TRIM BOARD	Deformed/Torn	697.00 FL	*697.00 FL
57	1		*O/S REAR DOOR GLASS POWER WINDOW MOTOR	Jammed	161.00 FL	*161.00 FL
58	1		*O/S REAR DOOR GLASS POWER WINDOW REGULATOR	Bent	180.00 FL	*180.00 FL
59	1		*O/S REAR DOOR GLASS	Broken	217.00 FL	*217.00 FL
60	1		*O/S REAR DOOR GLASS WEATHERSTRIP	Not Necessary	107.00 FL	*- FL
61	1		*O/S REAR DOOR FRAME STICKER-FRONT	Necessary	15.00 FL	*15.00 FL
62	1		*O/S REAR DOOR FRAME STICKER-TOP	Necessary	15.00 FL	*15.00 FL
63	1		*O/S REAR DOOR FRAME STICKER-REAR	Necessary	15.00 FL	*15.00 FL
64	1		*O/S REAR DOOR HINGE-TOP	Bent	25.00 FL	*25.00 FL
65	1		*O/S REAR DOOR HINGE-BOTTOM	Bent	25.00 FL	*25.00 FL
66	1		*O/S REAR DOOR CHECKER	Bent	31.00 FL	*31.00 FL
67	1		*O/S REAR DOOR FRAME WEATHERSTRIP	Not Necessary	124.00 FL	*- FL
68	1		*O/S REAR DOOR KEY PLATE	Not Necessary	29.00 FL	*- FL
69	1		*O/S REAR RIM	Cut	546.00 FL	*546.00 FL
70	1		*O/S REAR ABSORBER	Bent	200.00 FL	*200.00 FL
71	1		*O/S REAR WHEEL BEARING WITH HUB	Damaged	325.00 FL	*325.00 FL
72	1		*O/S REAR FENDER	Badly Dented	1,349.00 FL	*1,349.00 FL
73	1		*O/S REAR FENDER INNER COWLING	Not Necessary	202.00 FL	*- FL
74	8		*O/S REAR FENDER INNER COWLING CLIP	Necessary	40.00 FL	*40.00 FL
75	1		*O/S REAR FENDER MUDFLAP-FRONT	Deformed	15.00 FL	*15.00 FL
76	1		*O/S REAR FENDER STICKER	Necessary	15.00 FL	*15.00 FL
77	1		*O/S B PILLAR }	Badly Dented	1,864.00 FL	*1,600.00 FL
78	1		*O/S ROCKER PANEL }		1,729.00 FL	*- FL
79	1		*TAILGATE C&C EMBLEM	Necessary	55.00 FS	*40.00 FS
80	1		*N/S REAR TYRE	Serviceable	250.00 FS	*- FS
81	1		*N/S FRONT TYRE	Not Necessary	250.00 FS	*- FS
82	1		*O/S REAR TYRE	Not Necessary	250.00 FS	*- FS
83	1		*O/S REAR 1/4 GLASS PRIMER	Necessary	80.00 FS	*40.00 FS
84	1		*O/S REAR 1/4 GLASS SEALANT	Necessary	80.00 FS	*40.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	25,820.00	17,017.00
- List Item Discount on L Items 10.00/10.00% (\$)	2,485.50	1,689.70
Total Parts (\$)	23,334.50	15,327.30

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REINSTALL OF REAR BUMPER PARKING SENSOR	New	80.00	50.00
2	TO REMOVE UPHOLESTERY	New	150.00	80.00
3	TO REMOVE AND REFIT N/S 1/4 GLASS	New	100.00	80.00
4	TO TRANSFER OF DOOR FITTINGS AND PERFORM WATER SEEPAGE TEST	New	160.00	120.00
5	TO RUST-PROOFING OF THE AFFECTED AREAS	New	300.00	120.00
6	TO CHECK ELECTRICAL LIGHTING CONCERNED	New	100.00	30.00
7	TO TRANSFER OF TYRE,RIM AND ON WHEEL BALANCING	New	150.00	0.00
8	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT	New	80.00	80.00
9	TO DROP REAR AXLE AND SUSPENSION ASSY,REMOVE AND RENEWAL OF NECESSARY PARTS,TO CONDUCT FINAL CHECKING AND TESTING	New	200.00	200.00
10	PANEL BEATING,KNOCKING AND STRAIGHTEN THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME	New	1,600.00	1,400.00
11	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION	New	1,400.00	1,380.00
12	TO DROP FRONT SUSPENSION UNDERCARRIAGE PARTS,REMOVE AND RENEWAL OF THE NECESSARY PARTS,TO PERFORM FINAL CHECKING AND TESTING	New	200.00	120.00
Gross Labour Cost (\$)			4,520.00	3,660.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >