

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780

Hotline: 6385 1171

Our reference:

21-8316

Date:

28/11/2021

c/o Freesion Autodrive 25 Kaki Bukit Road 4 Synergy @ KB #03-33 Singapore 417800

Dear Sirs

RE:

Road Traffic Accident on 15/11/2021

Koh Boon Hock LLP

In accordance with your instructions received in this office on

15/11/2021 , we made arrangements to

examine the vehicle on

15/11/2021

at above-mentioned address. The following data was

recorded:

Vehicle details

Make	Honda	Registration	SKH5535T
Model	Civic	Chassis	JHMFD26408S201378
Colour	Gold	Gearbox	Auto
Odometer	341437km	Paintwork Good	
Steering	In order	Brakes In order	
Condition	Good		

Tyre Depths

Front left	225/45R17	85% Toyo
Front right	225/45R17	85% Toyo
Rear left	225/45R17	85% Toyo
Rear right	225/45R17	85% Toyo

Status	REPAIRABLE
Magnitude	Medium
Legal status	Unroadworthy

Impact Direction & Area of Damage:



Following our examination of the accident damage, we have calculated repair times and method, which are \$6,000.00 and detailed on page 2 & 3. We would recommend a sum of for repair, which is sufficiently lower than the pre accident value to render the vehicle an economically and physically reliable proposition.

Subsidiaries of Impact Analysis Consultant:

- ◆ Impact Analysis Consulting Pte Ltd
 ◆ Impact Analysis Academy Pte Ltd
 ◆ IA Racking Solutions Pte Ltd
- IA Accounting & Consultancy Pte Ltd
 Infoknights International Services (Philippines)
 IABN Pte Ltd www.iaconsultingsg.com



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 417800 Hotline: 6385 1171

Our reference

21-8316

Date

28/11/2021

Page

2

Section A: Damaged Parts Assessment

Section A: Dai	nageu	rai to Assessinent		
Part's Description	Qty		airer's imate	Our Adjustment
List Items:		Torn		
Rear bumper	1	torn.deformed	645.50	645.50 -
Rear bumper side retainer Ih	1	broken.nec CN	22.80	22.80 -
Rear fender Ih	1	bent.deep-cut /	895.40	895.40
Rear windscreen glass moulding	1	necessary 11	112.80	112.80
Rear door lh	1	bent.warped R	865.40	865.40 🗴
Rear door inner lock Ih	1	damaged na	205.40	205.40 🗶
Rear door outer protector lh	1	damaged wooled	124.80	124.80
Rear door outer handle cover lh	1	scratched 11	96.80	96.80
Rear door weatherstrip	1	ripped.nec n 🔨	175.80	175.80
Rocker panel lh	1	repair.	552.00	0.00
Fail lamp lh	1	refix SUC	225.90	0.00
Rear wheel bearing Ih	1	necessary Dyld	166.00	166.00_
Rear wheel bearing hub lh	1	necessary Dayled	198.70	198.70
Rear shock absorber lh	1	rebuilt su	301.00	0.00
	ub- Tota	l costs	4588.30	3509.40
Percentage d			917.66	701.88
		s for parts	3670.64	2807.52
Special Nett Items:				
Rocker panel side skirt lh	1	bent.deep-cut AL	628.80	628.80
Rear tyre rim lh	1	cut Cu)	559.80	559.80
Rear windscreen sealant	1	necessary $\sqrt{\ }$	50.00	50.00
Rear bumper clips	set	necessary nuc	45.00	20.00
	1	necessary $\wedge \wedge$	40.00	40.00
Rear fender sealant	1	serviceable.refix $\wedge \wedge$	250.00	0.00
Reverse sensor			1573.60	1298.60
Sub-T	otai cost	s for parts	1575.00	1250.00
Parts Repair				0.00
*	*	*	0.00	0.00
9	Sub-Tota	l costs	0.00	0.00
		for parts	5244.24	4106.12

Subsidiaries of Impact Analysis Consultant:

Impact Analysis Consulting Pte Ltd
 Impact Analysis Academy Pte Ltd
 IA Racking Solutions Pte Ltd

[●] IA Accounting & Consultancy Pte Ltd ● Infoknights International Services (Philippines) ● IABN Pte Ltd www.iaconsultingsg.com



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 417800 Hotline: **6385 1171**

Our reference

21-8316

Date

28/11/2021

Page

3

Section B: Labour Cost Calculation

		Manhr. Req.	Total	
To dismantle, replace, cut, weld, knock out dents to straighten accident parts as-mentioned on the 'Parts Repair' column inclusive of replacement parts.	\$ 45.00	23	\$ 1,035.00	6
Putty & Spray painting to adjacent panels. Job allowance. Paint / material. (5 panels)	Sub-cor	tract work.	\$ 1,100.00	5
Apply rust proofing on the adjacent panels.	Sub-cor	tract work.	\$ 80.00	1
Wiring and bulb checking	\$ 45.00	0.8	\$ 36.00	1
Remove and refix rear windscreen glass. (2-man job)	\$ 45.00	3.5	\$ 157.50	1
Conduct water leak test for rear portion associated repair works	\$ 45.00	1	\$ 45.00	1
Remove and replace rear undercarriage work lh	\$ 45.00	4	\$ 180.00	1.
Transfer of existing rear door mechanism to new door lh	\$ 45.00	2	\$ 90.00	1
Remove and refix rear bumper reverse sensor & conduct distance safety setting.	\$ 45.00	1.7	\$ 76.50	3
	Total la	bour cost	\$ 2,800.00	

Manhour rate and the number of manhours required for each repairing task are formulated based on individual workshop'. operating cost and in-house@ IA Research Guidelines respectively.

P-1157-8 202 P-926.24 5.N 1208-6 2-1720 3824-84 3083.

Subsidiaries of Impact Analysis Consultant:

• Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd

◆ IA Accounting & Consultancy Pte Ltd
 ◆ Infoknights International Services (Philippines)
 ◆ IABN Pte Ltd
 www.iaconsultingsg.com



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 417800

Hotline: 6385 1171

Our reference

21-8316

Date

28/11/2021

Section C: Summary Table of Total Repair Cost

Description Damaged Parts Assessment (See section A)		Cost	
		\$4,106.12	
Further discount	20%	\$821.22	
Recommended cost of parts replacement		\$3,284.90	(1)
Labour Cost Calculation (See section B)		\$2,800.00	(2)
Total Repair Cost (Round off to hundred)		\$6,000.00	(1) + (2)

We would recommend a sum oj	\$6,000.00	and	7	working days for repair.
No further items will be approved	without our expre	essed written agre	ement. Any s	ignificant additional
items will be subject to a supplem	entary report.			

Mechanical Engineer, Accident Expert Witness, Licensed Appraiser (Automobile)

B.Eng. (Hons, NUS)

Diploma. Mechanical Engineering

NTC-2 Automovite Technology

Sr.MIES, Institution of Engineers, Singapore (#20100091)

MATAI, Maryland Association of Traffic Accident Investigators

IAARS, International Association of Accident Reconstruction Specialists

PMC of Singapore Business Advisors & Consultants Council

ACTA certified Trainer, Singapore

SPRING- Recognised Certification for Management Consultants

Subsidiaries of Impact Analysis Consultant:

Impact Analysis Consulting Pte Ltd
 Impact Analysis Academy Pte Ltd
 IA Racking Solutions Pte Ltd

 IA Accounting & Consultancy Pte Ltd
 Infoknights International Services (Philippines)
 IABN Pte Ltd www.iaconsultingsg.com