1/27/22, 10:04 AM Adjuster Report

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CTI21012778/EQY3N2

27/01/2022 Date:

REFERENCE

China Taiping Insurance Handling Insurer:

(Singapore) Pte. Ltd.

Policy No:

DMPCSNW00212052100

Claimant Vehicle

SNC1306E

Insured Vehicle No:

SML6036R

No: Date of Loss:

Reg. Date:

11/12/2021

Nature of Claim: TP

Claim

SNM21D207349/C02/TANKW

DESCRIPTION & IDENTIFICATION OF VEHICLE

SNC1306E Reg No:

Make & Model: SKODA KAROQ, 1.5 TSI AMBITION (A)

Engine No: DAD675160 29/09/2021 (Man. Year: 2021) Chassis No:

Odometer:

TMBFK6NW4M3102619

7319 km

Colour: Black

Engine Capacity: 1498 cc N/A Market Value/New Car Price:

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): **Engine Modification:** Pre-accident Condition: Yes Nο

CONDITION OF TYRES

Front Tyre Size: 205/50 R17 Rear Tyre Size: 205/50 R17 Front Left Side: Rear Left Side: Michelin 5 mm Michelin 5 mm Front Right Side: Rear Right Side: Michelin 5 mm Michelin 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,040.00	2,400.00	1,640.00	40.59
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	4,040.00	2,400.00	1,640.00	40.59
+ GST 7.00/7.00% (S\$)	282.80	168.00	114.80	40.59
Nett Amount (S\$)	4,322.80	2,568.00	1,754.80	40.59

INSPECTION

Date Inspected:

Date of Assignment: 24/01/2022

Volkswagen Group Singapore Pte Ltd

247 ALEXANDRA ROAD

Singapore 159934

Estimated Period of Repair: 3.0 days

Adjuster: **CHEN TSUE YEE** Manager: SHIAU CHAN

22/12/2021

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

Inspected At:

1/27/22, 10:04 AM Adjuster Report

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 26 Jan 2022)

Parts: 144 SKODA KAROQ 1.5 TSI AMBITION (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SNC1306E)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with

the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Lab</u>	our Items			
1	B&P DIAGNOSIS AND PROGRAMMING	New	480.00	480.00
2	B&P CHECK SHORT CIRCUIT/HARNESS REPAIR	New	280.00	280.00
3	LABOUR	New	1,680.00	840.00
4	SPRAY PAINTING	New	1,600.00	800.00
		Gross Labour Cost (S\$)	4,040.00	2,400.00
	Report was unsub	pmitted during this print-out.		

< END OF ESTIMATES >