



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. FBE 1294L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	HANDLE BAR	NOT NECESSARY	125.00	-
1	HANDLE BAR BRACKET	NOT NECESSARY	95.00	-
1	BRAKE LEVER	NOT NECESSARY	76.00	-
1	SET MIRROR	N/S DISLODGE / O/S NOT NECESSARY	110.00	65.00
1	HEAD LAMP ASSY	DENTED / CRACKED	380.00	380.00
1	BRAKE PEDAL	NOT NECESSARY	68.00	-
1	BRAKE PUMP RESERVOIR	NOT NECESSARY	190.00	-
1	CLUTCH LEVER	CUT	65.00	65.00
1	FRONT SIGNAL LH	BROKEN	68.00	68.00
1	FRONT MUDGUARD	BROKEN	135.00	135.00
1	FRONT BRAKE CALIPER	SERVICEABLE	150.00	-
1	BRAKE DISC	NOT NECESSARY	250.00	-
1	SET FORK TUBE	BENT	480.00	480.00
1	FRONT BRACKET	DAMAGED	250.00	250.00
1	SET RIM	TO REPAIR SEE LABOUR	480.00	-
1	FUEL TANK	DENTED	280.00	280.00
1	GEAR PEDAL	BENT	68.00	68.00
1	LH TANK PANEL - GUARD	BROKEN	180.00	180.00
1	FRONT FOOTREST N/S	DAMAGED	85.00	85.00
1	FRONT WHEEL SHAFT	NOT NECESSARY	85.00	-
1	EXHAUST PIPE	SERVICEABLE	750.00	-
1	EXHAUST GUARD	NOT NECESSARY	160.00	-
1	BATTERY BOX	BROKEN	250.00	250.00
1	HEAD LAMP BRACKET	BENT	180.00	180.00
1	SET FRONT REFLECTOR	N/S CUT	60.00	30.00
1	REAR LH SIGNAL	BROKEN	75.00	75.00
	LESS 10% DISCOUNT		-509.50	-259.10
			4,585.50	2,331.90

Report Ref No. CS/AGI21012789/Dtf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	REAR BOX (SN)	CUT	150.00	120.00
1	FRONT NUMBER PLATE (SN)	CUT	15.00	10.00
1	METER ASSY (SN)	BROKEN	650.00	300.00
1	IU UNIT (SN)	BROKEN	170.00	150.00
			985.00	580.00
	<u>LABOUR</u>			
	TOWING FEE	NOT NECESSARY	50.00	-
	REMOVE AND REPLACE PARTS, ALIGN AND ETC.INCLUSIVE OF THE REPAIR OF SET RIM.		280.00	150.00
	REMOVE AND REPLACE FORK & BRACKET, FORK OIL SEAL,TOP UP FORK OIL.		150.00	80.00
	SUPPLY BODY STICKER.		120.00	30.00
	PUTTY AND RESPRAY PAINT.		250.00	50.00
			850.00	310.00
GRAND TOTAL			6,420.50	3,221.90

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			2,500.00
---	--	--	-----------------

Report Ref No. CS/AGI21012789/Dtf3n2

ANG BRYAN TANI

Automotive Assessor / Investigator

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.