#### LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

#### VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG21012949/GTF3E2

12/01/2022 Date:

**REFERENCE** 

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2070179457 **Claimant Vehicle** 

SNB1183Y Insured Vehicle No: SMX1770Z No:

Date of Loss: 17/12/2021 Nature of Claim: TP Claim No: 8729578743SG

**DESCRIPTION & IDENTIFICATION OF VEHICLE** 

Reg No: **SNB1183Y** 

Make & Model: HYUNDAI AVANTE, 1.6 (A) G4FMMU034971 Engine No:

Reg. Date: 30/07/2021 (Man. Year: 2021) Chassis No: KMHLN41ETNU201487

Colour: Odometer: 2481 km Grey

**Engine Capacity:** 1598 cc Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price** 

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Engine Modification: Pre-accident Condition: Yes No

CONDITION OF TYRES

Front Tyre Size: 225/45 R17 Rear Tyre Size: 225/45 R17 Kumho 9 mm Front Left Side: Rear Left Side: Kumho 9 mm Front Right Side: Kumho 9 mm Rear Right Side: Kumho 9 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

**INSPECTION** 

Date of Assignment: 21/12/2021

Assure Auto (HQ) Date Inspected: 28/12/2021 Inspected At:

B14 AMK BLK B 569116

Singapore 569116

Estimated Period of Repair: 4.0 days

XING GUO QIANG DENISE TAY KWEE CHENG Adjuster: Manager:

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

MARKET VALUE: \$105,000.00 (EST)

## **REPAIR DETAILS**

# **Recommended Parts**

No.	Qty Part No.	Particulars	Condition	Repairer's	Amount
1	1	*REAR NUMBER PLATE LAMP	Broken	0.00 F	*-F
2	1	*REAR BUMPER UPPER	Broken	0.00 F	*- F
3	1	*REAR BUMPER LOWER	Broken	0.00 F	*- F
4	1	*REAR BUMPER CLIPS	Necessary	0.00 F	*- F
5	1	*REAR BUMPER REINFORCEMENT	Cracked	0.00 F	*- F
6	1	*REAR BUMPER LAMP	Broken	0.00 F	*- F
7	2	*REAR BUMPER MOULDING	Cut	0.00 F	*- F
8	1	*REAR BUMPER REFLECTOR	Deformed	0.00 F	*- F
9	1	*REVERSE SENSOR	Not Working	0.00 F	*- F
10	1	*REAR END PANEL	Repair	0.00 F	*- F
F=Fra	anchise part.				
			Total Parts (S\$)	0.00	0.00
		Report was unsubmitted du	uring this print-out.		

### Recommended Miscellaneous Items

There are no new miscellaneous items selected.

### **Recommended Labour**

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >