

# LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CS3/AIG21012966/R1TF3E2

**Date:** 11/01/2022

### REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd.

Policy No:

**Claimant Vehicle No :** SMT3262G

**Insured Vehicle No :** SFB312T

Date of Loss: 16/12/2021

Nature of Claim: TP Claim No: 7026837814SG

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMT3262G**

Make & Model: HONDA SHUTTLE, 1.5 (A)

Engine No: L15B6022804

Reg. Date: 15/04/2020 (Man. Year: 2019)

Chassis No: GK82102387

Colour: White

Odometer: 32622 km

Engine Capacity: 1496 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes  
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size: 185/60 R15

Rear Tyre Size: 185/60 R15

Front Left Side: Bridgestone 6 mm

Rear Left Side: Bridgestone 6 mm

Front Right Side: Bridgestone 6 mm

Rear Right Side: Bridgestone 6 mm

*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

### INSPECTION

Date of Assignment: 22/12/2021

Date Inspected: 22/12/2021 Inspected At:

Fix Auto Pte Ltd (HQ)

5 SOON LEE STREET, #01-61 PIONEER POINT

Singapore 627607

Estimated Period of Repair: 3.0 days

**Adjuster:** MOHD RASUL

**Manager:** DENISE TAY KWEE CHENG

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

MARKET VALUE: \$81,000.00 (EST)

# REPAIR DETAILS

## Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT BUMPER	Repair	0.00 F	*- F
2	1		*FRT LH FENDER	Bent	0.00 F	*- F
3	1		*FRT LH FENDER INNER SHIELD	Deformed	0.00 F	*- F
4	1		*FRT LH WHEEL CAP	Cut	0.00 F	*- F
F=Franchise part.						
Total Parts (\$\$)					0.00	0.00

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.
---

< END OF ESTIMATES >