



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2204703

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 29/07/2022
Reference CC6/CTI21012971/Aga3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMN 3804A
Insured Veh. SLX 4360R
Claim No. SNM21D207368
Policy No. DMPCSNW00193222100
Accident Date 17/12/2021
Inspection Date 20/12/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21012971/Aga3q2 Date: 29/07/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLX 4360R	Veh. Inspected	SMN 3804A	
Policy No.	DMPCSNW00193222100	Coverage (\$)	0.00	
Claim No.	SNM21D207368	Excess (\$)	0.00	
Assign From		Assign Date	20/12/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS C	c.c	1497	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	JTDKD3B3101570203	Colour	SILVER	
Odometer	170917 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/55 R15	YOKOHAMA	6 mm	
L/H Front Tyre	195/55 R15	YOKOHAMA	6 mm	
R/H Rear Tyre	195/55 R15	YOKOHAMA	6 mm	
L/H Rear Tyre	195/55 R15	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	17/12/2021	Inspection Date	20/12/2021	
Survey held at	XIN HUA WORKSHOP PTE LTD 23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING) SINGAPORE 415933			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			11 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMN 3804A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	DEFORMED	987.60	987.60
1	FRONT BUMPER LOGO	NECESSARY	75.80	75.80
2	FRONT BUMPER FOGLAMP @\$241.70	NOT NECESSARY	483.40	-
2	FRONT BUMPER FOGLAMP GARNISH @\$95.60	NOT NECESSARY	191.20	-
2	FRONT BUMPER SIDE LAMP @\$158.90	NOT NECESSARY	317.80	-
1	FRONT BUMPER TOWING COVER	NOT NECESSARY	28.90	-
1	FRONT BUMPER CENTER GRILLE	NOT NECESSARY	205.90	-
1	FRONT BUMPER CENTER COVER GARNISH	TORN	271.50	271.50
1	FRONT BUMPER LOWER GRILLE	NOT NECESSARY	215.10	-
1	FRONT BUMPER TOP RUBBER	NOT NECESSARY	25.10	-
1	FRONT BUMPER TOP BEAM	NOT NECESSARY	248.10	-
1	FRONT BUMPER BOTTOM COVER GARNISH	NOT NECESSARY	168.70	-
1	FRONT BUMPER SPONGE	CRACKED	70.30	70.30
1	FRONT BUMPER REINFORCEMENT	DENTED	345.70	345.70
2	FRONT BUMPER SIDE RETAINER @\$115.80	NECESSARY	231.60	231.60
1	FRONT NUMBER PLATE GARNISH	DEFORMED	102.85	102.85
1	FRONT FENDER COWLING	NOT NECESSARY	294.60	-
2	HEADLAMP @\$1863.20	CRACKED	3,726.40	3,726.40
1	FRT BONNET	DENTED	1,792.10	1,792.10
1	FRT BONNET INSULATOR	NOT NECESSARY	317.80	-
1	BONNET LOCK	NOT NECESSARY	95.30	-
1	FRONT SUPPORT PANEL	BUCKLED	1,006.20	760.00
1	FRONT BRACE PANEL	BENT	175.60	175.60
2	HORN @\$122.80	NOT NECESSARY	245.60	-
1	RADIATOR	NOT NECESSARY	2,072.86	-
1	RADIATOR UPPER AIR GUARD	DEFORMED	126.20	126.20
2	RADIATOR SIDE GARNISH @\$85.80	NOT NECESSARY	171.60	-
1	AIR CON CONDENSER	DENTED	1,783.90	1,783.90
4	AIR CON CONDENSER MOUNTING RUBBER @\$25.60	NOT NECESSARY	102.40	-
1	FRONT TEMPERATURE SENSOR	NOT NECESSARY	135.70	-
1	TAILGATE	DENTED	1,059.60	1,059.60

Report Ref No. CC6/CTI21012971/Aga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAILGATE INNER LOCK	DAMAGED	448.30	385.00
1	TAILGATE LOCK CATCH	NOT NECESSARY	36.20	-
1	TAILGATE OUTER MOULDING	NOT NECESSARY	195.30	-
1	TAILGATE WEATHERSTRIP	CUT	298.40	298.40
1	TAILGATE LOGO	NECESSARY	45.90	45.90
1	TAILGATE EMBLEM 'TOYOTA'	NECESSARY	64.60	64.60
1	TAILGATE EMBLEM 'PRIUS-C'	NECESSARY	58.35	58.35
1	TAILGATE EMBLEM 'HYBRID'	NECESSARY	65.20	65.20
1	TAILGATE INNER HOLDER	NOT NECESSARY	57.70	-
1	TAILGATE INNER BOARD	NOT NECESSARY	385.60	-
1	TAILGATE KEY LOCK SENSOR	CRACKED	195.30	195.30
1	TAILGATE WINDSCREEN GLASS	NOT NECESSARY	1,120.70	-
1	REAR BUMPER	DEFORMED	794.70	794.70
1	REAR BUMPER CENTER BOTTOM GARNISH	TORN	165.70	165.70
1	REAR BUMPER REINFORCEMENT	BENT	395.90	395.90
2	REAR BUMPER REINFORCEMENT BRACKET @\$118.20	DENTED	236.40	236.40
2	REAR BUMPER SIDE RETAINER @\$69.80	NECESSARY	139.60	139.60
2	TAILLAMP @\$376.70	CRACKED	753.40	753.40
2	TAILLAMP LOWER BRACKET @\$69.30	NOT NECESSARY	138.60	-
2	REAR FENDER INNER COWLING @\$124.10	NOT NECESSARY	248.20	-
2	REAR FENDER INNER TRIM @\$478.7	NOT NECESSARY	957.40	-
1	REAR END PANEL	DENTED	566.90	566.90
1	REAR END PANEL TOP GARNISH	CRACKED	198.90	198.90
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	894.70	-
1	REAR FLOOR PANEL TOP BOARD	NOT NECESSARY	369.10	-
1	REAR SPARE TYRE BOLT	NOT NECESSARY	46.80	-
1	REAR TOOLS TRAY	NOT NECESSARY	232.50	-
1	CENTER EXHAUST	NOT NECESSARY	1,997.60	-
1	CENTER EXHAUST INSULATOR	NOT NECESSARY	172.50	-
1	SET CENTER EXHAUST GASKET	NOT NECESSARY	60.40	-
1	REAR EXHAUST PIPE	TO REPAIR SEE LABOUR	890.10	-
1	REAR EXHAUST INSULATOR	NOT NECESSARY	59.50	-

Report Ref No. CC6/CTI21012971/Aga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET REAR EXHAUST GASKET	NOT NECESSARY	60.40	-
4	REAR EXHAUST MOUNTING @\$39.80	NOT NECESSARY	159.20	-
1	REVERSE SENSOR WIRE HARNESS	NOT NECESSARY	575.40	-
	LESS 25% DISCOUNT		-7,540.22	-3,968.35
			22,620.64	11,905.05
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	60.00	30.00
1	SET REAR BUMPER CENTER BOTTOM GARNISH CLIP (SN)	NOT NECESSARY	50.00	-
1	TAILGATE SEALANT (SN)	NOT NECESSARY	80.00	-
1	SET TAILGATE OUTER MOULDING CLIP (SN)	NOT NECESSARY	30.00	-
1	SET TAILGATE INNER BOARD CLIP (SN)	NECESSARY	60.00	30.00
1	TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	80.00	60.00
1	TAILGATE WINDSCREEN INNER SHIELD (SN)	NOT NECESSARY	60.00	-
1	TAILGATE WINDSCREEN SOLAR FILM (SN)	NOT NECESSARY	250.00	-
1	SET TAILLAMP CLIP (SN)	NECESSARY	40.00	40.00
1	SET REAR FENDER INNER COWLING CLIP (SN)	NOT NECESSARY	60.00	-
1	SET REAR FENDER INNER TRIM CLIP (SN)	NOT NECESSARY	60.00	-
1	SET REAR FENDER INNER COWLING CLIP (SN)	NOT NECESSARY	50.00	-
1	REAR END PANEL INSULATION SEAL (SN)	NECESSARY	150.00	60.00
1	SET REAR END PANEL TOP GARNISH CLIP (SN)	NECESSARY	50.00	10.00
1	REAR FLOOR PANEL INSULATION SEAL (SN)	NOT NECESSARY	250.00	-
1	REVERSE SENSOR (SN)	DAMAGED	250.00	200.00
1	FRONT NUMBER PLATE (SN)	BENT	80.00	50.00
1	SET FRONT BUMPER CLIP (SN)	NECESSARY	80.00	30.00
1	SET FRONT BUMPER FOGLAMP GARNISH CLIP (SN)	NOT NECESSARY	60.00	-
1	SET FRONT BUMPER CENTER GRILLE CLIP (SN)	NOT NECESSARY	60.00	-
1	SET FRONT BUMPER CENTER COVER GARNISH CLIP (SN)	NOT NECESSARY	60.00	-
1	SET FRONT BUMPER LOWER GRILLE CLIP (SN)	NOT NECESSARY	60.00	-
1	SET FRONT BUMPER BOTTOM COVER GARNISH CLIP (SN)	NOT NECESSARY	60.00	-
1	SET FRONT NUMBER PLATE GARNISH CLIP (SN)	NOT NECESSARY	60.00	-

Report Ref No. CC6/CTI21012971/Aga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT SUPPORT PANEL SEALANT (SN)	NECESSARY	120.00	50.00
1	SET RADIATOR SIDE GARNISH CLIP (SN)	NOT NECESSARY	60.00	-
1	SET FRONT FENDER COWLING CLIPS (SN)	NOT NECESSARY	80.00	-
1	RADIATOR COOLANT (SN)	NECESSARY	80.00	40.00
			2,490.00	600.00
	LABOUR			
	TO PANEL BEAT ,REMOVE AND REPLACE PARTS.INCLUSIVE OF THE REPAIR OF REAR FLOOR PANEL AND REAR EXHAUST PIPE .		2,800.00	1,800.00
	TO SPRAY PAINT AFFECTED AREA.		2,600.00	1,400.00
	TUFF COAT.		220.00	80.00
	CHARGE UP AC GAS.		200.00	60.00
	REMOVE & REFIT RADIATOR CONDUCT PRESSURE TEST.		120.00	60.00
	REALIGN & REFOCUS HEADLAMP.	NOT NECESSARY	120.00	-
	WIRING AND BULB CHECK.		180.00	60.00
	REMOVE AND REFIX CUSHION SEAT/ UPHOLSTERY & ROOF LINING TO FACILITATE REPAIR.		180.00	60.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.		100.00	50.00
	TRANSFER TAILGATE MECHANISM .		200.00	80.00
	CONDUCT WATER LEAKAGE TEST.	NOT NECESSARY	100.00	-
	REMOVE AND REFIX REAR EXHAUST PIPE .	NOT NECESSARY	180.00	-
	REMOVE AND REFIX TAILGATE WINDSCREEN.		180.00	120.00
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	280.00	-
			7,460.00	3,770.00
GRAND TOTAL			32,570.64	16,275.05

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			13,000.00
---	--	--	------------------

Report Ref No. CC6/CTI21012971/Aga3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMN 3804A

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMN 3804A

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

