

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI21013002/EVY3N2**Date:** 07/01/2022**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMHCSNA00001882102

Claimant Vehicle No : PA7310P **Insured Vehicle No :** SMJ6345J

Date of Loss: 21/12/2021 Nature of Claim: TP Claim No: SNM21D207436/C02/TAYHP

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **PA7310P**

Make & Model: ISUZU LT134P, 7.8 D (A) Engine No: 6HK1454426

Reg. Date: 12/11/2007 (Man. Year: 2007) Chassis No: JALLT134P77000132

Colour: Grey Odometer: 539321 km

Engine Capacity: 7790 cc

Market Value/New Car Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 295/80R22.5 Rear Tyre Size: 295/80R22.5

Front Left Side: Dunlop 4 mm Rear Left Side: Dunlop 4 mm

Front Right Side: Dunlop 4 mm Rear Right Side: Dunlop 4 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	4,280.00	2,250.00	2,030.00	47.43
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,200.00	950.00	250.00	20.83
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	5,480.00	3,200.00	2,280.00	41.61
Approved Total (Overridden) (\$\$)		2,550.00		
(\$\$)	5,480.00	2,550.00	2,930.00	53.47
+ GST 7.00/7.00% (\$\$)	383.60	178.50	205.10	53.47
Nett Amount (\$\$)	5,863.60	2,728.50	3,135.10	53.47

INSPECTION

Date of Assignment: 21/12/2021

Date Inspected: 22/12/2021 Inspected At: Connect3 (HQ)
566 Woodlands Road
Singapore 728697

Estimated Period of Repair: 5.0 days

Adjuster: CHEN TSUE YEE**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 06 Jan 2022)	
Parts:	N/A	ISUZU LT134P 7.8 D (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for PA7310P)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Broken	2,750.00 F	*2,500.00 FL
2	1		*REAR BUMPER INNER STRUCTURE	Not Necessary	980.00 F	*- FL
3	1		*REAR BUMPER RH BRACKET	Not Necessary	550.00 F	*- FL
						F=Franchise part. L=ListItemDisc.
					Sub Total (S\$)	4,280.00 2,500.00
					- List Item Discount on L Items 0.00/10.00% (S\$)	0.00 250.00
					Total Parts (S\$)	4,280.00 2,250.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR CHARGES	New	600.00	400.00
2	SPRAY PAINTING	New	600.00	550.00
Gross Labour Cost (S\$)			1,200.00	950.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >