

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CC4/AIG21013029/KEA3Q2**Date:** 28/06/2022REFERENCE

|                              |                                      |                             |              |
|------------------------------|--------------------------------------|-----------------------------|--------------|
| Handling Insurer:            | AIG Asia Pacific Insurance Pte. Ltd. | Policy No:                  | 7210038562   |
| <b>Claimant Vehicle No :</b> | SFR9919A                             | <b>Insured Vehicle No :</b> | GBH3999H     |
| Date of Loss:                | 18/12/2021                           | Nature of Claim:            | TP           |
|                              |                                      | Claim No:                   | 0772088135SG |

DESCRIPTION & IDENTIFICATION OF VEHICLE

|                             |                                                     |             |                   |
|-----------------------------|-----------------------------------------------------|-------------|-------------------|
| Reg No:                     | <b>SFR9919A</b>                                     |             |                   |
| Make & Model:               | JAGUAR XF, 2.2 I4D AUTO ABS D/AB 2WD 4DR HID TC (A) | Engine No:  | 4032215224DT      |
| Reg. Date:                  | 19/11/2013 (Man. Year: 2013)                        | Chassis No: | SAJAC0565DDU00306 |
| Colour:                     | Metallic Pearl Blue                                 | Odometer:   | 192900 km         |
| Engine Capacity:            | 2179 cc                                             |             |                   |
| Market Value/New Car Price: | N/A                                                 |             |                   |
| Sum Insured (\$\$):         | <b>Market Value/New Car Price</b>                   |             |                   |

CONDITION OF VEHICLE AT THE TIME OF SURVEY

|                          |                         |                      |                          |                         |
|--------------------------|-------------------------|----------------------|--------------------------|-------------------------|
| General Condition:       | Steering (Serviceable): | Yes                  | Footbrake (Serviceable): | Yes                     |
| Handbrake (Serviceable): | Yes                     | Engine Modification: | No                       | Pre-accident Condition: |

CONDITION OF TYRES

|                   |               |                  |               |
|-------------------|---------------|------------------|---------------|
| Front Tyre Size:  | 245/45 R18    | Rear Tyre Size:  | 245/45 R18    |
| Front Left Side:  | Goodyear 8 mm | Rear Left Side:  | Goodyear 8 mm |
| Front Right Side: | Goodyear 8 mm | Rear Right Side: | Goodyear 8 mm |

*The above values represent the remaining tyre treads depth*

| <b>COST OF CLAIMS</b>                            | <b>Repairer's</b> | <b>Adjuster's</b> | <b>Difference</b> | <b>Diff %</b> |
|--------------------------------------------------|-------------------|-------------------|-------------------|---------------|
| Parts                                            | 13,102.90         | 10,864.71         | 2,238.19          | 17.08         |
| Miscellaneous Items                              | 0.00              | 0.00              | 0.00              |               |
| Labour                                           | 3,340.00          | 2,100.00          | 1,240.00          | 37.13         |
| Paintwork Labour                                 | 0.00              | 0.00              | 0.00              |               |
| Towing                                           | 0.00              | 0.00              | 0.00              |               |
| <b>Calculated Gross Total (\$\$)</b>             | <b>16,442.90</b>  | <b>12,964.71</b>  | <b>3,478.19</b>   | <b>21.15</b>  |
| <b>Approved Total (Overridden) (\$\$)</b>        |                   | <b>10,300.00</b>  |                   |               |
| <b>(\$\$)</b>                                    | 16,442.90         | 10,300.00         | 6,142.90          | 37.36         |
| <b>+ GST 7.00/7.00% (\$\$)</b>                   | 1,151.00          | 721.00            | 430.00            | 37.36         |
| <b>Nett Amount (\$\$)</b>                        | <b>17,593.90</b>  | <b>11,021.00</b>  | <b>6,572.90</b>   | <b>37.36</b>  |
| <b>+ Car Rental (6.0 x S\$140.00/day) (\$\$)</b> |                   | 840.00            |                   |               |
| <b>Nett Liability (\$\$)</b>                     |                   | <b>11,861.00</b>  |                   |               |
| <b>Global Sum Settlement (\$\$)</b>              |                   | <b>11,860.00</b>  |                   |               |

INSPECTION

|                             |            |                                                                                                                     |
|-----------------------------|------------|---------------------------------------------------------------------------------------------------------------------|
| Date of Assignment:         | 22/12/2021 |                                                                                                                     |
| Date Inspected:             | 22/12/2021 | Inspected At: Motor Edgevantage Pte Ltd (HQ)<br>160 Sin Ming Drive, Sin Ming AutoCity #03-01/02<br>Singapore 575722 |
| Estimated Period of Repair: | 6.0 days   |                                                                                                                     |

**Adjuster:** KENNETH KONG**Manager:** Asher Sng Rong Yi

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Recommended Parts

| No. | Qty | Part No. | Particulars                             | Condition         | Repairer's | Amount       |
|-----|-----|----------|-----------------------------------------|-------------------|------------|--------------|
| 1   | 2   |          | *JAGUAR SRS AIRBAG MODULE XF            | Activated         | 3,718.00 F | *3,718.00 FL |
| 2   | 1   |          | *JAGUAR BONNET HINGE RH XF              | Distorted         | 210.00 F   | *210.00 FL   |
| 3   | 1   |          | *JAGUAR BONNET HINGE LH XF              | Distorted         | 210.00 F   | *210.00 FL   |
| 4   | 1   |          | *JAGUAR FRONT BONNET LOCK RH XF         | Dented            | 310.00 F   | *310.00 FL   |
| 5   | 1   |          | *JAGUAR FRONT BONNET LOCK LH XF         | Repair            | 310.00 F   | *- FL        |
| 6   | 2   |          | *JAGUAR BONNET STRUT XF                 | Repair            | 448.00 F   | *- FL        |
| 7   | 2   |          | *JAGUAR FRONT IMPACT SENSOR XF          | Necessary         | 370.00 F   | *370.00 FL   |
| 8   | 1   |          | *JAGUAR HEADLAMP ASSEMBLY XF            | Cracked           | 2,860.00 F | *2,860.00 FL |
| 9   | 1   |          | *JAGUAR FRONT HEADLAMP SUPPORT PANEL XF | Bent              | 1,980.00 F | *1,980.00 FL |
| 10  | 1   |          | *JAGUAR FRONT BUMPER ASSEMBLY XF        | Buckled / Cracked | 2,170.00 F | *2,170.00 FL |
| 11  | 1   |          | *JAGUAR FRONT BUMPER LOWER GRILLE RH XF | Serviceable       | 273.00 F   | *- FL        |
| 12  | 1   |          | *JAGUAR FRONT BUMPER SIDE BRACKET XF    | Distorted         | 85.40 F    | *85.40 FL    |
| 13  | 1   |          | *JAGUAR FRONT BUMPER TOW EYE COVER XF   | Cracked           | 73.60 F    | *73.60 FL    |
| 14  | 1   |          | *JAGUAR FRONT BUMPER LID RH XF          | Cracked           | 84.90 F    | *84.90 FL    |

F=Franchise part. L=ListItemDisc.

|                                                   |           |           |
|---------------------------------------------------|-----------|-----------|
| Sub Total (S\$)                                   | 13,102.90 | 12,071.90 |
| - List Item Discount on L Items 0.00/10.00% (S\$) | 0.00      | 1,207.19  |
| Total Parts (S\$)                                 | 13,102.90 | 10,864.71 |

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

| No                              | Particulars                                                                                                                                                                          | Lab.Type | Repairer's      | Amount          |
|---------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|-----------------|-----------------|
| <b>Labour Items</b>             |                                                                                                                                                                                      |          |                 |                 |
| 1                               | TO REMOVE ,INSTALL ,INSTALL FRONT BONNET LH AND RH AIR BAGS MODULES,FRONT BOTH BONNET HINGES ,BONNET STRUT ,BONNET LOCKS ,IMPACT SENSORS,FRONT BUMPER ,HEADLAMP ,FRONT SUPPORT PANEL | New      | 1,200.00        | 750.00          |
| 2                               | TO PUTTY ,SPRAY PAINT FRONT BUMPER ,BOTH FRONT HINGE ,FRONT BONNET ,FRONT FENDER RH                                                                                                  | New      | 1,600.00        | 1,000.00        |
| 3                               | TO DOWNLOAD SOFTWARE ON AIRBAG MODULE CHECK WIRING ,CONTACT DIAGNOSTIC USING EQUIPMENT TOOLS TO RUM THROUGH AIR BAG (SRS) SYSTEM                                                     | New      | 400.00          | 250.00          |
| 4                               | TOWING CHARGES ON DOLLY FROM UPPER THOMSON ROAD TO WORKSHOP (ACCIDENT TOW)                                                                                                           | New      | 140.00          | 100.00          |
| <b>Gross Labour Cost (\$\$)</b> |                                                                                                                                                                                      |          | <b>3,340.00</b> | <b>2,100.00</b> |

Report was unsubmitted during this print-out.

< END OF ESTIMATES >