Auto Insure Pte. Ltd 6 Marsiling Lane 739145

Insurer Reference: SJM2728J

Repairer Reference: M3792 / SJM2728J Date calculated: 22/12/2021 3:12 PM



Full Report Registration: SJM2728J

Printed: 22/12/2021 3:12 PM

Summary Information

Claim

Location:

Singapore (SG)

Work Provider:

China Taiping Insurance

(Singapore) Pte Ltd

Printed by:

Siew Meng Hui

5

Currency:

SGD 15/12/21

Claim Reference: Estimated Repair Time:

SJM2728J 5

Date of Incident:

Hire Car Start:

Hire Car End:

Actual Repair Days:

Vehicle Details

Vehicle Manufacturer:

MITSUBISHI COLT (Z30) VERSION-R

Sub Model: Model Sheet Number:

Model:

32 62 32

Registration:

SJM2728J

VIN number:

JMYXTZ27A8Z000153

Odometer:

212073

Model Specs

6-SPEED GEARBOX

5-DOOR


hicle Condition

ehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

All Underbody

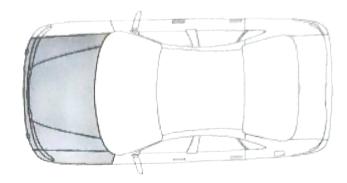

Tyres Condition

Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Tyre Brand

mm

Condition

mm

mm

mm

mm

Middle), mm

Spare Tyre Brand

Tread (Spare), mm

Labour	Time Base 10 WU/h	Price = 42.	.00 SGD/h
Code	Description	WU	Price SGD
	PREPARATION TIME	2.0	8.40
NO NUMBER	ADJUST HEADLAMPS	2.0	8.40
NO NUMBER	R + R FRONT BUMPER	8.0	33.60
514110 10	R + R FRONT BUMPER ATTACHED PARTS	2.0	8.40
514121 10)	** * **********************************	12.0	50.40
422022 10)	R + R L/F WING INCLUDES: R + R HEADLAMP AND WHEELARCH TRIM		
321110 10)	R + R AXLE CROSSMEMBER INCLUDES: R + R STEERING GEAR, FRONT EXHAUST PIPE AND STABILIZER	20.0	84.00
NO NUMBER	ALIGN + ADJUST FRONT	10.0	42.00
8863	GEARBOX HOUSING CHECK		
8884	CLUTCH HOUSING CHECK		
1003	GEARBOX OIL CHECK 7		60.00*

	Total of Labour				295.20
Paint					
Paint Work	SYSTEM AZT		Time Basis 10 WU/h		
Code	Description			WU	Price SGD
	L/F WING NEW PART PAINTING			10.0	
	FRONT BUMPER COVER NEW PART PAINT K1R	\		7.0	
	LEFT DOOR REPAIR PAINTING >50%			23.0	
	L/FR WHEEL SURFACE PAINT			4.0	
Paint Materia	l Per Part				
Code	Description				Price SGD
0741	L/F WING NEW PART PAINTING				16.52
0283	FRONT BUMPER COVER NEW PART PAINT K1F	}			21.29
1481	LEFT DOOR REPAIR PAINTING >50%				26.96
7201	L/FR WHEEL SURFACE PAINT				1.41
	Labour Cost - Paint	42 00 CCD (I	Hrs	wu	Price SGD
	Factor	42.00 SGD/h		44.0	
	Time Paint		1.70	44.0 17.0	71.40
	Preparation Main Work Metal Preparation Comp. Work Plastic		0.30	3.0	12.60
	Total	10 WU/h	6.40	64.0	268.80

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01 Price SGD
1004	FDR WHEEL GARNISH L		Supplementary	90.00
7011	FRONT AXLE SUPPORT	7 MR594001	Original	950.00
0283	FRONT BUMPER COVER	/6400G592 HZ	Original	250.00
0391	FRT LWR BUMPER COVER / WT	6400C106 "	Original	250.00
0561	L/F HEADLAMP CBL 7	8301B181	Original	350.00
0841	L/F MUDFLAP	MN186249	Original	80.00

Labour Cost

Fixed Rate Alignment

Panel / Mechanical Labour

Measuring Work

Material Cost - Paint New Part Painting

Surface-/Blend Paint

Material-constant Metal

Material-constant Plastic

Repair Painting

Total

New Part Painting - Plastic K1R

WU

46.0

10.0

193.20

60.00

42.00

Price SGD

16.52

21.29

26.96

18.10

93.28

1.41

9.00

Hrs

4.60

1.00

17 141 053	L/F UPP BUMPER BRKT 6400C107 D. OLL/F WING 5220D221	art Source riginal riginal riginal	90.00 30.00 300.00 300.00
f: OEM Parts n: Non-OEM Parts	Savings Subtotal		0.00 2,600.00
u: Used parts	Total		2,600.00
Extras			Price SGD
Code	Description		Price 3db
1000 1001 1002	BUMPER CLIPS FRONT FOR INR SHIELD CLIPS FRONT WHEEL TYRE LH FRONT Total Extras	(rof.) 161	30.00* 20.00* 230.00* 280.00
Final Calcul	ation	SGD	SGD
Parts Total Parts		2,600.00	2,600.00
	Base 10 WU/h WU X 42.00 SGD/h	193.20 60.00	
Measuring Total of Labor		42.00	295.20
Total Of Extra	s		280.00
Labour Cost Material Cos	Time Base 10 WU/h 64.0 WU X 42.00 SGD/h t cluding Material	268.80 93.28	362.08
GST (+7.00 Repair Cost I	%)		3,537.28 247.61 3,784.89
Deduction F	Excludes GST) or Excess actions (Excludes GST)	-500.00	-500.00
Grand Total E			3,037.28
GST (+7.00 Grand Total I	%) Included GST		212.61 3,249.89

Comments

* - USER SUPPLIED DATA NN - NO MANUFACTURERS CODE EXISTS) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

Hoys.

Impson Repair

After repair photos.

Not Authorized.

Exass: 0

Guo Qianp - 82880282

H/12/2/.

LKK Auto Consultants hence notify

- the Repairer of the following:
- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from insurance Company

Acknowledged by Repairer

Signature:

Date: