

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI21013155/AVY3N2**Date:** 09/02/2022REFERENCE

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMCVSNW00084442100

Claimant Vehicle No : SLN5429Z **Insured Vehicle No :** GR3388J

Date of Loss: 24/12/2021 Nature of Claim: TP **Claim No:** SNM21D207576/C02/TANKW

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLN5429Z**

Make & Model: HONDA VEZEL HYBRID, 1.5 x (A) Engine No: LEB5936750

Reg. Date: 08/05/2017 (Man. Year: 2017) Chassis No: RU31236738

Colour: White Odometer: 168610 km

Engine Capacity: 1496 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 225/45R17 Rear Tyre Size: 225/45R17

Front Left Side: Michelin 6 mm Rear Left Side: Michelin 6 mm

Front Right Side: Michelin 6 mm Rear Right Side: Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	28,132.10	16,041.60	12,090.50	42.98
Miscellaneous Items	0.00	0.00	0.00	
Labour	7,270.00	4,380.00	2,890.00	39.75
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	35,402.10	20,421.60	14,980.50	42.32
Approved Total (Overridden) (S\$)		16,300.00		
Nett Amount (S\$)	35,402.10	16,300.00	19,102.10	53.96

INSPECTION

Date of Assignment: 29/12/2021

Date Inspected: 28/12/2021 Inspected At: Automobile Hub Enterprise
1 KAKI BUKIT AVENUE 5, #2 -11 AUTOBAY @
KAKI BUKIT
Singapore 417883

Estimated Period of Repair: 14.0 days

Adjuster: ADRIAN LING**Manager:** VERON CHEN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS**Reference**

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 09 Feb 2022)
Parts: M1-SUV	HONDA VEZEL HYBRID 1.5 x (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLN5429Z)
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	2		*REAR NUMBER PLATE LAMP	Not Necessary	77.00 F	*- FL
2	1		*REAR BUMPER	Distorted	762.70 F	*762.70 FL
3	2		*REAR BUMPER SIDE HOLDER	Necessary	47.00 F	*47.00 FL
4	2		*REAR BUMPER REFLECTOR	N/s Cracked/O/s Cut	282.20 F	*282.20 FL
5	1		*REAR END PANEL	Distorted	585.00 F	*585.00 FL
6	1		*REAR END PANEL TOP GARNISH	Deformed	98.40 F	*98.40 FL
7	1		*REAR END PANEL BUZZER	Cracked	85.20 F	*85.20 FL
8	1		*REAR END PANEL ANTENNA SENSOR	Cracked	60.10 F	*60.10 FL
9	2		*TAILLAMP	Cut	949.20 F	*949.20 FL
10	2		*TAILLAMP LOWER APRON	Deformed	390.00 F	*390.00 FL
11	1		*TAILGATE	Distorted	1,100.00 F	*1,100.00 FL
12	1		*TAILGATE LOCK	Jammed	182.50 F	*182.50 FL
13	1		*TAILGATE LOCK STRIKER	Not Necessary	24.70 F	*- FL
14	1		*TAILGATE WEATHERSTRIPE	Cut	165.40 F	*165.40 FL
15	2		*TAILGATE DAMPER	Not Necessary	365.40 F	*- FL
16	2		*TAILGATE REFLECTOR	Cracked	826.40 F	*826.40 FL
17	1		*TAILGATE PULL POCKET	Deformed	27.50 F	*27.50 FL
18	1		*TAILGATE OUTER HANDLE SWITCH	Not Necessary	125.50 F	*- FL
19	1		*TAILGATE OUTER GARNISH	Cracked	325.00 F	*325.00 FL
20	1		*TAILGATE INNER TRIM BOARD	Deformed	285.60 F	*285.60 FL
21	1		*TAILGATE GLASS MOULDING	Necessary	120.00 F	*120.00 FL
22	2		*REAR FENDER INNER TRIM BOARD	Deformed	610.40 F	*610.40 FL
23	2		*REAR FENDER INNER SHIELD	Not Necessary	295.00 F	*- FL
24	1		*REAR FENDER WHEEL ARC GARNISH	N/s Deformed	392.00 F	*196.00 FL
25	1		*SPARE TYRE PANEL	Buckled	1,130.00 F	*1,130.00 FL
26	1		*SPARE TYRE PANEL UNDERCOVER	Deformed	225.10 F	*225.10 FL
27	1		*SPARE TYRE PANEL TOP COVER	Deformed	306.60 F	*306.60 FL
28	1		*TOOLS TRAY	Deformed	310.90 F	*310.90 FL
29	1		*HYBRID BATTERY AIR DUCT	Not Necessary	110.20 F	*- FL
30	1		*HYBRID BATTERY TOP METAL COVER	Not Necessary	325.70 F	*- FL
31	1		*HYBRID BATTERY LOWER TRAY	Not Necessary	346.00 F	*- FL
32	1		*REAR EXHAUST PIPE	Bent	598.60 F	*598.60 FL
33	1		*REAR EXHAUST MOUNTING	Not Necessary	28.50 F	*- FL
34	1		*REAR EXHAUST HEAT SHIELD	Crumpled	98.30 F	*98.30 FL
35	1		*REAR EXHAUST PIPE	Not Necessary	762.90 F	*- FL
36	1		*FRONT BUMPER	Deformed	801.70 F	*801.70 FL
37	2		*FRONT BUMPER SIDE HOLDER	Necessary	50.20 F	*50.20 FL
38	1		*FRONT BUMPER LOWER GRILLE	Deformed	77.50 F	*77.50 FL
39	1		*FRONT BUMPER TOW COVER	Not Necessary	20.20 F	*- FL
40	2		*FRONT BUMPER FOG LAMP	Not Necessary	655.40 F	*- FL
41	2		*FRONT BUMPER FOG LAMP COVER	Not Necessary	156.00 F	*- FL
42	1		*FRONT BUMPER REINFORCEMENT	Dented	321.00 F	*321.00 FL
43	2		*FRONT BUMPER REINFORCEMENT TOP MOULDING	Not Necessary	70.00 F	*- FL
44	1		*FRONT GRILLE	Cracked	421.60 F	*421.60 FL
45	1		*FRONT GRILLE BASE	Cracked	351.80 F	*351.80 FL
46	1		*FRONT GRILLE CHROME MOULDING	Cracked	283.90 F	*283.90 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
47	1		*FRONT GRILLE INNER BRACKET	Cracked	76.20 F	*76.20 FL
48	1		*HONDA LOGO	Necessary	34.90 F	*34.90 FL
49	2		*HEADLAMP	Cracked	3,569.00 F	*3,569.00 FL
50	2		*HEADLAMP LOWER BRACKET	Cracked	78.00 F	*78.00 FL
51	1		*BONNET	Dented	892.30 F	*892.30 FL
52	1		*BONNET LOCK	Not Necessary	95.10 F	*- FL
53	1		*BONNET WEATHERSTRIPE	Not Necessary	75.00 F	*- FL
54	1		*FRONT SUPPORT PANEL	Repair	676.40 F	*- FL
55	1		*FRONT SUPPORT PANEL TOP COVER	Deformed	190.30 F	*190.30 FL
56	1		*AIR CON CONDENSER	Dented	898.00 F	*898.00 FL
57	2		*AIR CON CONDENSER SIDE GUIDE	Not Necessary	72.00 F	*- FL
58	1		*RADIATOR	Not Necessary	1,250.60 F	*- FL
59	2		*FRONT FENDER	Not Necessary	1,164.00 F	*- FL
60	2		*FRONT FENDER WHEEL ARC GARNISH	Not Necessary	306.00 F	*- FL
61	1		*REAR NUMBER PLATE	Bent	30.00 FS	*30.00 FS
62	1		*REAR NUMBER PLATE HOLDER	Deformed	30.00 FS	*30.00 FS
63	1		*REAR BUMPER CLIPS	Necessary	30.00 FS	*30.00 FS
64	1		*REAR BUMPER LOWER GARNISH	Deformed	680.00 FS	*500.00 FS
65	1		*REVERSE SENSOR	Damaged	280.00 FS	*200.00 FS
66	1		*REAR END PANEL TOP GARNISH CLIPS	Necessary	20.00 FS	*20.00 FS
67	1		*REAR END PANEL SEALANT	Necessary	60.00 FS	*60.00 FS
68	1		*TAILGATE INNER TRIM BOARD CLIPS	Necessary	30.00 FS	*30.00 FS
69	1		*TAILGATE GLASS SEALANT	Necessary	60.00 FS	*60.00 FS
70	1		*REAR FENDER INNER TRIM BOARD CLIPS	Necessary	60.00 FS	*60.00 FS
71	1		*REAR FENDER INNER SHIELD CLIPS	Not Necessary	60.00 FS	*- FS
72	1		*REAR FENDER WHEEL ARC GARNISH CLIPS	Necessary	40.00 FS	*20.00 FS
73	1		*SPARE TYRE PANEL UNDERCOVER CLIPS	Necessary	30.00 FS	*30.00 FS
74	1		*SPARE TYRE PANEL TOP RUBBERISED MAT	Not Necessary	280.00 FS	*- FS
75	1		*REAR CAMERA	Not Necessary	480.00 FS	*- FS
76	1		*FRONT NUMBER PLATE	Bent	30.00 FS	*30.00 FS
77	1		*FRONT NUMBER PLATE HOLDER	Deformed	30.00 FS	*30.00 FS
78	1		*FRONT BUMPER CLIPS	Necessary	30.00 FS	*30.00 FS
79	1		*FRONT BUMPER LOWER SPOILER	Deformed	700.00 FS	*580.00 FS
80	1		*FRONT GRILLE CLIPS	Necessary	30.00 FS	*30.00 FS
81	1		*FRONT SUPPORT PANEL TOP COVER CLIPS	Necessary	20.00 FS	*20.00 FS
82	1		*AIR CON CONDENSER SIDE GUIDE CLIPS	Not Necessary	20.00 FS	*- FS
83	1		*RADIATOR COOLANT	Not Necessary	50.00 FS	*- FS
84	1		*FRONT FENDER WHEEL ARC GARNISH CLIPS	Not Necessary	40.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	28,132.10	19,604.50
- List Item Discount on L Items 0.00/20.00% (\$)	0.00	3,562.90
Total Parts (\$)	28,132.10	16,041.60

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING (REAR)	New	1,800.00	1,200.00
2	SPRAY PAINTING (REAR)	New	1,600.00	1,000.00
3	WIRING (REAR)	New	50.00	30.00
4	TO SPRAY TUFF COAT (REAR)	New	150.00	100.00
5	TO REMOVE REVERSE SENSOR (REAR)	New	100.00	50.00
6	TO REMOVE REAR CAMERA (REAR)	New	100.00	50.00
7	TO REMOVE UPHOLSTERY AND REAR SEAT (REAR)	New	300.00	200.00
8	TO REMOVE TAILGATE GLASS (REAR)	New	180.00	120.00
9	TO TRANSFER TAILGATE FITTINGS (REAR)	New	150.00	80.00
10	TO REMOVE REAR AND CENTRE EXHAUST PIPES (REAR)	New	300.00	80.00
11	TO REMOVE HYBRID BATTERY (REAR)	New	450.00	380.00
12	PANEL BEATING (FRONT)	New	1,000.00	500.00
13	SPRAY PAINTING (FRONT)	New	800.00	500.00
14	WIRING (FRONT)	New	50.00	30.00
15	TO REMOVE CONDENSER AND TO TOP UP AIR CON GAS (FRONT)	New	120.00	60.00
16	TO REMOVE RADIATOR AND TO TOP UP COOLANT (FRONT)	New	120.00	0.00
			Gross Labour Cost (\$)	7,270.00
				4,380.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >