

PERFECT AUTOMOBILE APPRAISAL SERVICES

10 Hougang Street 11 #14-29 The Minton Singapore 534080
Hand phone No. 96683949 Fax No. 63880908
Company Registration No. 53103119E

THIRD PARTY CLAIM

To : Hii Kah Poh
c/o : 1 Kaki Bukit Avenue 6
#01-48 Autobay @ Kaki Bukit
Singapore 417883

Date : 17th March 2021

Our Ref : PA/FA/21/1004/1

REFERENCE :

ASSIGNED BY : Owner
ASSIGNED ON : 12th March 2021

WORKSHOP : Fastech Auto Pte Ltd
1 Kaki Bukit Avenue 6
#01-48 Autobay @ Kaki Bukit
Singapore 417883

ACCIDENT DATE : 11th March 2021
SURVEY DATE : 12th March 2021

VEHICLE DETAILS :

REGN PLATE	: SGT 6120 J	COLOUR	: Blue
MAKE & MODEL	: Mitsubishi Lancer 1.6A	GEN BODY WORK	: Good
YEAR REGN	: 2007	AUDIO PLAYER	: Yes
ENG CAPACITY	: 1584cc	AIR CONDITIONER	: Yes
ENGINE NO.	: 4G18HY3676	STEERING	: Affected
CHASSIS NO	: JMSTCS3A7U009699	HAND BRAKE	: Serviceable
MILEAGE	: 173491Km	FOOT BRAKE	: Serviceable

TYRES SIZE & CONDITION :

FRONT O/S : Michelin 205/45 R 17 approximately 80%
FRONT N/S : Michelin 205/45 R 17 approximately 80%
REAR O/S : Hankook 245/45 R 17 approximately 50%
REAR N/S : Hankook 245/45 R 17 approximately 50%

Note : The above percentage represent the remaining estimated life of the tyre treads.

Our Ref : PA/FA/21/1004/1

Veh. No. : SGT 6120 J

GENERAL DESCRIPTION OF DAMAGES :

At the time of inspection, we noted that this vehicle sustained damages at the front o/s portion.

For more details of the damages, please see schedule and photographs attached.

Attached forty-four (44) photographs taken during our inspections.

CONCLUSIONS & RECOMMENDATIONS :

ORIGINAL QUOTATION : \$ 12,915.00

REVISED QUOTATION : \$ 8,050.00 (Lump Sum)

We have thoroughly inspected each and every item on the estimate against the physical damages found on the vehicle. We have listed the breakdown of our findings and our recommendations as per assessment attached.

In normal circumstances, the repairs would take approximately five (5) days to complete.

In accordance to your instruction, we have **NOT AUTHORISED** repair to the vehicle and the survey was conducted strictly on a '**WITHOUT PREJUDICE**' basis. We hope that this report will be of assistance to you in dealing with this matter.

Should you discover any discrepancy in this report, please kindly notify us within two (2) weeks or this report will be treated as valid.

The information contained in these documents is privileged and confidential and is for the exclusive use of the addressee's designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this document not meant for you, please contact us immediately to arrange for its return.

PERFECT AUTOMOBILE APPRAISAL SERVICES

W/s Fastech Auto Pte Ltd
 1 Kaki Bukit Avenue 6
 #01-48 Autobay @ Kaki Bukit
 Singapore 417883

Our Ref : PA/FA/21/1004/1

Veh. No. : SGT 6120 J

QTY	DESCRIPTIONS	COMMENTS/ CONDITION	ORIGINAL QUOTATION	REVISED QUOTATION
-----	--------------	------------------------	-----------------------	----------------------

LIST PARTS

1 pc	Front bumper	deformed	\$ 995.00	\$ 995.00
1 pc	Front bumper o/s side retainer	bent	\$ 65.00	\$ 65.00
1 pc	Front bumper n/s side retainer	bent	\$ 65.00	\$ 65.00
1 pc	Front bumper reinforcement	repairable	\$ 580.00	\$ -
1 pc	Front o/s fender	dented	\$ 685.00	\$ 685.00
1 pc	Front o/s fender inner shield	torn	\$ 260.00	\$ 260.00
1 pc	Front o/s fender wheel housing	repairable	\$ 655.00	\$ -
1 pc	Front o/s fender signal lamp	cracked	\$ 85.00	\$ 85.00
1 pc	O/s headlamp	cracked	\$ 1,150.00	\$ 1,150.00
1 pc	Front support panel	repairable	\$ 785.00	\$ -
1 pc	Front o/s lower arm	bent	\$ 765.00	\$ 765.00
1 pc	Front o/s knuckle arm	bent	\$ 745.00	\$ 745.00
1 pc	Front o/s wheel bearing	dented	\$ 195.00	\$ 195.00
1 pc	Front o/s drive shaft	serviceable	\$ 1,225.00	\$ -
1 pc	Wiper tank	dented	\$ 295.00	\$ 295.00
			\$ 8,550.00	\$ 5,305.00
		Less 10%	\$ 855.00	\$ 530.50
			\$ 7,695.00	\$ 4,774.50

S/NETT PARTS

1 pc	Front o/s sport wheel	dented	\$ 600.00	\$ 600.00
1 set	Front sport shock absorber assy	bent	\$ 1,200.00	\$ 1,200.00
1 pc	Front o/s tyre (paying @ 80% only)	cut	\$ 350.00	\$ 280.00
1 set	Front bumper clip	necessary	\$ 45.00	\$ 45.00
1 set	Front o/s fender inner shield clip	necessary	\$ 45.00	\$ 45.00
			\$ 2,240.00	\$ 2,170.00

PERFECT AUTOMOBILE APPRAISAL SERVICES

W/s Fastech Auto Pte Ltd
 1 Kaki Bukit Avenue 6
 #01-48 Autobay @ Kaki Bukit
 Singapore 417883

Our Ref : PA/FA/21/1004/1

Veh. No. : SGT 6120 J

QTY	DESCRIPTIONS	COMMENTS/ CONDITION	ORIGINAL QUOTATION	REVISED QUOTATION
-----	--------------	------------------------	-----------------------	----------------------

LABOUR CHARGES

To check and re-adjust computerised wheel alignment.	\$	120.00	\$	80.00
To remove and replace front undercarriage parts and components.	\$	300.00	\$	250.00
To disconnect and check front electrical wiring, harness, wire sockets, etc. To remove and reinstall damaged parts, test and rectify for proper functioning.	\$	60.00	\$	40.00
To apply rustproofing, reseal tuff-coating treatment to front replaced/ repaired parts and panels.	\$	100.00	\$	80.00
To putty and spray painting on front damaged portion including touch up paint on accident affected areas.	\$	1,200.00	\$	800.00
To remove and replace damaged parts and panels. To cut, weld, straighten and panel beat where necessary.	\$	1,200.00	\$	800.00
		\$ 12,915.00	\$	8,994.50

The repairer has agreed to undertake repairs on a contractual basis at **Lump Sum \$ 8,050.00** corresponding to supply of parts, labour and spray painting charges.






CHUAH POH SIONG GARY
 CAE, MIMI, AMSOE,
 AMIRTE, AMSAE-AUS, MSAAA

PERFECT AUTOMOBILE APPRAISAL SERVICES

Vehicle No: SGT 6120J

Inspection Photos

Date Of Accident: 11 March 2021

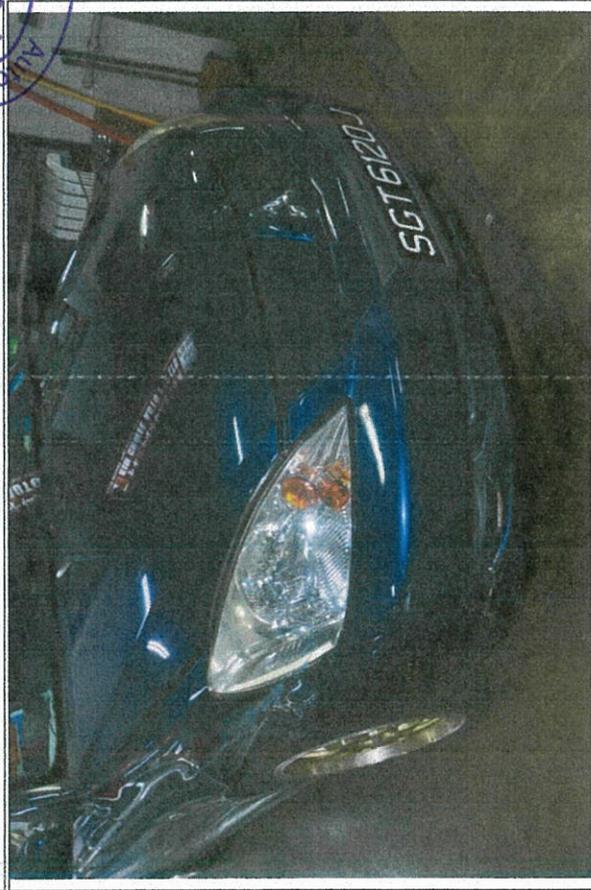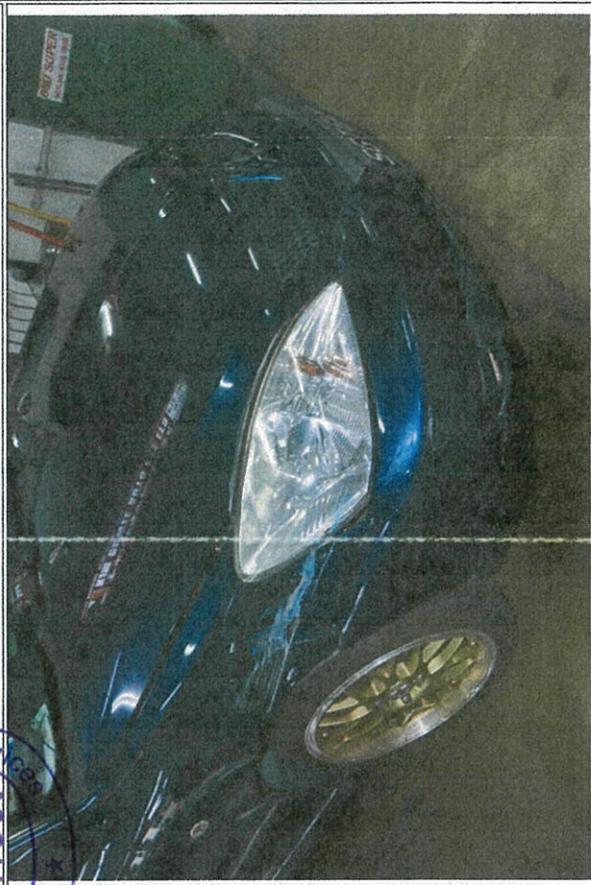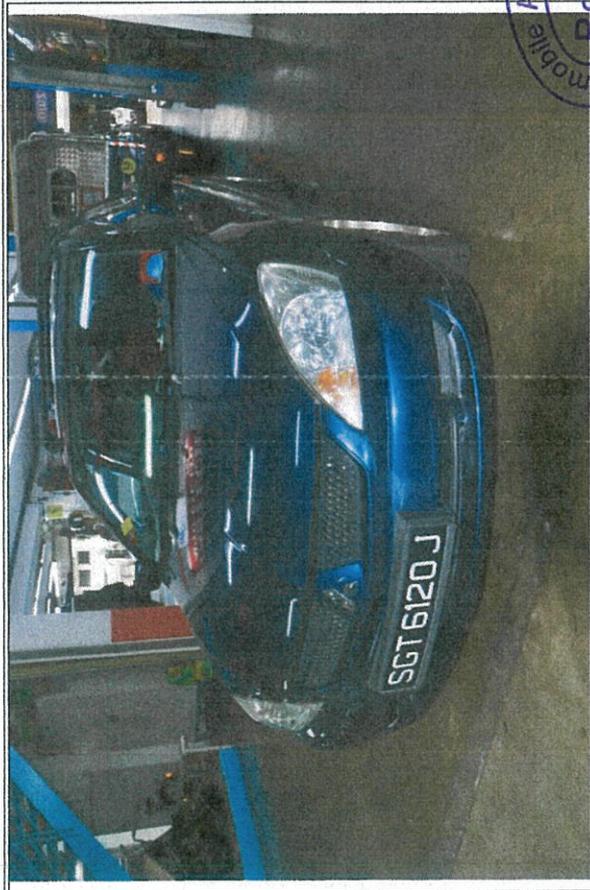


Mobile Appraisal Services
Perfect Appraisal Services

PERFECT AUTOMOBILE APPRAISAL SERVICES

Vehicle No: SGT 6120J

Inspection Photos

Date Of Accident: 11 March 2021




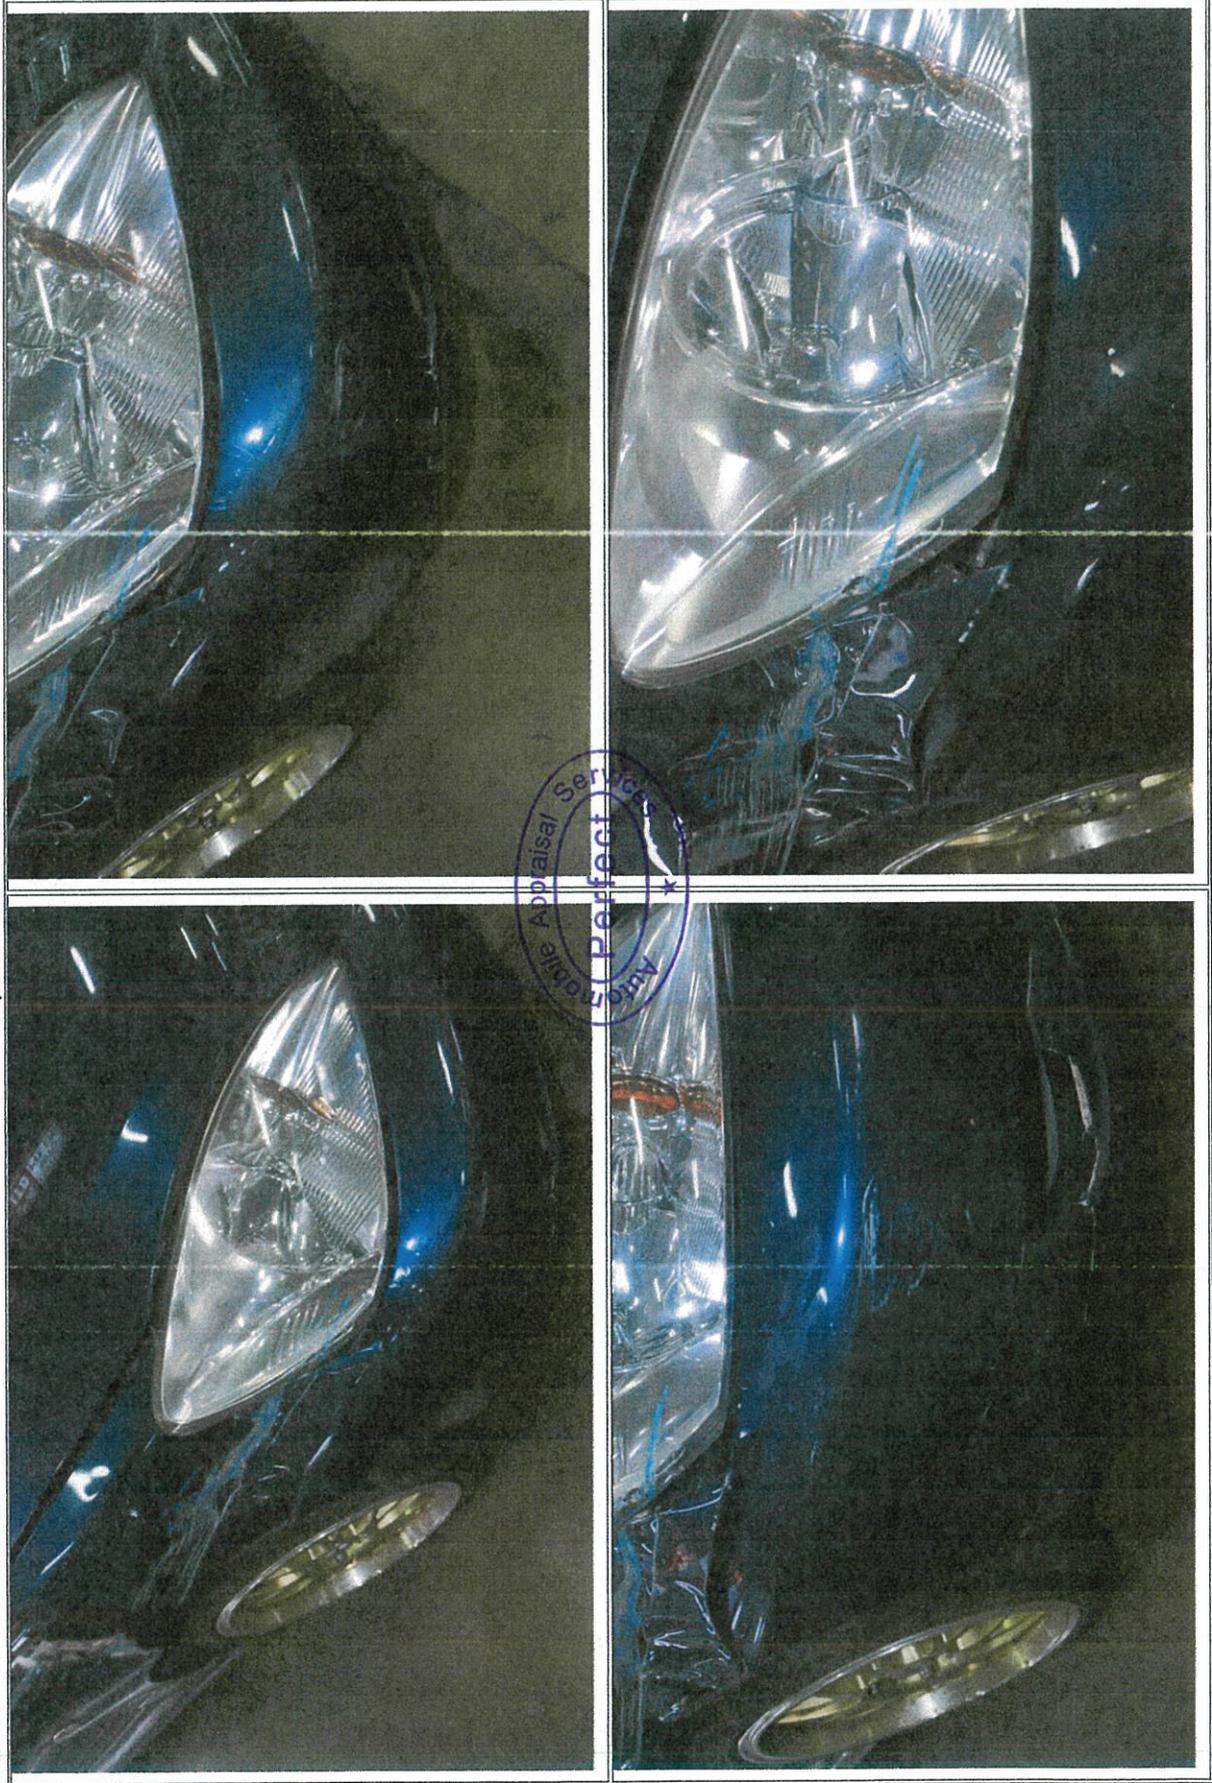


PERFECT AUTOMOBILE APPRAISAL SERVICES

Vehicle No: SGT 6120J

Inspection Photos

Date Of Accident: 11 March 2021

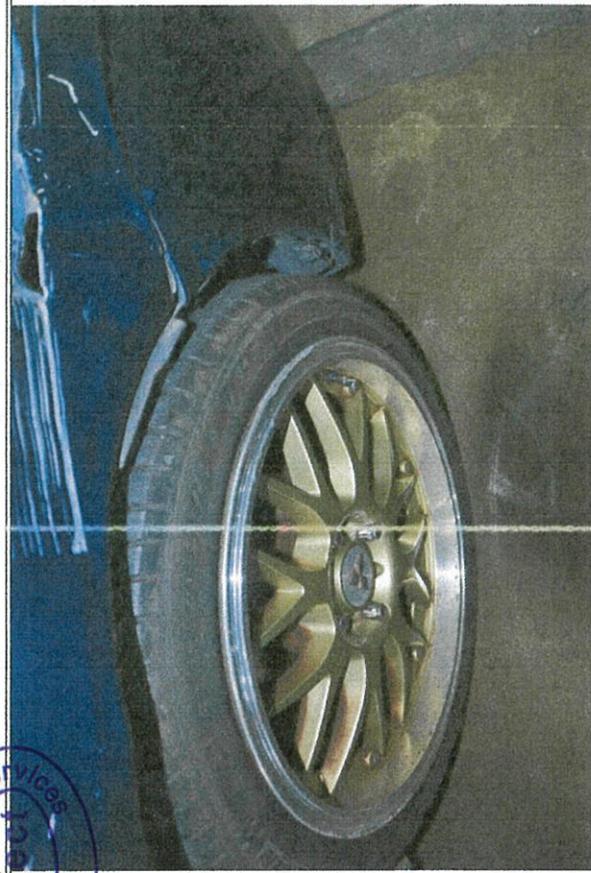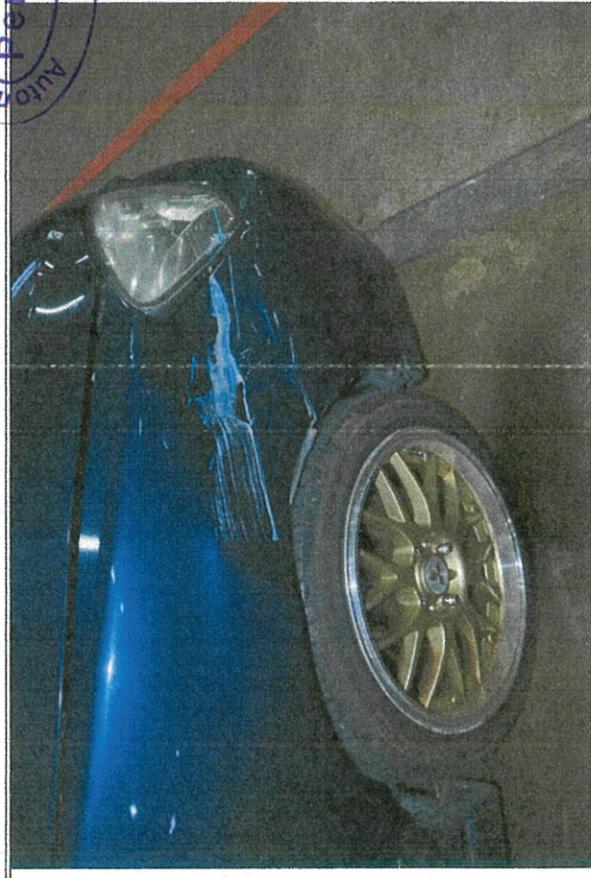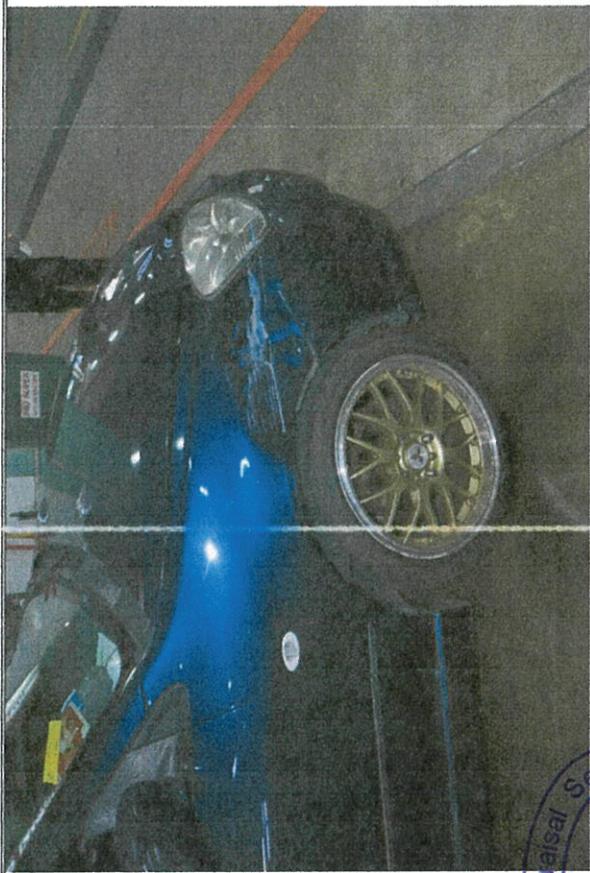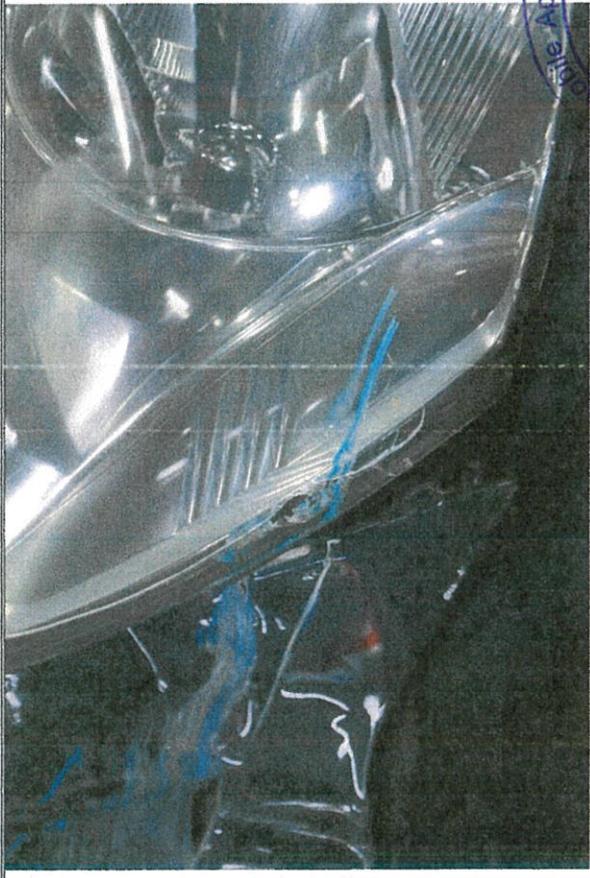


PERFECT AUTOMOBILE APPRAISAL SERVICES

Vehicle No: SGT 6120J

Inspection Photos

Date Of Accident: 11 March 2021




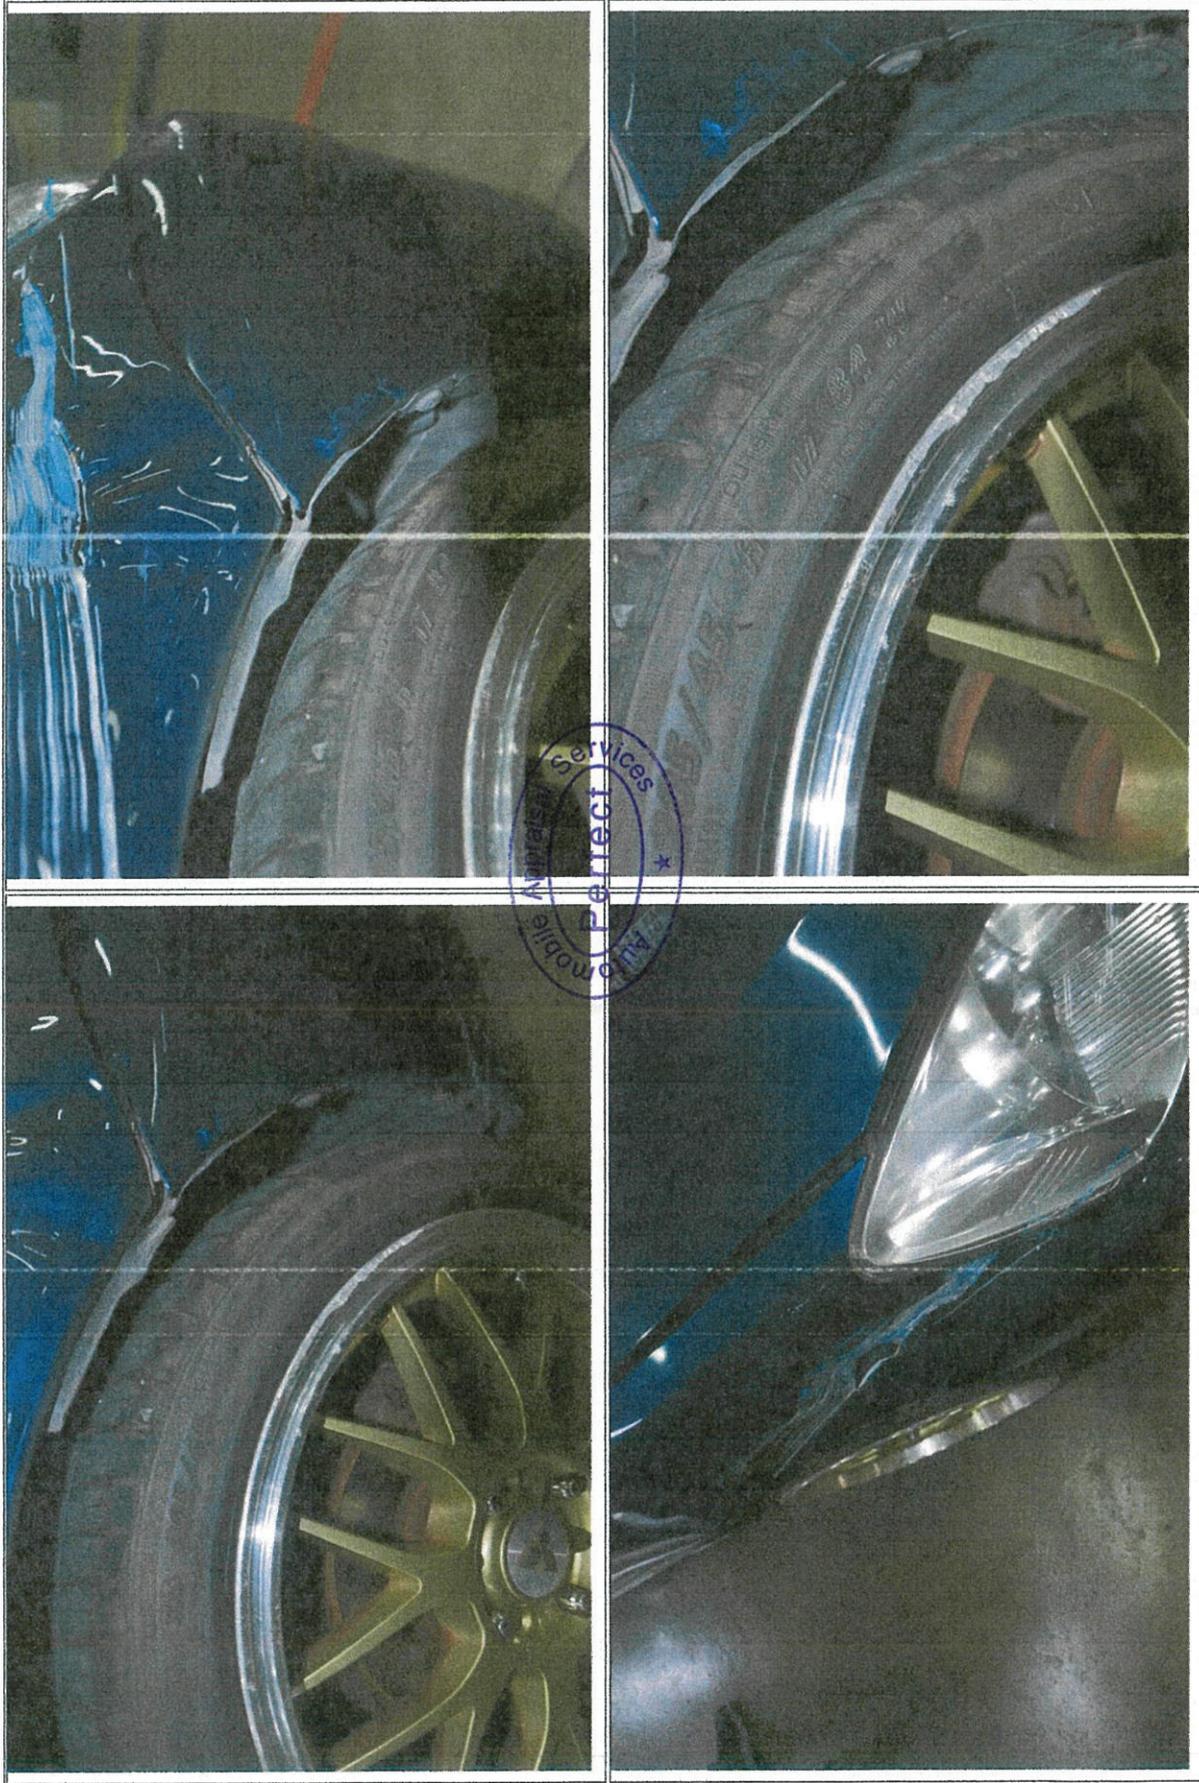


PERFECT AUTOMOBILE APPRAISAL SERVICES

Vehicle No: SGT 6120J

Inspection Photos

Date Of Accident: 11 March 2021

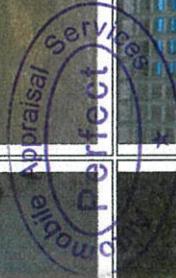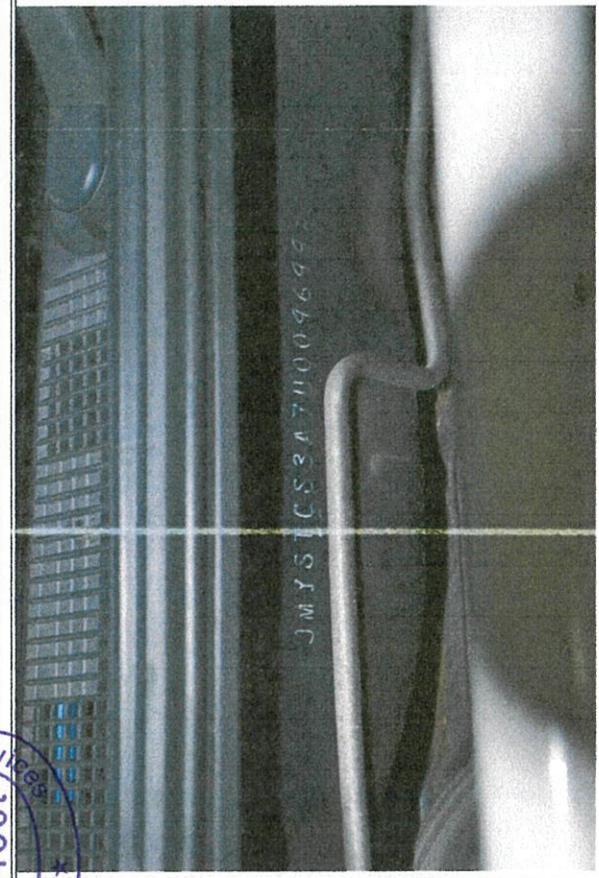
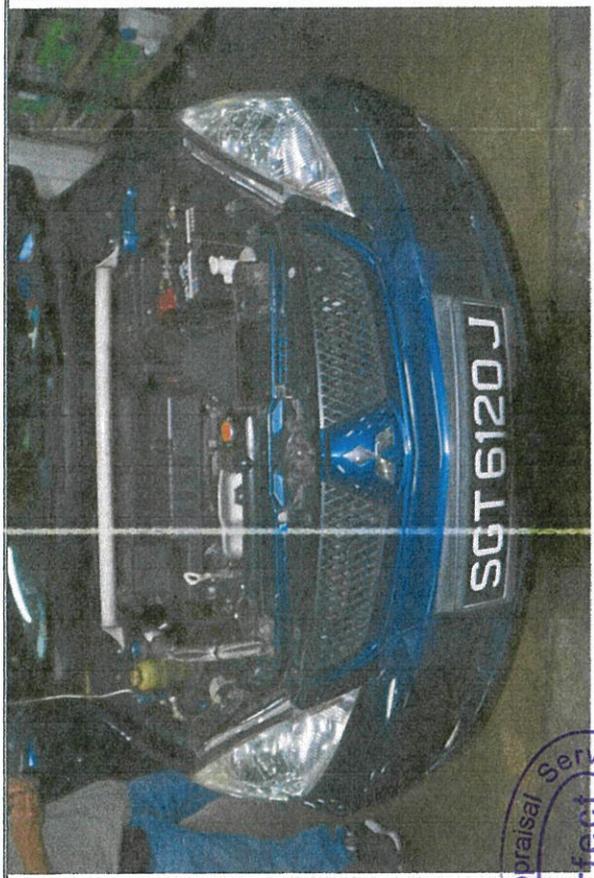
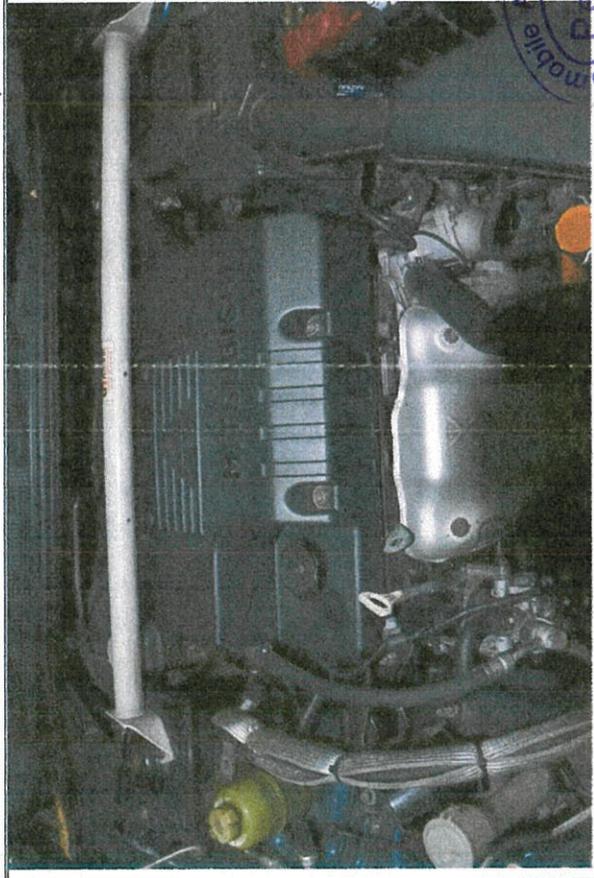


PERFECT AUTOMOBILE APPRAISAL SERVICES

Vehicle No: SGT 6120J

Re-inspection Photos

Date Of Accident: 11 March 2021

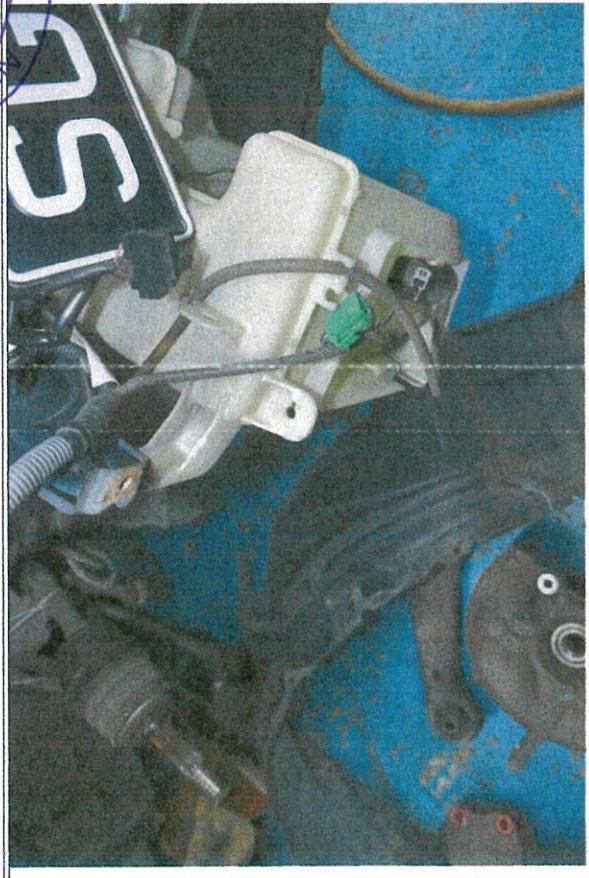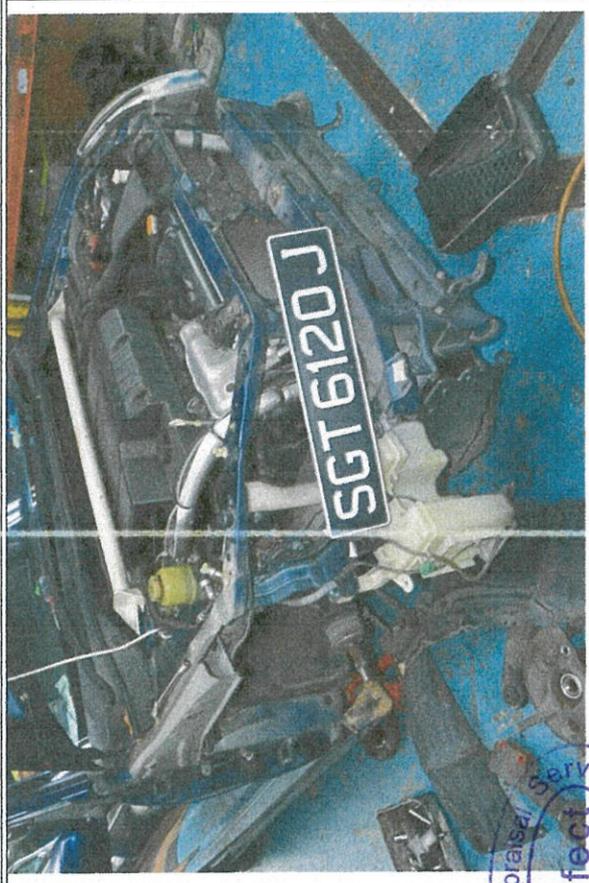
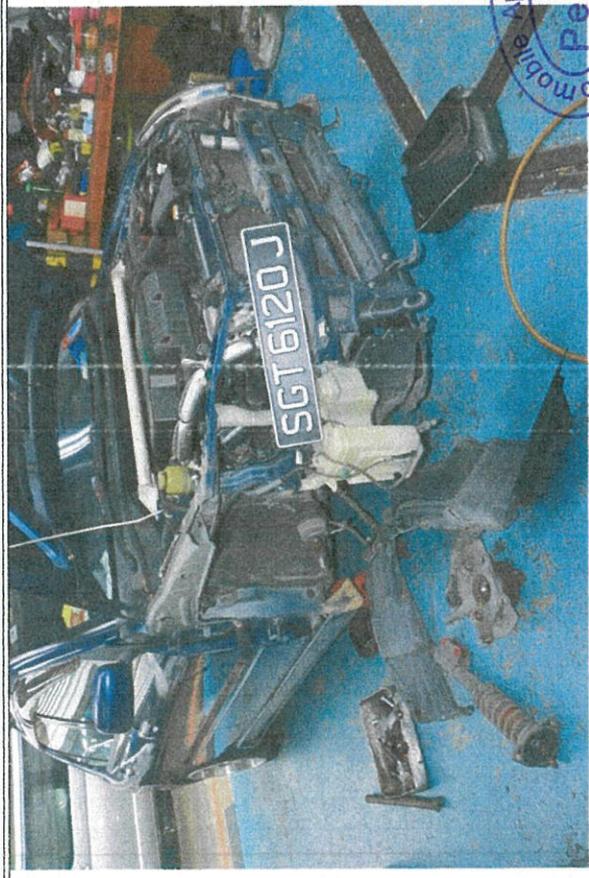


PERFECT AUTOMOBILE APPRAISAL SERVICES

Vehicle No: SGT 6120J

Re-inspection Photos

Date Of Accident: 11 March 2021



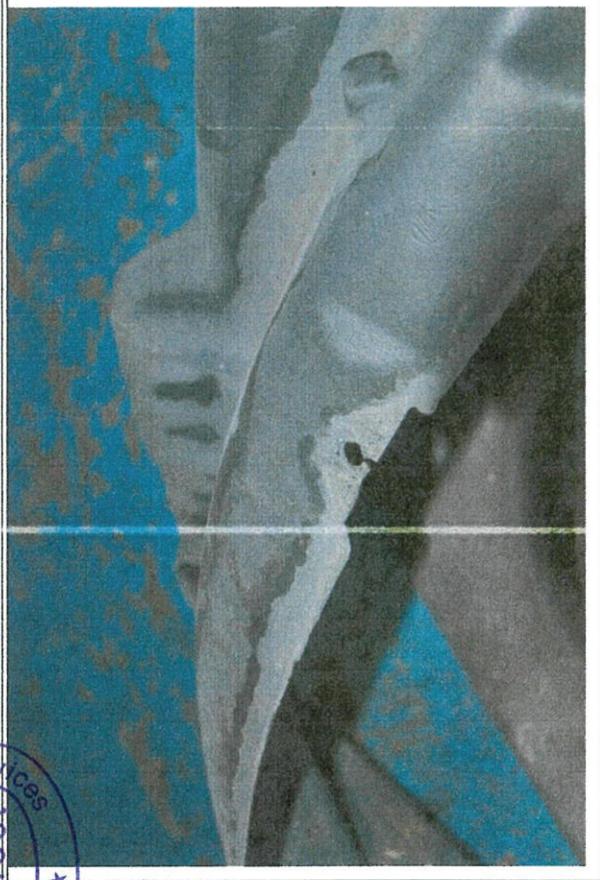
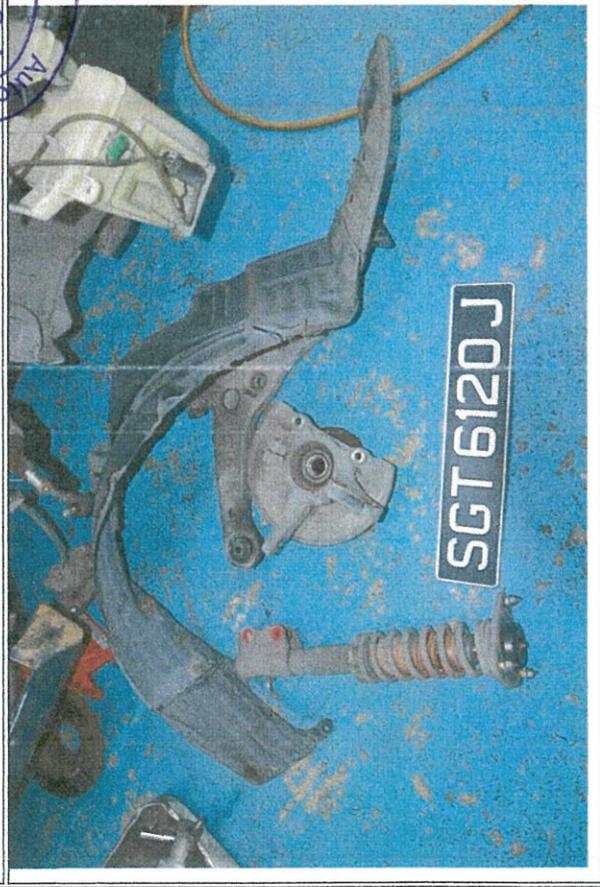


PERFECT AUTOMOBILE APPRAISAL SERVICES

Vehicle No: SGT 6120J

Re-inspection Photos

Date Of Accident: 11 March 2021

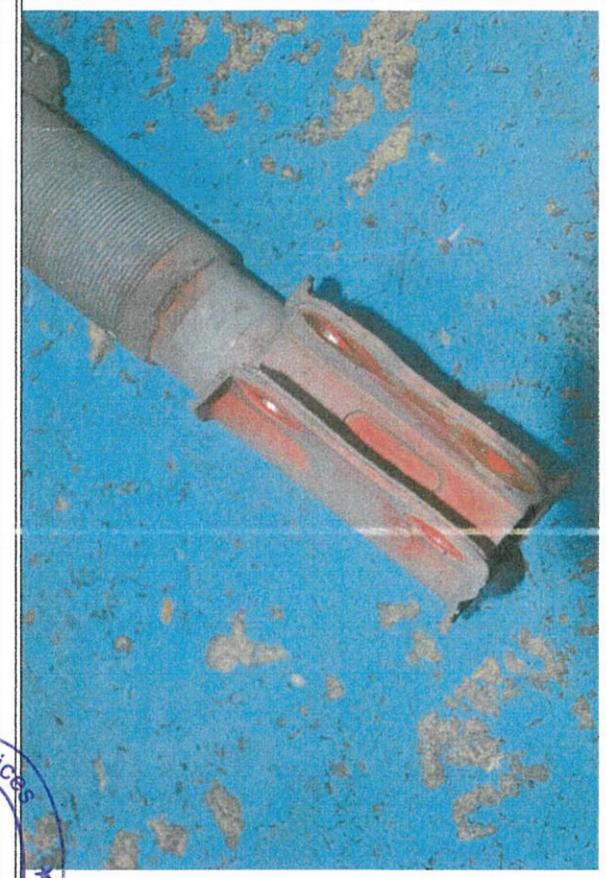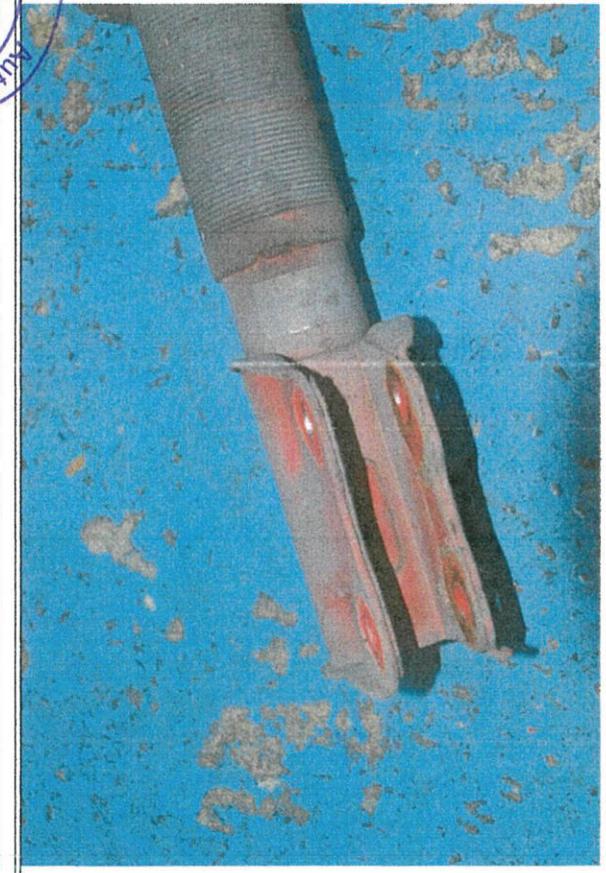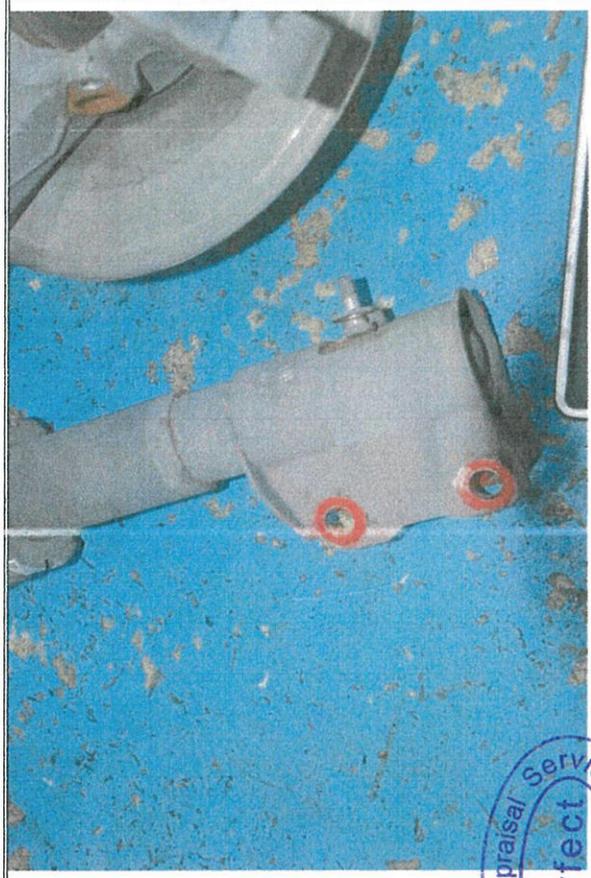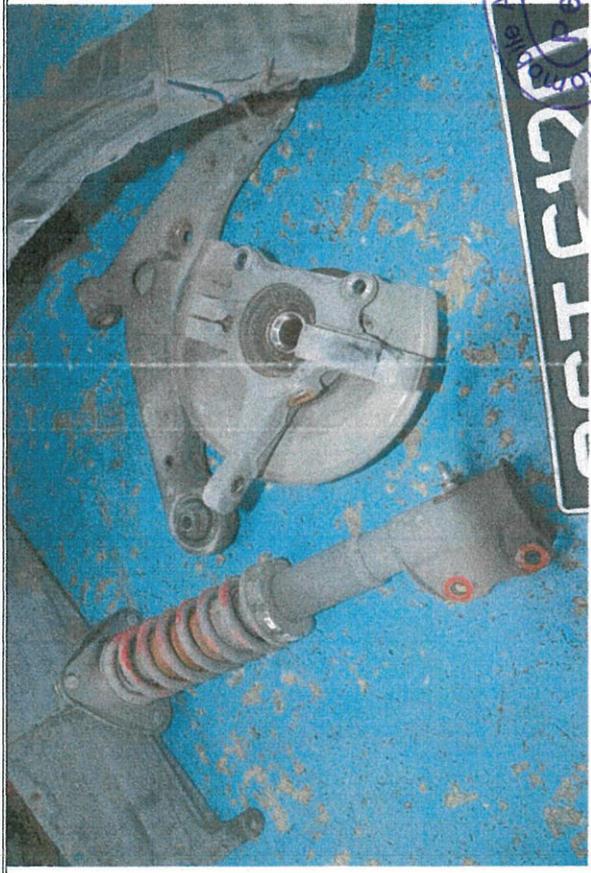


PERFECT AUTOMOBILE APPRAISAL SERVICES

Vehicle No: SGT 6120J

Re-inspection Photos

Date Of Accident: 11 March 2021

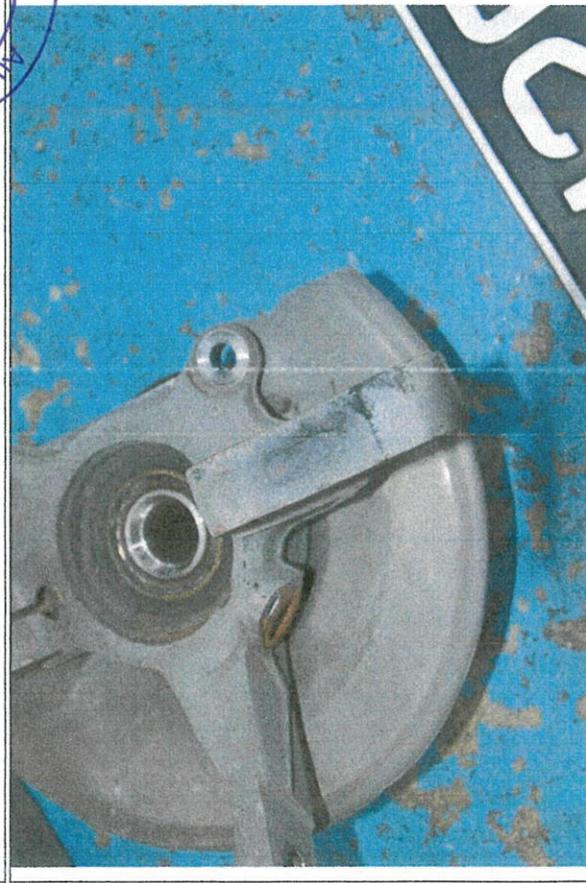



Perfect
Automobile Appraisal Services

PERFECT AUTOMOBILE APPRAISAL SERVICES

Vehicle No: SGT 6120J

Re-inspection Photos

Date Of Accident: 11 March 2021

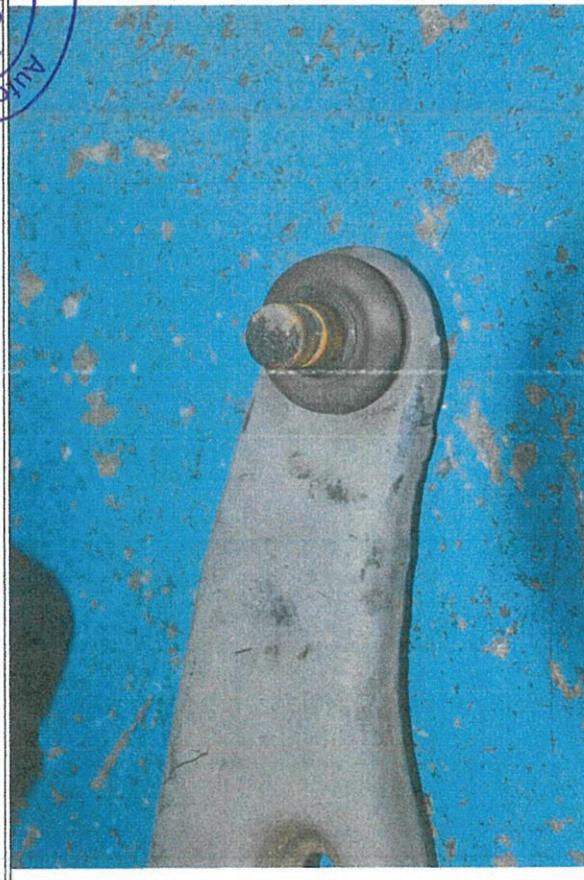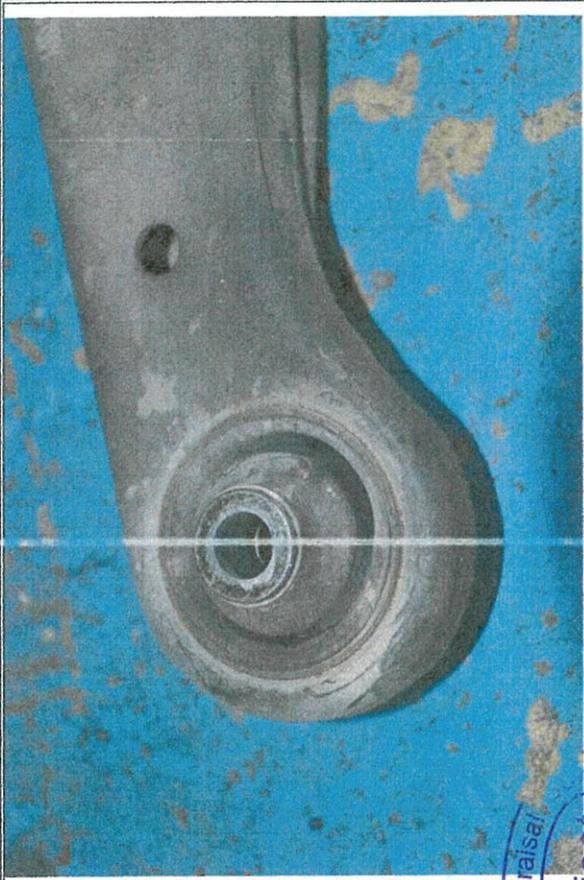

Perfect
Automobile Appraisal Services

PERFECT AUTOMOBILE APPRAISAL SERVICES

Vehicle No: SGT 6120J

Re-inspection Photos

Date Of Accident: 11 March 2021

