

Estimate Repair

Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10, #01-20
575645



Insurer Reference:
Repairer Reference: 045317
Date calculated: 28/12/2021 5:15 PM

Full Report
Registration: SMJ2407R
Printed: 28/12/2021 5:15 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:		Date of Incident:	26/12/21
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle	
Manufacturer:	BMW
Model:	5 SERIES F10
Sub Model:	520 I
Model Sheet Number:	01 42 05
Registration:	SMJ2407R
VIN number:	
Odometer:	128476

*Not Authorized
11/12/21
Repair After Paint
Ex @ 12500*

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

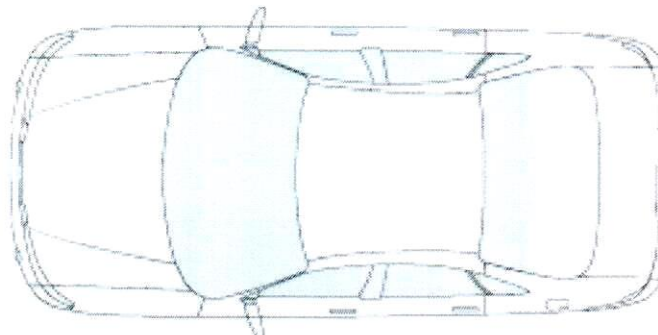

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 12 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	ADD/TIME FOR MAIN WORK		2.0	7.00
35 555)	RENEW R/F SIDE PANEL		13.0	45.50
51 64 532	RENEW R/FRONT PANEL SUPPORT (FRT BUMPER SUPPORT REMOVED) INCLUDES: HEADLAMP, AIR GUIDE RADIATOR AND IMPACT ELEMENT REMOVE AND REFIT		15.0	52.50
51 23 621)	R + R BOTH BONNET LOCKS		3.0	10.50
51 23 631	RENEW L/BONNET STRIKER		1.0	3.50
51 23 631	RENEW R/BONNET STRIKER		1.0	3.50
51 11 656	R + R FRONT BUMPER		9.0	31.50
51 11 551	R + R FRONT UPPER BUMPER CARRIER		4.0	14.00
51 11 592	REMOVE/REFIT FRONT BUMPER BAR TRIM (WITH FRONT BUMPER BAR REMOVED)		6.0	21.00
63 10 514	ALIGN FRONT FOG LAMPS		2.0	7.00
61 71 561)	R + R WATER RESERVOIR		4.0	14.00
41 61 510	R + R BONNET		4.0	14.00
41 61 571)	RENEW L/BONNET HINGE		3.0	10.50

Code	Description	WU	Price SGD
41 61 572)	RENEW R/BONNET HINGE	3.0	10.50
51 76 530	R + R REAR BONNET SEAL	1.0	3.50
51 31 511)	RENEW WINDSCREEN	31.0	108.50
	DOES NOT INCLUDE: VEHICLE TEST		
72 12 730	R + R R/HEAD AIRBAG	4.0	14.00
51 71 947	R + R R/SILL PANEL COVER	6.0	21.00
65 77 726)	R + R R/SIDE IMPACT SENSOR	1.0	3.50
51 44 501	R + R HEADLINING	36.0	126.00
	(VEHICLE WITHOUT TILT/SLIDE SUNROOF)		
	INCLUDES: R + R SUN VISORS, FRONT PILLAR TRIMS, CENTRE PILLAR TRIMS AND REAR PILLAR TRIMS		
51 45 529	R + R INSTRUMENT CARRIER TRIM	37.0	129.50
51 45 531)	RENEW INSTRUMENT PANEL COVER	9.0	31.50
51 47 500	R + R FRONT ASSEMBLY PROTECTION	3.0	10.50
31 12 574)	REPLACE RH SUSPENSION ARM	4.0	14.00
	(WITH SUSPENSION STRUT REMOVED)		
36 12 501	R + R R/F WHEEL/TYRE	4.0	14.00
34 11 612	REMOVE/REFIT FRONT BRAKE DISC (N)	2.0	7.00
	(WITH BRAKE CALIPER REMOVED)		
31 31 502	R + R R/F STRUT	6.0	21.00
31 31 501	REPLACE RIGHT FRONT SUSPENSION STRUT	5.0	17.50
	(WITH SUSPENSION STRUT ASSEMBLY REMOVED)		
31 12 574	R + R L/LWR CONTROL ARM	8.0	28.00
31 12 573	R + R R/UPPER CONTROL ARM	8.0	28.00
31 12 626)	R + R L/F TENSION ROD	3.0	10.50
31 35 500)	DETACH + REFIT LEFT FRONT STABILIZER	3.0	10.50
31 35 500)	DETACH + REFIT RIGHT FRONT STABILIZER	3.0	10.50
31 35 501	R + R L/FRT PRESSURE ROD	3.0	10.50
31 35 501	R + R R/FRT PRESSURE ROD	3.0	10.50
32 21 737)	RENEW L + R TIE RODS	8.0	28.00
36 11 500	TYRE PUNCTURE INITIALIZE DISPLAY	1.0	3.50
00 00 556	VEHICLE CHECK	3.0	10.50
	(BY VEHICLE DIAGNOSTIC SYSTEM)		
1006	INSTRUMENT PANEL DASHBOARD		350.00*
1007	HEADLINING COVER HEADLINING		350.00* 28a
Labour Cost		Hrs	WU
Panel / Mechanical Labour		21.80	262.0
Fixed Rate			917.00
Total of Labour			700.00
			1,617.00

Paint

Paint Work

Time Basis 12 WU/h

Code	Description - MF	WU	Price SGD
99 68 529	FRONT BUMPER PAINTING STAGE 2	16.0	56.00
LE 0634	R/WASHER NOZZLE TRIM PAINTING STAGE 2	2.0	7.00
99 35 519	R/F WING PAINTING STAGE 2	8.0	28.00
99 99 000	ADDITIONAL TIME FOR ONE MAIN WORK INCLUDES: MIX COLOUR AND SPRAY COLOUR SAMPLE	21.0	73.50

Total Paint

Hrs 3.90 WU 47.0 Price SGD 164.50

Material Cost - Paint

New Part Painting
Material-constant Metal
Total

Price SGD
83.85
13.47
97.32

Spare Parts

				prices as at 2021-12-15	
Code	Description	Part Number	Part Source	Price SGD	
0283	FRONT BUMPER COVER	51 11 7 285 960	Original	B 950.00	✓
0306	R/AIR INTAKE TRIM	51 11 7 231 860	Original	Sm 30.00	X
0308	R/BUMPER AIR GRILLE	51 11 7 200 700	Original	Sm 55.00	X
0326	R/F AIR DUCT	51 74 7 200 790	Original	Sm 25.00	X
0333	FRT UPP BUMPER SUPP	51 11 7 200 705	Original	0.00	
0336	FRT UPP BUMPER SUPP	SEE GUIDE NO. 0333	Original	SVC 250.00	
40	FRT UPP IMPACT DAMP	51 11 7 200 707	Original	Sm 55.00	X
0415	L/F GRILLE	51 13 7 203 649	Original	Sm 110.00	✓
0416	R/F GRILLE	51 13 7 203 650	Original	Sm 110.00	✓
0431	GRILLE BADGE	51 14 7 057 794	Original	Sm 60.00	✓
0475	L/BONNET HINGE	41 61 7 207 199	Original	R 65.00	X
0476	R/BONNET HINGE	41 61 7 207 200	Original	R 65.00	X
0491	L/UPPER LOCK	51 23 7 183 763	Original	R 60.00	X
0492	R/UPPER LOCK	51 23 7 183 764	Original	R 60.00	X
0503	L/BONNET LOCK	51 23 7 206 453	Original	R 150.00	X
0504	R/BONNET LOCK	51 23 7 183 762	Original	R 150.00	X
0562	RIGHT HEADLAMP ASSY	63 11 7 203 242	Original	CNT 1,600.00	✓
0594	R/F HEADLAMP BRACKET	41 35 7 207 210	Original	R 180.00	X
0634	R/WASHER NOZZLE TRIM	51 11 7 246 870	Original	Sm 40.00	X
0638	R/F FOG LAMP	63 17 7 216 886	Original	Sm 180.00	X
0742	R/F WING	41 35 5 A03 262	Original	R 880.00	✓
0748	R/F SUPPORT	51 76 7 019 804	Original	Sm 220.00	X
0842	R/F W-HOUSE CVR FRT	51 71 7 186 728	Original	Dir 65.00	✓
0844	R/F W-HOUSE RR COVER	51 71 7 186 724	Original	Dir 65.00	✓
88	R/F PANEL SUPPORT	51 64 7 200 794	Original	Sm 90.00	X
1026	COWL PANEL INSUL	51 48 9 162 739		Sm 86.65	X
1401	WINDSCREEN	51 31 4 898 963	Original	CNT 650.00	✓
1411	WINDSCREEN BOND KIT	83 19 2 289 287	Original	0.00	
1414	CLEANER R1 FRT SCRIN	83 19 2 211 217	Original	0.00	
1417	INFO LABEL AIRBAG	71 21 2 122 334	Original	0.00	
1419	WINDSCREEN BUFFER	51 31 7 288 462	Original	0.00	
1423	FRONT SCREEN COVER	51 31 7 203 121	Original	Sm 55.00	X
1436	FLUID RESERVOIR	61 66 7 269 668	Original	Sm 100.00	X
4325	PASSENGER AIRBAG	72 12 9 230 399	Original	Avrm 1,590.00	✓
4331	INSTRUMENT PANEL	51 45 9 277 289	Original	Tm 3,800.00	✓
4616	R/HEAD AIRBAG	72 12 9 143 418	Original	Avrm 790.00	✓
4622	R/B-PILLAR SENSOR	65 77 9 224 177	Original	Sm 125.00	✓
4942	R/A-PILLAR COVER	51 43 9 173 442	Original	Sm 60.00	X
4952	R/UPP B PILLAR TRIM	51 43 7 358 986	Original	Sm 65.00	X
4957	HEADLINING	51 44 9 173 445	Original	De form 1,360.00	✓
7050	R/UPPER CONTROL ARM	31 12 6 775 967	Original	R 380.00	✓

Code	Description	Part Number	Part Source	Price SGD
7053	L/F TRACK CONT ARM	31 12 6 794 203	Original	<i>Per</i> 360.00 <i>X</i>
7054	R/F TRACK CONT ARM	31 12 6 794 204	Original	<i>R</i> 360.00 <i>✓</i>
7071	L/F TENSION ROD	31 12 6 775 971	Original	<i>Per</i> 350.00 <i>X</i>
7072	R/F TENSION ROD	31 12 6 775 972	Original	<i>D</i> 350.00 <i>✓</i>
7078	R/F CPL SPRING STRUT	31 31 6 789 364	Original	<i>R</i> 350.00 <i>✓</i>
7082	R/F STEERING KNUCKLE	31 21 4 082 760	Original	<i>R</i> 480.00 <i>✓</i>
7092	R/F STRUT BEARING	31 30 6 795 082	Original	<i>Per</i> 95.00 <i>✓</i>
7124	R/F WHEEL HUB	31 20 6 865 152	Original	<i>R</i> 380.00 <i>✓</i>
7202	R/F WHEEL	36 11 6 780 720	Original	<i>Per</i> 800.00 <i>✓</i>
7228	R/FR TYRE	225/55 R 17 .. W	Original	<i>Per</i> 550.00 <i>50/100</i>
7261	FRONT STABILISER	31 35 6 777 933	Original	<i>Per</i> 330.00 <i>X</i>
7277	L/SWING SUPPORT	31 35 6 777 319	Original	<i>Per</i> 70.00 <i>X</i>
7278	R/SWING SUPPORT	31 35 6 777 319	Original	<i>Per</i> 70.00 <i>X</i>
7309	L/TIE ROD	32 10 6 784 716	Original	<i>Per</i> 245.00 <i>X</i>
7310	R/TIE ROD	32 10 6 784 719	Original	<i>Per</i> 245.00 <i>X</i>
7423	CIRCUIT CENTRE	61 31 9 354 047	Original	<i>Per</i> 980.00 <i>X</i>
7445	DRIVER AIRBAG	32 30 6 783 825	Original	<i>Per</i> 1,930.00 <i>✓</i>
1000	FRT SEAT BEAT RH	FRT SEAT BELT	Original	<i>Per</i> 510.00 <i>X</i>
1001	FRT SEAT BELT LH	FRT SEAT BELT	Original	<i>Per</i> 510.00 <i>X</i>
1002	REAR SEAT BELT RH	REAR SEAT BELT	Original	<i>Per</i> 320.00 <i>X</i>
1003	REAR SEAT BELT LH	REAR SEAT BELT	Original	<i>Per</i> 320.00 <i>X</i>
f: OEM Parts				0.00
n: Non-OEM Parts				24,181.65
u: Used parts				
Savings				0.00
Subtotal				24,181.65
Total				24,181.65

Extras

Code	Description	Price SGD
1004	AIR BAG ECU CPL AIR BAG ECU	<i>Per</i> 1,120.00* <i>✓</i>
1005	SEAT BELT A/BAG ECU SEAT BELT	<i>Per</i> 320.00* <i>X</i>
Total Extras		1,440.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	24,181.65	24,181.65
Labour Time Base 12 WU/h		
Total 262.0 WU X 42.00 SGD/h	917.00	
Fixed Rate	700.00	
Total of Labour	<i>1087.50</i>	1,617.00
Total Of Extras		1,440.00
Paint Work Time Base 12 WU/h		
Labour Cost 47.0 WU X 42.00 SGD/h	164.50	
Material Cost	97.32	
Total Paint Including Material	<i>252.96</i>	261.82
Repair Cost Excludes GST		27,500.47
GST (+7.0%)		1,925.03
Repair Cost Included GST		29,425.50

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

Kenneth Kong (LKKAUTO)

From: Kenneth Kong (LKKAUTO)
Sent: Monday, 7 March, 2022 8:08 AM
To: SA 0406; Cecilia Lee Peng Geok
Cc: Kenneth Ding; Accounts (Ding Auto)
Subject: RE: OD CLAIM - SMJ2407R - REF : SNM21D207613/C01 - OWNER'S FEEDBACK

Hi Henry, this vehicle is a limit repair case and the left hand front absorber is not consistent with the claim. If the owner insist to change, please ask him to pay for the additional repair. Thanks

From: SA 0406 [mailto:sa0406@dingauto.sg]
Sent: Saturday, 5 March, 2022 3:56 PM
To: Cecilia Lee Peng Geok
Cc: Kenneth Kong (LKKAUTO); Kenneth Ding; Accounts (Ding Auto)
Subject: OD CLAIM - SMJ2407R - REF : SNM21D207613/C01 - OWNER'S FEEDBACK


Dear Cecilia,

Good day to you.

Refer to the above case, the vehicle's owner feedback that the RH front undercarriage made noise when crossing the road hump. Hence, we checked and agreed to replace the RH front shock absorber again as it is related to the accident claim. But the owner insisted the LH front shock absorber needed to be replaced as a pair. He said will drop an email to CTI to request it.

Thank you.

Henry Lee
Ding Auto Pte Ltd.

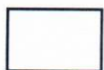

Virus-free. www.avast.com