

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/ICS21013298/DNF3E2

Date: 05/08/2022

REFERENCE

Handling Insurer: ECICS Limited Policy No:
Claimant Vehicle No : SH9943C **Insured Vehicle No :** SJU8213X
Date of Loss: 25/12/2021 Nature of Claim: TP Claim No: DMPC2100473H/02/CT

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SH9943C**
Make & Model: HYUNDAI AE IONIQ HEV FL, 1.6 DCT (A) Engine No: G4LEKU409922
Reg. Date: 18/03/2020 (Man. Year: 2019) Chassis No: KMHC851CVLU190248
Colour: Blue Odometer: 140351 km
Engine Capacity: 1580 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195/65 R15 Rear Tyre Size: 195/65 R15
Front Left Side: West Lake 5 mm Rear Left Side: West Lake 5 mm
Front Right Side: West Lake 5 mm Rear Right Side: West Lake 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	28,918.66	15,772.44	13,146.22	45.46
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,210.00	2,190.00	3,020.00	57.97
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	34,128.66	17,962.44	16,166.22	47.37
+ GST 7.00/7.00% (S\$)	2,389.01	1,257.37	1,131.64	47.37
Nett Amount (S\$)	36,517.67	19,219.81	17,297.86	47.37

INSPECTION

Date of Assignment: 29/12/2021
Date Inspected: 30/12/2021 Inspected At: Bifrost Auto Pte Ltd (sin Ming) (HQ)
Estimated Period of Repair: 9.0 days Blk 9 Sector C, #01-42 Sin Ming Industrial Estate
Singapore 575644

Adjuster: BRYAN TANI

Manager: HUEY YON

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 05 Aug 2022)
Parts:	143	HYUNDAI AE IONIQ HEV FL 1.6 DCT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SH9943C)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BONNET	Bent	2,253.80 FL	*2,253.80 FL
2	1		*BONNET LOCK	Bent	127.30 FL	*127.30 FL
3	1		*RADIATOR GRILLE NEW MODEL	Broken	1,568.60 FL	*1,568.60 FL
4	2		*FLAP ASSY ACTIVE AIR UPPER, (LH/RH)	Broken	1,649.20 FL	*1,649.20 FL
5	1		*FLAP ASSY ACTIVE WIRE	Not Necessary	765.30 FL	*- FL
6	1		*FRONT NUMBER PLATE GARNISH	Serviceable	188.00 FL	*- FL
7	1		*FRONT BUMPER COVER	Distorted / Broken	418.30 FL	*418.30 FL
8	1		*FRONT BUMPER TOP COVER	Not Necessary	476.30 FL	*- FL
9	1		*FRONT BUMPER SPONGE	Torn	186.90 FL	*186.90 FL
10	1		*FRONT BUMPER REINFORCEMENT	Bent	1,075.10 FL	*394.80 FL
11	2		*FRONT BUMPER REINFORCEMENT ABSORBER (LH/RH)	Bent	373.00 FL	*373.00 FL
12	1		*FRONT BUMPER TOWING COVER	Serviceable	29.00 FL	*- FL
13	1		*FRONT BUMPER MOULDING CENTRE UPPER	Mtg Broken	368.50 FL	*368.50 FL
14	1		*FRONT BUMPER LOWER STIFFNER	Not Necessary	285.10 FL	*- FL
15	1		*FRONT BUMPER LOWER GRILLE	Not Necessary	365.30 FL	*- FL
16	1		*FRONT BUMPER LOWER GRILLE MOULDING	Not Necessary	127.60 FL	*- FL
17	1		*FRONT BUMPER LIP	Not Necessary	35.10 FL	*- FL
18	2		*FRONT BUMPER BRACKET TOP (LH/RH)	Not Necessary	70.00 FL	*- FL
19	2		*FRONT BUMPER BRACKET (LH/RH)	Serviceable	56.00 FL	*- FL
20	2		*FRONT BUMPER RETAINER MOUNTING (LH/RH)	Not Necessary	130.60 FL	*- FL
21	10		*FRONT BUMPER CLIPS	Necessary	25.00 FL	*25.00 FL
22	1		*HEADLAMP SUPPORT PANEL ASSY	Mtg Broken	949.30 FL	*949.30 FL
23	2		*HEADLAMP (LH/RH)	Cracked	7,974.60 FL	*4,220.60 FL
24	2		*HORN UNIT (LH/RH)	Not Necessary	145.60 FL	*- FL
25	1		*HORN WIRE	Not Necessary	386.70 FL	*- FL
26	1		*RADIATOR INVERTER	Bent	884.80 FL	*884.80 FL
27	1		*RADIATOR	Bent	710.50 FL	*710.50 FL
28	1		*RADIATOR FAN BLOWER MOTOR ASSY	Cracked / Broken	1,226.60 FL	*1,226.60 FL
29	2		*RADIATOR AIR GUARD (LH/RH)	Serviceable	152.80 FL	*- FL
30	2		*RADIATOR AIR GUARD, UPR (LH/RH)	Serviceable	255.00 FL	*- FL
31	1		*AIRCON CONDENSER	Bent	663.60 FL	*663.60 FL
32	1		*BOOT LID	Not Necessary	2,480.40 FL	*- FL
33	1		*BOOT LID RUBBER	Necessary	187.40 FL	*187.40 FL
34	1		*BOOT LID H EMBLEM	Not Necessary	28.00 FL	*- FL
35	1		*EMBLEM-HYBRID	Not Necessary	24.30 FL	*- FL
36	1		*EMBLEM-IONIQ	Not Necessary	31.30 FL	*- FL
37	1		*BOOT LID TRIMBOARD	Not Necessary	259.70 FL	*- FL
38	10		*BOOT LID TRIMBOARD CLIPS	Not Necessary	11.00 FL	*- FL
39	1		*BOOT LID TRIMBOARD, CENTRE	Not Necessary	159.60 FL	*- FL
40	1		*BOOT LID GLASS UPPER MOULDING	Not Necessary	186.30 FL	*- FL
41	1		*BOOT LID GLASS LOWER MOULDING	Not Necessary	145.20 FL	*- FL
42	1		*REAR BUMPER	Distorted / Mtg Cracked	459.40 FL	*459.40 FL
43	1		*REAR BUMPER REINFORCEMENT	Cracked	394.80 FL	*394.80 FL
44	2		*REAR BUMPER REINFORCEMENT BRACKET (LH/RH)	Bent	376.20 FL	*376.20 FL

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
45	1		*ANTENNA ASSY-SMARTK OUTER	Mtg Broken	689.50 FL	*40.50 FL
46	1		*REAR BUMPER CENTRE MOULDING ASSY	Broken	451.25 FL	*451.25 FL
47	1		*REAR BUMPER LOWER CENTRE MOULDING ASSY	Serviceable	47.50 FL	*- FL
48	1		*REAR BUMPER STAY	Not Necessary	138.10 FL	*- FL
49	2		*REAR BUMPER SIDE RETAINER (LH/RH)	Serviceable	171.60 FL	*- FL
50	1		*REAR BUMPER COVER CLIPS	Necessary	22.00 FL	*22.00 FL
51	1		*REAR BUMPER UNDER CENTRE	Mtg Broken	123.85 FL	*123.85 FL
52	2		*REAR BUMPER SIDE UNDER (LH/RH)	Not Necessary	246.20 FL	*- FL
53	1		*REAR BUMPER REAR HOOK	Not Necessary	94.60 FL	*- FL
54	1		*REAR BUMPER REFLECTOR LAMP (LH/RH)	O/S Dislodged	165.80 FL	*82.90 FL
55	1		*REAR BUMPER TOWING COVER	Serviceable	98.80 FL	*- FL
56	1		*REAR BUMPER RESERVE LIGHT (PARKING BRAKE LIGHT)	Socket Broken	328.60 FL	*328.60 FL
57	1		*LICENCE LAMP	Not Necessary	193.53 FL	*- FL
58	1		*REAR PANEL	Dented	532.00 FL	*532.00 FL
59	1		*REAR PANEL GARNISH	Not Necessary	346.80 FL	*- FL
60	1		*REAR TRAY TOOLS BOX RH	Not Necessary	675.30 FL	*- FL
61	1		*REAR TRAY TOOLS BOX LH	Not Necessary	693.20 FL	*- FL
62	1		*REAR TRAY LUGGS CENTER	Not Necessary	354.20 FL	*- FL
63	1		*EXHAUST SILENCER	Not Necessary	943.50 FL	*- FL
64	1		*EXHAUST PIPE HANGER	Not Necessary	29.20 FL	*- FL
65	1		*REAR NUMBER PLATE }	Cut	25.00 FS	*45.00 FS
66	1		*REAR NO PLATE TRIM COVER }	Cut	30.00 FS	*- FS
67	1		*COOLANT	Not Necessary	45.00 FS	*- FS
68	1		*INVERTER COOLANT	Not Necessary	65.00 FS	*- FS
69	1		*BOOT LID COMFORT LOGO & TEL NO. STICKER	Not Necessary	35.00 FS	*- FS
70	1		*BOOT LID COMFORT CABLINK TEL NO. STICKER	Not Necessary	30.00 FS	*- FS
71	2		*REAR WINDSCREEN SEALANT	Not Necessary	92.00 FS	*- FS
72	1		*REAR BUMPER RUBBER MAT	Necessary	50.00 FS	*50.00 FS
73	1		*REAR BUMPER REVERSE SENSOR	Damaged	180.00 FS	*180.00 FS
74	1		*AIRCON METAL HOSE - SMALL	Dented	352.10 FL	*352.10 FL
75	1		*FRONT BUMPER MOULDING	Not Necessary	93.60 FL	*- FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	36,010.33	19,646.80
- List Item Discount on L Items 20.00/20.00% (\$\$)	7,091.67	3,874.36
Total Parts (\$\$)	28,918.66	15,772.44

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING	New	1,800.00	1,000.00
2	SPRAY PAINTING CHARGE	New	1,800.00	800.00
3	WIRING CHARGE	New	100.00	30.00
4	TUFF KOTE	New	100.00	40.00
5	TOWING CHARGE	New	80.00	0.00
6	REMOVE / REFIX REAR WINDSCREEN GLASS	New	240.00	0.00
7	REMOVE / REFIX REVERSE SENSOR	New	120.00	40.00
8	REMOVE / REFIX EXHAUST PIPE	New	80.00	0.00
9	REMOVE / REFIX RADIATOR	New	90.00	50.00
10	REMOVE / REFIX AIRCON & REFILL GAS	New	130.00	80.00
11	REMOVE / REFIX FUSE BOX	New	120.00	0.00
12	DIAGNOSTIC & RESETTNG TO ERASE FAULT CODE	New	550.00	150.00
Gross Labour Cost (\$\$)			5,210.00	2,190.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >