

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG21013310/APA3Q2**Date:** 11/01/2023REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	0999993662
Claimant Vehicle No :	SJT5512H	Insured Vehicle No :	SMK1225A
Date of Loss:	28/12/2021	Nature of Claim:	TP
		Claim No:	9596233237SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJT5512H	Engine No:	1NZX974793
Make & Model:	TOYOTA VIOS, 1.5 (A)	Chassis No:	MR053HY9305131508
Reg. Date:	19/10/2009 (Man. Year: 2009)	Odometer:	210429 km
Colour:	White		
Engine Capacity:	1497 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	185/60 R15	Rear Tyre Size:	185/60 R15
Front Left Side:	Hankook 6 mm	Rear Left Side:	Hankook 6 mm
Front Right Side:	Hankook 6 mm	Rear Right Side:	Hankook 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	14,338.50	8,517.97	5,820.53	40.59
Miscellaneous Items	0.00	0.00	0.00	
Labour	8,130.00	4,600.00	3,530.00	43.42
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	22,468.50	13,117.97	9,350.53	41.62
Approved Total (Overridden) (S\$)		10,500.00		
Nett Amount (S\$)	22,468.50	10,500.00	11,968.50	53.27
+ Loss of Use (17.0 x S\$60.00/day) (S\$)		1,020.00		
+ Doc/Search Fee (S\$)		7.45		
+ Other Costs (S\$)		80.00		
Nett Liability (S\$)		11,607.45		
Global Sum Settlement (S\$)		11,600.00		

INSPECTION

Date of Assignment:	28/12/2021	Advance Auto Garage (HQ)
Date Inspected:	28/12/2021 Inspected At:	23 KAKI BUKIT AVENUE 4 #04-01 AAS KAKI BUKIT CENTRE
Estimated Period of Repair:	15.0 days	Singapore 415933

Adjuster: ADRIAN LING**Manager:** CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR NUMBER PLATE	Bent	30.00 FS	*30.00 FS
2	1		*REAR NUMBER PLATE HOLDER	Deformed	30.00 FS	*30.00 FS
3	2		*REAR NUMBER PLATE LAMP	Not Necessary	151.60 FL	*- FL
4	1		*REAR BUMPER	Distorted	459.50 FL	*459.50 FL
5	1		*REAR BUMPER CLIPS	Necessary	30.00 FS	*30.00 FS
6	2		*REAR BUMPER SIDE HOLDER	Damaged	76.00 FL	*76.00 FL
7	2		*REAR BUMPER REFLECTOR	Cracked	180.60 FL	*180.60 FL
8	2		*REAR BUMPER BRACKET	Bent	171.20 FL	*171.20 FL
9	1		*REAR BUMPER STICKER	Necessary	100.00 FS	*50.00 FS
10	1		*REVERSE SENSOR	Damaged	280.00 FS	*200.00 FS
11	1		*REAR END PANEL	Distorted	586.40 FL	*586.40 FL
12	1		*REAR END PANEL TOP GARNISH	Deformed	230.80 FL	*230.80 FL
13	1		*REAR END PANEL TOP GARNISH CLIPS	Necessary	20.00 FS	*20.00 FS
14	1		*REAR END PANEL SEALANT	Necessary	60.00 FS	*60.00 FS
15	2		*TAILLAMP	Cracked	579.00 FL	*579.00 FL
16	2		*TAILLAMP LOWER BRACKET	Damaged	56.00 FL	*56.00 FL
17	1		*TAILLAMP PANEL	O/S Dented	230.00 FL	*115.00 FL
18	1		*BOOTLID	Distorted	545.10 FL	*545.10 FL
19	1		*BOOTLID LOCK	Jammed	100.70 FL	*100.70 FL
20	1		*BOOTLID WEATHERSTRIPE	Cut	184.50 FL	*184.50 FL
21	2		*BOOTLID HINGE	Bent	137.20 FL	*137.20 FL
22	1		*BOOTLID OUTER GARNISH	Cracked	162.10 FL	*162.10 FL
23	1		*BOOTLID OUTER GARNISH CLIPS	Necessary	10.00 FS	*10.00 FS
24	1		*BOOTLID TOP SPOILER	Not Necessary	1,000.00 FS	*- FS
25	1		*TOYOTA LOGO	Necessary	27.50 FL	*27.50 FL
26	1		*VIOS EMBLEM	Necessary	30.90 FL	*30.90 FL
27	1		*E EMBLEM	Necessary	30.20 FL	*30.20 FL
28	1		*BOOTLID SURROUND MOULDING	Necessary	180.00 FS	*100.00 FS
29	1		*REAR CAMERA	Damaged	480.00 FS	*380.00 FS
30	1		*REAR FENDER	O/S Buckled	1,561.40 FL	*780.70 FL
31	2		*REAR FENDER INNER TRIM COVER	Torn	450.00 FL	*450.00 FL
32	1		*REAR FENDER INNER TRIM COVER CLIPS	Necessary	60.00 FS	*60.00 FS
33	2		*REAR FENDER INNER SHIELD	Not Necessary	137.80 FL	*- FL
34	1		*REAR FENDER INNER SHIELD CLIPS	Not Necessary	40.00 FS	*- FS
35	1		*REAR WINDSCREEN MOULDING	Necessary	120.50 FL	*120.50 FL
36	1		*REAR WINDSCREEN SEALANT	Necessary	60.00 FS	*60.00 FS
37	1		*SPARE TYRE PANEL	Repair	871.40 FL	*- FL
38	1		*SPARE TYRE PANEL TOP BOARD	Torn	127.40 FL	*127.40 FL
39	2		*SPARE TYRE PANEL SIDE SPONGE	N/S Cracked / O/S Deformed	440.00 FL	*440.00 FL
40	1		*REAR EXHAUST PIPE	Not Necessary	569.00 FL	*- FL
41	1		*REAR EXHAUST PIPE MOUNTING	Not Necessary	30.90 FL	*- FL
42	1		*FRONT NUMBER PLATE	Bent	30.00 FS	*30.00 FS
43	1		*FRONT BUMPER	Deformed	481.30 FL	*481.30 FL
44	1		*FRONT BUMPER CLIPS	Necessary	30.00 FS	*30.00 FS
45	2		*FRONT BUMPER SIDE HOLDER	Necessary	76.00 FL	*76.00 FL
46	1		*FRONT BUMPER TOW COVER	Not Necessary	23.60 FL	*- FL
47	1		*FRONT BUMPER REINFORCEMENT	Dented	361.90 FL	*361.90 FL
48	2		*FRONT BUMPER REINFORCEMENT BRACKET	Dented	462.80 FL	*462.80 FL
49	1		*FRONT BUMPER LOWER GRILLE	Deformed	138.50 FL	*138.50 FL
50	2		*FRONT BUMPER SIDE GRILLE	Cracked	136.00 FL	*136.00 FL
51	1		*FRONT BUMPER LOGO	Necessary	65.10 FL	*65.10 FL
52	1		*FRONT BUMPER TOP INNER BRACKET	Distorted	258.80 FL	*258.80 FL
53	1		*FRONT GRILLE	Cracked	320.10 FL	*320.10 FL
54	1		*FRONT GRILLE CLIPS	Necessary	20.00 FS	*20.00 FS
55	1		*BONNET	Not Necessary	589.80 FL	*- FL

Report was unsubmitted during this print-out.

1/11/23, 4:02 PM

Adjuster Report

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
56	1		*BONNET LOCK	Not Necessary	101.20 FL	*- FL
57	2		*HEADLAMP	Cracked	916.00 FL	*916.00 FL
58	2		*HEADLAMP TOP PANEL	Repair	194.40 FL	*- FL
59	1		*FRONT SUPPORT PANEL	Repair	788.60 FL	*- FL
60	1		*AIR CON CONDENSER	Dented	1,069.50 FL	*1,069.50 FL
61	1		*RADIATOR	Not Necessary	1,606.70 FL	*- FL
F=Franchise part. S=SpcNett. L=ListItemDisc.						
Sub Total (\$\$)					18,298.00	10,987.30
- List Item Discount on L Items 25.00/25.00% (\$\$)					3,959.50	2,469.33
Total Parts (\$\$)					14,338.50	8,517.97
Report was unsubmitted during this print-out.						

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING	New	3,800.00	2,000.00
2	SPRAY PAINTING	New	3,000.00	2,000.00
3	WIRING	New	100.00	60.00
4	TO REMOVE REVERSE SENSOR AND REAR CAMERA	New	200.00	100.00
5	TO REMOVE UPHOLSTERY	New	150.00	80.00
6	TO SPRAY TUFF COAT	New	200.00	120.00
7	TO REMOVE FUEL TANK	New	150.00	0.00
8	TO REMOVE REAR WINDSCREEN	New	180.00	120.00
9	TO REMOVE EXHAUST PIPE	New	150.00	0.00
10	TO REMOVE CONDENSER AND TO TOP UP AIR CON GAS	New	100.00	60.00
11	TO REMOVE RADIATOR AND TO TOP UP COOLANT	New	100.00	60.00
Gross Labour Cost (S\$)			8,130.00	4,600.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >