

# PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Mobile: 9061 0543, Email: mirage1195@gmail.com

## ACCIDENT VEHICLE INSPECTION REPORT

Report no : 406M1220.KAW  
Vehicle no : JRH4250

### **1 REFERENCE**

Date of inspection : 27 November 2020  
Requested by : Chai Chee Sin  
c/o 7D Rivervale Crescent  
#08-16  
Singapore 545085  
Type of survey : Independent  
Repairer : Kompressor Automotive Workshop  
8 Kaki Bukit Ave 4, #02-48 Premier @ Kaki Bukit Singapore 415875  
Date of accident : 18 November 2020

### **2 VEHICLE DATA**

Make/model : **Nissan Almera 1.5VL AT**  
Chassis no : PN8BBAN17TCB03524  
Engine no : HR15978951C  
Date of registration : 30 January 2016  
Engine capacity : 1498 cc  
Colour : Black  
Odometer reading : 202707 km

### **3 STATIC CONDITION CHECK**

Steering : Affected  
Foot brakes : Serviceable  
Hand brakes : Serviceable  
Paintwork : Good  
General : Good

### **4 TIRE CONDITION CHECK**

	<u>RH/MAKE</u>	<u>LH/MAKE</u>	<u>SIZE</u>
Front tread	: 6 mm/Yokohama	6 mm/Yokohama	205/45R16
Rear tread	: 6 mm/Yokohama	6 mm/Yokohama	205/45R16

### **5 BRIEF DESCRIPTION OF DAMAGE**

Front bumper scraped/deformed, front LH fender grazed/bent/distorted, LH front door grazed/bent/creased, LH headlamp assy leg bent/casing broken, LH front undercarriage & suspension parts damaged, etc. Please see para. 8 of this report for more details.

### **6 REMARKS**

This inspection is carried out on a "WITHOUT PREJUDICE" basis and I have not authorized any repairs.

### **7 RECOMMENDATION**

Cost of repairs : \$5,100.00 (lump sum)  
Est. no. of days taken : Seven (7)

**8 ASSESSMENT OF DAMAGE AND COSTS**

Report no: 406M1220.KAW  
 Vehicle no: JRH4250

**A SPARE PARTS**

Description	Qty	Assessed Condition	Repairer's Amount	Revised Amount
<u>(Nett item)</u>				
Front bumper X Repair	1	scraped/deformed	316.80	316.80
Front bumper side retainer X SVC	2	necessary	44.20	44.20
Front bumpert chrome trim X SVC	1	bent/deformed	108.60	108.60
LH front fender X Repair	1	grazed/bent/distorted	457.40	457.40
LH front fender splash shield SVC	1	to reuse	70.60	0.00
LH front door X Repair	1	grazed/bent/creased	1,123.90	1,123.90
LH front door frame black sticker set X SVC	1	necessary	35.10	35.10
LH headlamp assy X SVC	1	leg bent/casing broken	359.50	359.50
LH front lower arm X SVC	1	bent/bush torn	207.20	207.20
LH knuckle arm X SVC	1	bent	376.90	376.90
LH knuckle arm bearing X SVC	1	necessary	106.50	106.50
		Subtotal of the above	3,206.70	3,136.10
		Discount 10% / 10%	320.67	313.61
		Subtotal 1:	2,886.03	2,822.49
LH front sport rim ✓	1	scraped/deformed	520.00	520.00 400
LH front tyre X SVC	1	sidewall grazed/deformed	255.00	255.00
LH front fender splash shield clip ✓	8	necessary	24.00	24.00 ✓
Front shock absorber (set) X SVC	1	bent	800.00	800.00
Front bumper clip ✓	10	necessary	30.00	30.00 ✓
		Subtotal 2:	1,629.00	1,629.00
		Total cost of parts:	4,515.03	4,451.49

**B LABOUR**

Labour charges to dismantle and remove all dmaaged parts, renew and install the same; to cut out the damaged body panels, renew and weld the same; to panel beat and straighten affected areas.	750.00	500.00 400
Spray painting charges to putty and spray paint the front bumper, front fender, front door and necessary areas.	1,000.00	750.00 600
To spray anti-rust protection for the affected parts and areas.	120.00	60.00 ✗
To check wiring.	40.00	30.00 ✗
To align headlamps and refocus headlamp beams.	80.00	60.00 ✗
To remove and transfer front door glass and fittings.	80.00	60.00 ✗
To remove and replace damaged left hand front suspension and undercarriage parts.	450.00	300.00 ✗
To conduct wheel alignment before repair.	60.00	60.00 ✓
To conduct wheel alignment after repair.	60.00	60.00 ✓
Total cost of labour:	2,640.00	1,880.00 1120
Total cost of repair:	7,155.03	6,331.49

Report no: 406M1220.KAW  
Vehicle no: JRH4250

**9 CONCLUSION**


The revised or adjusted cost of repairs to restore the vehicle is 1574 \$6,331.49

(a) The recommended cost of repair based on lump sum repairs would be -20%: 1250 \$5,100.00

(b) The estimated number of days taken by the repairs would be 5 Days Seven (7)  
(1<sup>st</sup> Reinspection conducted on 6 April 2021)  
(Post Repair Inspection conducted on 12 April 2021)

*The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its pre-accident condition.*

Yours faithfully



Liaw Leong San  
Licensed Automotive Appraiser

Dated: 17 May 2021