



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBE 8057J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	REAR BACK DOOR N/S	BADLY DENTED	1,250.00	1,250.00
1	REAR BACK DOOR GLASS N/S	BROKEN	668.00	668.00
1	REAR BACK DOOR OUTER HANDLE N/S	TO REPAIR SEE LABOUR	205.00	-
1	REAR BACK DOOR "PEUGEOT" EMBLEM N/S	NECESSARY	90.00	90.00
1	REAR BACK DOOR WIPER ARM	DAMAGED	125.00	125.00
1	REAR BACK DOOR WIPER MOTOR	CRACKED	520.00	520.00
1	REAR BACK DOOR INNER LOCK N/S	JAMMED / SHORTED	145.00	145.00
1	REAR BACK DOOR INNER TRIM BOARD N/S	NOT NECESSARY	182.00	-
2	REAR BACK DOOR LICENCE LAMPS @\$53.00	GRAZED (1 PC ONLY)	106.00	53.00
1	REAR BACK DOOR O/S	DENTED	1,250.00	1,250.00
1	REAR BACK DOOR "PARTNER" EMBLEM O/S	NECESSARY	88.00	88.00
1	REAR BACK DOOR INNER LOCK O/S	SERVICEABLE	145.00	-
1	REAR BUMPER	DENTED	685.00	685.00
1	REAR BUMPER BEAM	BENT	452.00	452.00
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	50.00
2	REAR BUMPER SIDE HOLDERS @\$60.00	NOT NECESSARY	120.00	-
1	REAR END PANEL OUTER	BADLY DENTED	665.00	665.00
1	REAR END PANEL INNER	TO REPAIR SEE LABOUR	715.00	-
1	REAR END PANEL RUBBER	TWISTED	266.00	266.00
1	TAILLAMP N/S	CRACKED	245.00	245.00
	LESS 10% DISCOUNT		-797.20	-655.20
			7,174.80	5,896.80
<b><u>SPECIAL NETT ITEMS</u></b>				
1	SET REAR BUMPER REVERSE SENSOR (SN)	SHORTED	280.00	200.00
1	REAR LICENCE PLATE (SN)	CRACKED	50.00	40.00
1	SET REAR REVERSE CAMERA (SN)	SERVICEABLE	300.00	-
1	REAR BACK DOOR GLASS SEALANT N/S (SN)	NECESSARY	50.00	40.00
1	REAR BACK DOOR GLASS SEALANT O/S (SN)	NECESSARY	50.00	40.00

Report Ref No. CS/SMO21013328/Uqf3n2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR 70KM/H STICKER (SN)	NECESSARY	20.00	10.00
			750.00	330.00
	<b><u>LABOUR</u></b>			
	TO CHECK WIRING.		50.00	20.00
	TO DISMANTLE & REPLACED REAR REVERSE SENSOR.		80.00	50.00
	TO DISMANTLE & REPLACED REAR BACK DOOR GLASS N/S.		120.00	100.00
	TO DISMANTLE & REFIX REAR BACK DOOR GLASS O/S.		120.00	100.00
	TO TRANSFER REAR BOTH BACK DOOR COMPONENTS.		150.00	100.00
	TO SPRAY RUST PROOFING.		100.00	80.00
	LABOUR FOR PANEL BEATING & REPLACED PARTS.INCLUSIVE OF THE REPAIR OF REAR BACK DOOR OUTER HANDLE N/S AND REAR END PANEL INNER.		880.00	600.00
	TO PUTTY & SPRAY PAINTING.		1,080.00	800.00
			2,580.00	1,850.00
<b>GRAND TOTAL</b>			<b>10,504.80</b>	<b>8,076.80</b>

<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>6,400.00</b>
---	--	--	-----------------

Report Ref No. CS/SMO21013328/Uqf3n2

CHUA KANG SENG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.