

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CS/AIG22000004/RTF3N2**Date:** 07/02/2022**REFERENCE**

Insured/Claimant:	TOH YING HUI ELAINE	Policy No:	1900109936	
Date of Loss:	30/12/2021	Nature of Claim:	OD	Claim No: 8381874098SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMM8843J	Engine No:	G4FGKH741973
Make & Model:	KIA CERATO, 1.6 (A)	Chassis No:	KNAF3416MK5047586
Reg. Date:	18/07/2019 (Man. Year: 2019)	Odometer:	19863 km
Colour:	White		
Engine Capacity:	1591 cc		
Market Value/New Car Price:	S\$77,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55R16	Rear Tyre Size:	205/55R16
Front Left Side:	Yokohama 6 mm	Rear Left Side:	Yokohama 6 mm
Front Right Side:	Yokohama 6 mm	Rear Right Side:	Yokohama 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	8,300.00	5,462.40	2,837.60	34.19
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,700.00	3,840.00	860.00	18.30
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	13,000.00	9,302.40	3,697.60	28.44
- Excess (S\$)	300.00	300.00	0.00	0.00
(S\$)	12,700.00	9,002.40	3,697.60	29.11
+ GST 7.00/7.00% (S\$)	889.00	630.17	258.83	29.11
Nett Amount (S\$)	13,589.00	9,632.57	3,956.43	29.11

INSPECTION

Date of Assignment:	03/01/2022	
Date Inspected:	03/01/2022 Inspected At:	Cycle & Carriage KIA Pte Ltd (Pandan Gardens) 209 Pandan Gardens Singapore 609339
Estimated Period of Repair:	8.0 days	

Adjuster: MOHD RASUL**Manager:** DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*LAMP ASSY-HEAD,LH	Cracked	1,219.00 FL	*1,219.00 FL
2	1		*LAMP ASSY-HEAD,RH	Not Necessary	1,219.00 FL	*- FL
3	1		*HORN ASSY-LOW PITCH	Not Necessary	74.00 FL	*- FL
4	1		*RADIATOR ASSY	bent	646.00 FL	*646.00 FL
5	1		*BLOWER ASSY	Not Necessary	656.00 FL	*- FL
6	1		*GUARD-AIR,LH	Scratched	28.00 FL	*28.00 FL
7	1		*GUARD-AIR,RH	Scratched	28.00 FL	*28.00 FL
8	1		*CONDENSER ASSY-COOLER	Bent	687.00 FL	*687.00 FL
9	1		*PANEL ASSY-UNDER COVER	Not Necessary	117.00 FL	*- FL
10	1		*DUCT ASSY-AIR	Cracked	55.00 FL	*55.00 FL
11	1		*PANEL ASSY-HOOD	Bent	1,502.00 FL	*1,502.00 FL
12	1		*HINGE ASSY-HOOD,RH	Bent	43.00 FL	*43.00 FL
13	1		*HINGE ASSY-HOOD,LH	Bent	43.00 FL	*43.00 FL
14	1		*PANEL-FENDER,LH	Bent	430.00 FL	*430.00 FL
15	1		*PANEL-FENDER,RH	Repair	430.00 FL	*- FL
16	1		*CARRIER ASSY-FRONT END MODULE	Cracked	675.00 FL	*675.00 FL
17	1		*BEAM COMPLETE-FR BUMPER	Not Necessary	497.00 FL	*- FL
18	1		*PAD-HOOD INSULATING	Deformed	156.00 FL	*156.00 FL
19	1		*GUARD ASSY-FRONT WHEEL,LH	Not Necessary	95.00 FL	*- FL
20	1		*COVER-FR BUMPER	Torn	633.00 FL	*633.00 FL
21	1		*GRILLE-FRONT BUMPER	Not Necessary	262.00 FL	*- FL
22	1		*GRILLE ASSY-RADIATOR	Cracked	328.00 FL	*328.00 FL
23	1		*GARNISH-RADIATOR GRILLE	Cracked	38.00 FL	*38.00 FL
24	1		*MOULDING-FRONT BUMPER,LH	Cracked	36.00 FL	*36.00 FL
25	1		*AIR DUCT-FR BUMPER,LH	Not Necessary	14.00 FL	*- FL
26	1		*ABSORBER-FRONT BUMPERENERGY	Cracked	84.00 FL	*84.00 FL
27	1		*STIFFNER-FR BPR LWR	Not Necessary	114.00 FL	*- FL
28	1		*BRACKET-FR BUMPER UPRSIDE MTG	Not Necessary	22.00 FL	*- FL
29	1		*BRACKET-FR BUMPER UPRSIDE MTG	Not Necessary	22.00 FL	*- FL
30	1		*ORNAMENT-KIA NO.115	Necessary	32.00 FL	*32.00 FL
31	1		*FRT NUMBER PLATE WITH FRAME	Bent	50.00 FS	*50.00 FS
32	1		*SUNDRIES	Necessary	50.00 FS	*30.00 FS
33	1		*DUCT EXTENSION	Cracked	5.00 FL	*5.00 FL
			Supplementary			
34	1		*CLIP (10PCS)	Necessary	10.00 FL	*10.00 FL
			Supplementary			
35	1		*REAINER - COWL TOP COVER MTG (5PCS)	Necessary	10.00 FL	*10.00 FL
			Supplementary			
36	1		*CLIPS - HOOD INSULATING PAD MTG (14PCS)	Necessary	14.00 FL	*14.00 FL
			Supplementary			
37	1		*COOLANT (4L)	Necessary	26.00 FL	*26.00 FL
			Supplementary			

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	10,350.00	6,808.00
- List Item Discount on L Items 20.00/20.00% (\$)	2,050.00	1,345.60
Total Parts (\$)	8,300.00	5,462.40

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
<u>Miscellaneous Items</u>				
1	1	*OD/TP Case (Insurer)	-	0.00
Sub Total (\$\$)			0.00	0.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	REPLACE FRT BUMPER,SUPPRT,BONNET,FRT LH FENDER & AFFECTED AREA REPAIR ON FRT RH FENDER	New	2,400.00	1,600.00
2	PAINT WORK ON FRT BUMPER,BONNET,FRT LH DOOR & BOTH FRT FENDER	New	1,750.00	1,750.00
3	REMOVE & REPLACE RADIATOR,CONDENSER	New	120.00	120.00
4	TO TOP UP AIRCON GAS	New	80.00	80.00
5	TO APPLY SEALANT ON AFFECTED AREA	New	80.00	60.00
6	PERFORM RUST PREVENTION	New	120.00	80.00
7	CHECK WIRING & CHASSIS ELECTRICAL SYSTEM	New	30.00	30.00
8	TO CARRY OUT DIAGNOSTIC CHECK ON ELECTRONIC CONTROL SYSTEM	New	120.00	120.00
Gross Labour Cost (\$\$)			4,700.00	3,840.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >