



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2200955

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 22/02/2022
Reference CC4/FCI22000212/Bea3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SNC 351E
Insured Veh. GBC 1203K
Claim No. D22000097MFCV
Policy No.
Accident Date 05/01/2022
Inspection Date 07/01/2022

Description	Total
Survey Inspection	357.00
Digital Photographs	
Transportation	
Subtotal	357.00
GST (7%)	24.99
Grand Total	381.99

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Ref: CC4/FCI22000212/Bea3q2 Date: 22/02/2022 Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	GBC 1203K	Veh. Inspected	SNC 351E
Policy No.		Coverage (\$)	0.00
Claim No.	D22000097MFCV	Excess (\$)	0.00
Assign From	CHRIS	Assign Date	06/01/2022
2. Vehicle Particulars & Condition			
Make & Model	TOYOTA SIENTA HYBRID 1.5X	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2021
Chassis No.	NHP1707178535	Colour	BLACK
Odometer	27227 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	FAIR		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	185/60 R15	TOYO	5 mm
L/H Front Tyre	185/60 R15	TOYO	5 mm
R/H Rear Tyre	185/60 R15	TOYO	5 mm
L/H Rear Tyre	185/60 R15	TOYO	5 mm
4. Description of Damages			
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.		
5. General Information			
Accident Date	05/01/2022	Inspection Date	07/01/2022
Survey held at	TEAM AUTOPRO PTE LTD 160 SIN MING DR #01-14 SIN MING AUTO CITY SINGAPORE 575722		
5a. Remarks			
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.		
5b. Estimate Days of Repair			
	ESTIMATED NORMAL PERIOD FOR REPAIR:		9 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SNC 351E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	TAILGATE	DENTED	1,431.90	1,076.00
1	TAILGATE LOGO	NECESSARY	84.60	60.00
1	TAILGATE EMBLEM 'HYBRID'	NECESSARY	98.00	65.60
1	TAILGATE OUTER GARNISH	BROKEN	375.75	364.00
1	TAILGATE INNER LOCK	JAMMED	371.40	321.00
1	TAILGATE LOCK STICKER	NOT DAMAGED	121.10	-
1	TAILGATE ANTENNA SENSOR	BROKEN	198.20	153.20
1	TAILGATE WEATHERSTRIP	TORN	381.90	316.00
1	TAILGATE INNER TRIM BOARD	NOT DAMAGED	387.00	-
1	TAILGATE INNER HANDLE	NOT DAMAGED	141.00	-
2	TAILGATE LAMP @\$503.60	CUT	1,007.20	1,007.20
1	TAILGATE WINDSCREEN MOULDING	NECESSARY	241.00	197.10
1	REAR BUMPER	BROKEN	691.10	691.10
2	REAR BUMPER SIDE RETAINER @\$87.60	NECESSARY	175.20	130.00
1	REAR BUMPER PROTECTOR CENTRE	CUT	384.60	209.00
2	REAR BUMPER PROTECTOR SIDE @\$234.50	CUT	469.00	318.00
2	REAR BUMPER REFLECTOR @\$145.00	BROKEN	290.00	166.00
1	REAR END PANEL	TO REPAIR SEE LABOUR	788.20	-
1	REAR END PANEL TOP GARNISH	NOT DAMAGED	374.25	-
1	SPARE TYRE PANEL	NOT DAMAGED	975.65	-
1	SPARE TYRE PANEL TOP BOARD	NOT DAMAGED	591.68	-
1	SPARE TYRE PANEL INSULATOR	NOT DAMAGED	581.40	-
2	REAR FENDER INNER TRIM BOARD @\$688.74	NOT DAMAGED	1,377.48	-
2	TAILLAMP @\$779.80	O/S BROKEN / N/S CUT	1,559.60	1,559.60
2	TAILLAMP LOWER BRACKET @\$184.30	NECESSARY	368.60	166.20
	LESS 25% DISCOUNT		-3,366.45	-1,700.00
			10,099.36	5,100.00
SPECIAL NETT ITEMS				
1	SUNDRIES (SN)	NOT NECESSARY	80.00	-

Report Ref No. CC4/FCI22000212/Bea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAILGATE SEALANT (SN)	NECESSARY	100.00	40.00
1	TAILGATE OUTER GARNISH CLIPS (SN)	NECESSARY	50.00	30.00
1	TAILGATE INNER TRIM BOARD CLIPS (SN)	NOT NECESSARY	50.00	-
2	TAILGATE LAMP CLIPS @\$50.00 (SN)	NO SUCH PARTS	100.00	-
2	TAILGATE LAMP SEAL @\$60.00 (SN)	NECESSARY	120.00	60.00
1	TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	120.00	40.00
1	TAILGATE WINDSCREEN INNER SEAL (SN)	NECESSARY	60.00	30.00
1	TAILGATE WINDSCREEN PRIMER & CLEANER (SN)	NOT NECESSARY	80.00	-
1	REAR BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	REAR BUMPER PROTECTOR CENTRE CLIPS (SN)	NOT NECESSARY	50.00	-
2	REAR BUMPER PROTECTOR SIDE CLIPS @\$50.00 (SN)	NOT NECESSARY	100.00	-
1	REAR END PANEL SEALANT (SN)	NOT NECESSARY	100.00	-
1	REAR END PANEL TOP GARNISH CLIPS (SN)	NOT NECESSARY	50.00	-
1	SPARE TYRE PANEL SEALANT (SN)	NOT NECESSARY	100.00	-
2	REAR FENDER INNER TRIM BOARD CLIPS @\$50.00 (SN)	NOT NECESSARY	100.00	-
2	TAILLAMP SEAL @\$60.00 (SN)	NECESSARY	120.00	60.00
2	TAILLAMP CLIPS @\$50.00 (SN)	NO SUCH PARTS	100.00	-
2	REVERSE SENSOR @\$250.00 (SN)	SCRATCHED	500.00	200.00
			2,030.00	490.00
	LABOUR			
	R&R TAILGATE COMPONENT .		150.00	80.00
	R&R TAILGATE WINDSCREEN.		250.00	120.00
	R&R REVERSE SENSOR.		100.00	60.00
	CHECK WIRING .		100.00	20.00
	UPHOLSTERY .	NOT NECESSARY	200.00	-
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR END PANEL .		1,800.00	1,000.00
	RUST PROOFING .	NOT NECESSARY	200.00	-
	SPRAY PAINTING.		1,800.00	600.00
			4,600.00	1,880.00
	GRAND TOTAL		16,729.36	7,470.00



RECOMMENDED COST OF REPAIRS			7,470.00
------------------------------------	--	--	-----------------

Report Ref No. CC4/FCI22000212/Bea3q2

LIM TEOW GUAN

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SNC 351E

INSPECTION

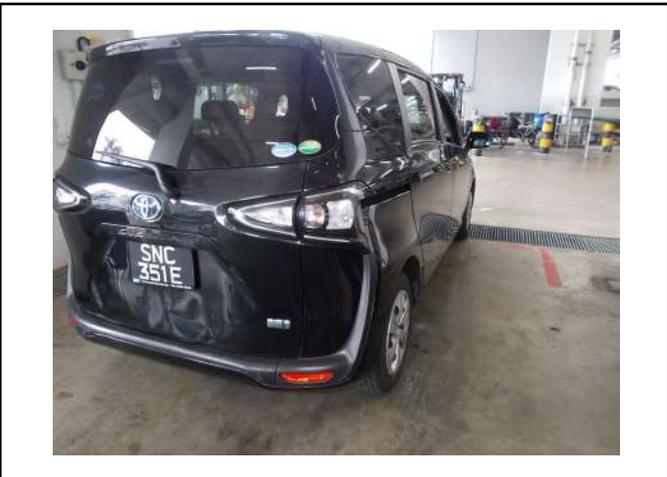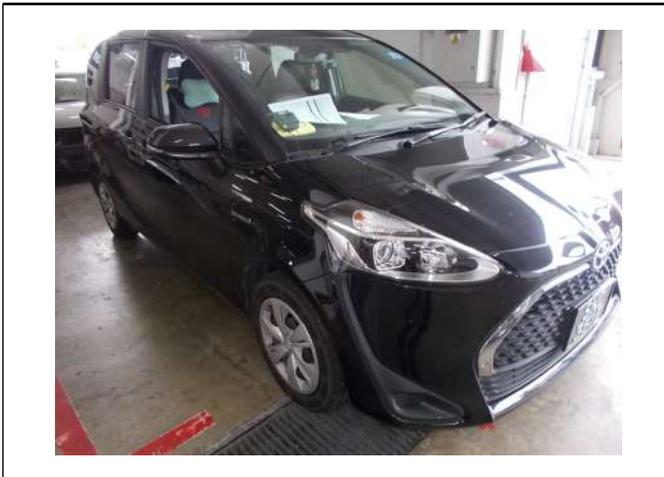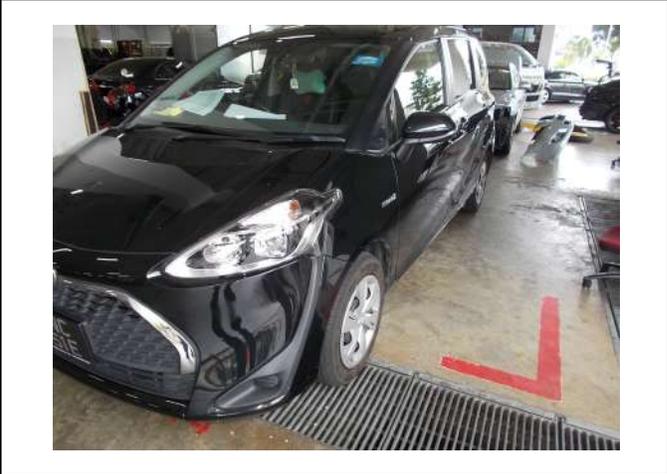





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

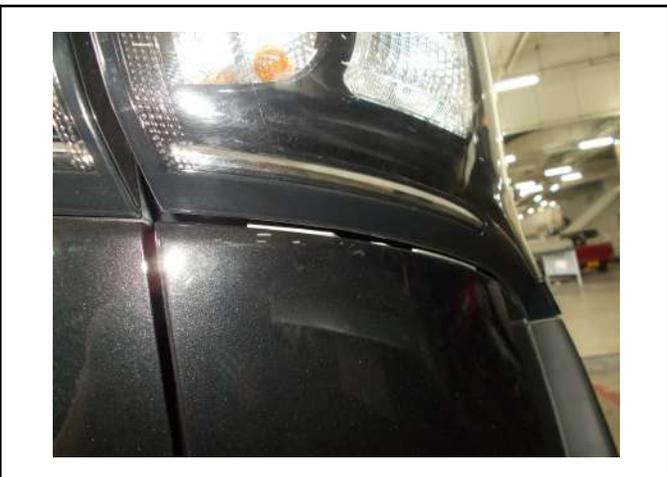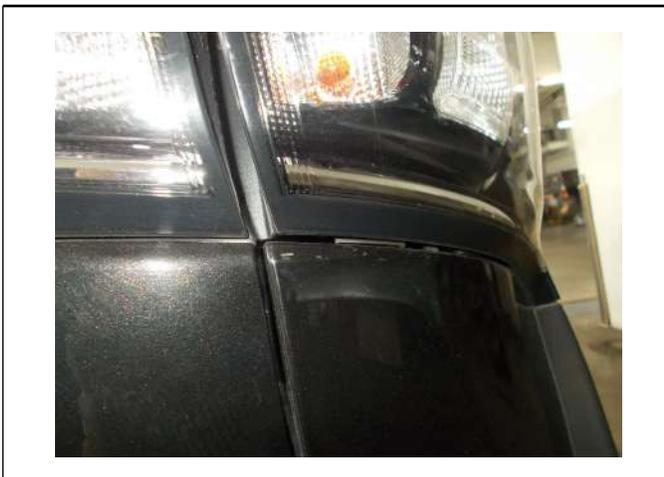



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

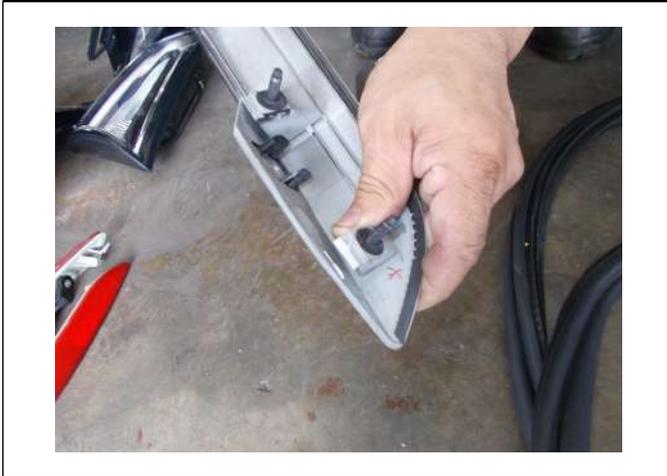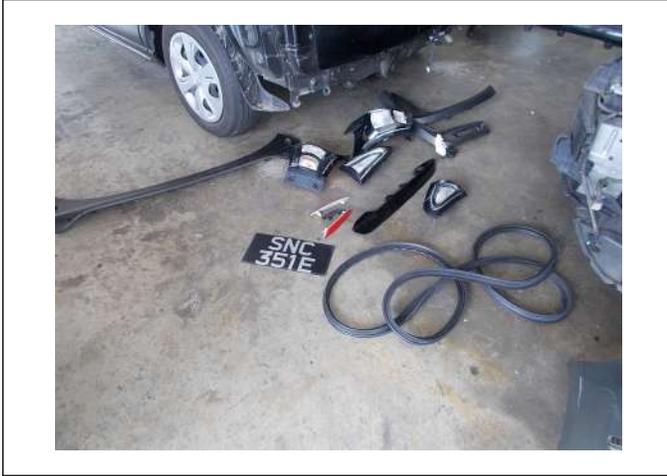



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

