



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBE 2575U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	FRONT GRILLE BASE	CRACKED	428.00	410.00
1	FRT GRILLE TOP	LOOP CRACKED	182.00	182.00
4	FRT GRILLE CLIP @\$8.90	NECESSARY	35.60	35.60
1	FRT BUMPER	DENTED	687.00	598.20
1	FRT BUMPER GRILLE	CRACKED	214.00	214.00
1	FRT BUMPER REINFORCEMENT	DENTED	698.00	458.20
1	FRT BUMPER SIDE COVER RH	DEFORMED / CRACKED	89.60	89.60
2	FRT BUMPER SIDE RETAINER R/L @\$124.00	O/S CRACKED / N/S NOT NECESSARY	248.00	124.00
2	FRT BUMPER SIDE COVER CLIP @\$8.90	MISSING (1PC ONLY)	17.80	8.90
1	HEADLAMP RH	DEFACED / LOOP BROKEN	2,584.50	1,950.00
1	FRT DOOR PILLAR RH	TO REPAIR SEE LABOUR	586.00	-
1	FRT DOOR WEATHERSTRIP RH	NOT NECESSARY	211.00	-
1	FRT DOOR STEP GARNISH RH	NOT NECESSARY	281.00	-
1	AIR CLEANER ASSY	DENTED / BROKEN	891.00	687.50
1	AIR DUCT TOP HOSE	DENTED / DISTORTED	220.00	177.25
1	FRT WIRE HARNESS RH	TO REPAIR SEE LABOUR	1,567.52	-
1	FRT WIRE HARNESS BRACKET RH	CRACKED	182.00	182.00
1	FRT CORNER PANEL RH (NPA)	TO REPAIR SEE LABOUR	-	-
1	FRT SUPPORT PANEL RH (NPA)	TO REPAIR SEE LABOUR	-	-
1	FRT DOOR RH (NPA)	TO REPAIR SEE LABOUR	-	-
1	FRT DOOR PILLAR RH (NPA)	TO REPAIR SEE LABOUR	-	-
	LESS 25% DISCOUNT		-2,280.76	-1,279.31
			6,842.26	3,837.94

Report Ref No. CS1/LAW22000228/Tqf3e2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	FRT DOOR STICKER (COMPANY REG.) (SN)	O/S NECESSARY	28.00	28.00
			28.00	28.00
	<b><u>LABOUR</u></b>			
	TO REMOVE AND REINSTALL ELECTRICAL WIRING SYSTEM FOR NECESSARY REPAIRS. TO CHECK ELECTRICAL SYSTEM AND REPAIR WIRE HARNESS.		120.00	40.00
	TO SPRAY ANTI-RUST COATING ON NEW AND AFFECTED PANELS.	NOT NECESSARY	120.00	-
	TO REMOVE, REPLACE AND REINSTALL RH HEADLAMP AND FOCUS HEADLAMP.	NOT NECESSARY	50.00	-
	TO TRANSFER RHF DOOR COMPONENT PARTS TO NEW DOOR.	NOT NECESSARY	220.00	-
	TO REMOVE AND REINSTALL A/C CONDENSER, A/C PIPINGS FOR NECESSARY REPAIRS. (INCLUDE VACUUM & RECHARGE A/C GAS).	NOT NECESSARY	280.00	-
	TO REMOVE, REPLACE AND REINSTALL AIR CLEANER ASSY.		180.00	40.00
	TO REMOVE AND REINSTALL RHF INTERIOR TRIMS, GARNISHES, ETC. FOR NECESSARY REPAIRS. (INCLUDE REMOVE CARPET).	NOT NECESSARY	220.00	-
	TO SUPPLY BODY STICKER FILM MATERIALS SUCH AS ARTWORK, LOGO, ETC, AND WRAP, APPLY ON RHF DOOR.		580.00	100.00
	TO STRAIGHTEN, REPAIR, REALIGN ON AFFECTED AREA AND REPLACE DAMAGED PARTS. INCLUSIVE OF THE REPAIR OF FRT DOOR PILLAR RH, FRT WIRE HARNESS RH, FRT CORNER PANEL RH, FRT SUPPORT PANEL RH, FRT DOOR RH AND FRT DOOR PILLAR RH.		1,250.00	500.00
	TO SPRAY PAINTING, BLENDING ON AFFECTED AND ADJACENT AREA.		660.00	450.00
			3,680.00	1,130.00
<b>GRAND TOTAL</b>			<b>10,550.26</b>	<b>4,995.94</b>

<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>4,000.00</b>
---	--	--	-----------------

Report Ref No. CS1/LAW22000228/Tqf3e2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

ANG BRYAN TANI

Automotive Assessor / Investigator

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.