

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CC3/AIG22000265/RVCN2**Date:** 19/05/2022**REFERENCE**

Insured/Claimant: MOHAMED NOOR BIN AKBAR Policy No: 1900141871-01
Date of Loss: 06/01/2022 Nature of Claim: OD Claim No: 5004785751SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMN3130K**
Make & Model: AUDI Q2, 999cc 1.0 TFSI S TRONIC (A) Engine No: CHZC30340
Reg. Date: 31/07/2019 (Man. Year: 2019) Chassis No: WAUZZZGA3KA061319
Colour: Black Odometer: 72561 km
Engine Capacity: 999 cc
Market Value/New Car Price: S\$110,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 215/60R16 Rear Tyre Size: 215/60R16
Front Left Side: Bridgestone 6 mm Rear Left Side: Bridgestone 6 mm
Front Right Side: Bridgestone 6 mm Rear Right Side: Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	37,448.00	16,884.24	20,563.76	54.91
Miscellaneous Items	0.00	0.00	0.00	
Labour	24,344.00	13,094.00	11,250.00	46.21
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	61,792.00	29,978.24	31,813.76	51.49
- Excess (S\$)	800.00	800.00	0.00	0.00
(S\$)	60,992.00	29,178.24	31,813.76	52.16
+ GST 7.00/7.00% (S\$)	4,269.44	2,042.48	2,226.96	52.16
Nett Amount (S\$)	65,261.44	31,220.72	34,040.72	52.16

INSPECTION

Date of Assignment: 10/01/2022

Date Inspected: 07/01/2022 Inspected At:

24 BENOI SECTOR
SINGAPORE 629857
REPAIRER: PREMIUM AUTOMOBILES PTE LTD

Estimated Period of Repair: 17.0 days

Adjuster: MOHD RASUL**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*FRONT BUMPER	Deformed	1,936.00 FS	*1,547.60 FS
2	1	*FRONT BUMPER FIXING PARTS	Not Necessary	347.00 FS	*- FS
3	1	*FRONT BUMPER GRILLE-CENTER	Cracked	197.00 FS	*157.20 FS
4	2	*FRONT BUMPER AIR GUIDE GRILLE-LH/RH	Scratched	338.00 FS	*270.40 FS
5	2	*FRONT BUMPER END CAP-LH/RH	Not Necessary	118.00 FS	*- FS
6	1	*FRONT BUMPER SPOILER	Cracked	299.00 FS	*238.80 FS
7	1	*FRONT BUMPER CLOSING ELEMENT	Not Necessary	156.00 FS	*- FS
8	2	*FRONT WHEEL SPOILER-LH/RH	Not Necessary	68.00 FS	*- FS
9	2	*FRONT BUMPER ADAPTER-LH/RH	Not Necessary	78.00 FS	*- FS
10	1	*RADIATOR GRILLE	Cracked	1,411.00 FS	*1,128.80 FS
11	1	*RADIATOR STRIKER PLATE	Necessary	124.00 FS	*99.20 FS
12	1	*FRONT BUMPER FOAM FILLER PIECE	Not Necessary	78.00 FS	*- FS
13	1	*FRONT BUMPER REINFORCEMENT BEAM	Bent	723.00 FS	*578.40 FS
14	2	*FRONT BUMPER GUIDE SECTION-LH/RH	Not Necessary	72.00 FS	*- FS
15	1	*FRONT BUMPER TOP COVER	Cracked	100.00 FS	*80.00 FS
16	1	*CAUTION STICKER	Necessary	14.00 FS	*10.88 FS
17	1	*AIR COND STICKER	Necessary	8.00 FS	*5.68 FS
18	1	*HORN-RH	Not Necessary	180.00 FS	*- FS
19	1	*HORN SUPPORT-RH	Not Necessary	31.00 FS	*- FS
20	1	*FRONT FENDER-RH	Repair	1,147.00 FS	*- FS
21	1	*FRONT FENDER ATTACHMENT PARTS	Not Necessary	40.00 FS	*- FS
22	1	*FRONT FENDER BRACKET-RH	Not Necessary	48.00 FS	*- FS
23	1	*FRONT FENDER BRACKET END-RH	Not Necessary	16.00 FS	*- FS
24	1	*FRONT FENDER BRACE-RH	Not Necessary	44.00 FS	*- FS
25	6	*POP RIVET	Not Necessary	20.00 FS	*- FS
26	1	*BONNET	Repair	2,789.00 FS	*- FS
27	1	*BONNET ATTACHMENT PARTS	Not Necessary	165.00 FS	*- FS
28	2	*BONNET HINGE-LH/RH	Not Necessary	124.00 FS	*- FS
29	3	*BONNET IMPACT PROTECTION-CENTER/LH/RH	Not Necessary	90.00 FS	*- FS
30	1	*BONNET STRIKER-RH	Not Necessary	110.00 FS	*- FS
31	1	*BONNET MICROSWITCH	Not Necessary	214.00 FS	*- FS
32	1	*BONNET RELEASE ELEMENT	Not Necessary	58.00 FS	*- FS
33	1	*BONNET BOWDEN CABLE-CENTER	Not Necessary	58.00 FS	*- FS
34	1	*BONNET BOWDEN CABLE CAP	Not Necessary	10.00 FS	*- FS
35	1	*HEADLIGHT MOUNTING-LH/RH (2 Pcs)	Cracked (1 Pc only)	236.00 FS	*94.40 FS
36	1	*HEADLIGHT-LH/RH	O/s Cracked/ N/s Not Necessary	9,830.00 FS	*3,932.00 FS
37	2	*LIFT CYLINDER-LH/RH	Not Necessary	284.00 FS	*- FS
38	1	*LIFT CYLINDER HOSE	Not Necessary	182.00 FS	*- FS
39	2	*FRONT WHEEL ARCH COVER-LH/RH	Necessary	644.00 FS	*514.40 FS
40	6	*RADIATOR COOLANT	Necessary	266.00 FS	*212.64 FS
41	1	*RADIATOR AIR GUIDE-RH	Cracked	31.00 FS	*24.16 FS
42	1	*RADIATOR SEAL-RH OUTER	Not Necessary	7.00 FS	*- FS
43	1	*RADIATOR AIR GUIDE-UPPER CENTER	Cracked	22.00 FS	*17.20 FS
44	1	*REAR BUMPER	Deformed	1,280.00 FS	*1,024.00 FS
45	1	*REAR BUMPER FIXING PARTS	Not Necessary	77.00 FS	*- FS
46	1	*REAR BUMPER SPOILER	Deformed	284.00 FS	*227.20 FS
47	1	*REAR BUMPER TOWING EYE	Not Necessary	43.00 FS	*- FS
48	2	*REAR LIGHT REFLECTOR-LH/RH	Not Necessary	60.00 FS	*- FS
49	1	*TAIL LIGHT-LH	Not Necessary	1,321.00 FS	*- FS
50	1	*TAIL LIGHT TRIM-LH	Not Necessary	30.00 FS	*- FS
51	1	*REAR BUMPER REINFORCEMENT BEAM	Not Necessary	579.00 FS	*- FS
52	2	*REAR BUMPER HOLDING STRAP-LH/RH	Not Necessary	26.00 FS	*- FS
53	2	*REAR BUMPER GUIDE SECTION-LH/RH	Not Necessary	108.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
54	2	*REAR BUMPER AIR SENSOR-INNER/OUTER (NPA)	Not Necessary	0.00 FS	*- FS
55	1	*REAR BUMPER AIR SENSOR SEAL RING (4 Pcs)	Not Necessary	9.00 FS	*- FS
56	1	*REAR BUMPER WIRING SET	Not Necessary	515.00 FS	*- FS
57	1	*REAR LID	Bent	2,359.00 FS	*1,887.20 FS
58	1	*REAR LID ATTACHMENT PARTS	Not Necessary	120.00 FS	*- FS
59	1	*REAR LIG GASKET	Not Necessary	118.00 FS	*- FS
60	1	*REAR LID LOCK STRIKER	Not Necessary	291.00 FS	*- FS
61	1	*REAR LID LOCK	Not Necessary	241.00 FS	*- FS
62	1	*BONNET LOCK COVER	Not Necessary	13.00 FS	*- FS
63	1	*REAR PACKING ADHESIVE	Necessary	19.00 FS	*14.88 FS
64	1	*AUDI EMBLEM	Necessary	138.00 FS	*110.00 FS
65	1	*Q2 EMBLEM	Necessary	99.00 FS	*79.04 FS
66	1	*REAR FOAM STRIPS	Not Necessary	133.00 FS	*- FS
67	1	*REAR SPOILER FIXING PARTS	Necessary	133.00 FS	*106.00 FS
68	4	*BOOT LID BUNGS	Necessary	117.00 FS	*93.12 FS
69	1	*REAR WINDSCREEN	Necessary	779.00 FS	*623.20 FS
70	1	*PRIMER	Necessary	20.00 FS	*15.76 FS
71	1	*REAR END PANEL	Bent	245.00 FS	*196.00 FS
72	1	*REAR END PANEL REINFORCEMENT	Not Necessary	733.00 FS	*- FS
73	2	*REAR END PANEL CONNECTING PLATE-LH/RH	Not Necessary	82.00 FS	*- FS
74	1	*REAR END PANEL TRIM	Not Necessary	155.00 FS	*- FS
75	2	*REAR WHEEL ARCH COVER-LH/RH	Necessary	340.00 FS	*272.00 FS
76	1	*REAR SILENCER	Bent	708.00 FS	*566.00 FS
77	1	*DUAL CLIP	Necessary	59.00 FS	*46.96 FS
78	2	*EXHAUST SYSTEM RETAINER-LH/RH	Distorted/Cracked	83.00 FS	*65.92 FS
79	1	*FRONT SILENCER	Bent	623.00 FS	*498.00 FS
80	1	*DUAL CLIP	Necessary	59.00 FS	*46.96 FS
81	1	*REAR SILENCER HEAT SHIELD	Bent	163.00 FS	*130.00 FS
82	1	*REAR NO PLATE	Scratched	60.00 FS	*60.00 FS
83	1	*FRONT NO PLATE	Bent	60.00 FS	*60.00 FS
84	1	*ARYLIC SEALANT	Necessary	180.00 FS	*180.00 FS
85	1	*CAVITY WAX	Necessary	140.00 FS	*140.00 FS
86	1	*STONE CHIP	Necessary	180.00 FS	*180.00 FS
87	1	*METAL FILLER POWDER	Necessary	280.00 FS	*280.00 FS
88	1	*REAR WINDSCREEN SEALANT	Necessary	200.00 FS	*200.00 FS
89	1	*SUNDRIES	Necessary	400.00 FS	*12.72 FS
90	2	*ELBOW FITTING (WASHER BRACKET) (Supplementary)	Broken	66.00 FS	*52.16 FS
91	1	*COUPLING ELEMENT (Supplementary)	Necessary	13.00 FS	*10.16 FS
92	1	*RADIATOR	Cracked	994.00 FS	*795.20 FS

F=Franchise part. S=SpcNett.

Total Parts (\$\$) 37,448.00 16,884.24

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE,CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS,HORNS,OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY	New	360.00	360.00
2	TO REMOVE AND TRANSFER BOTH HEADLIGHTS CONTROL UNIT AND POWER MODULE	New	800.00	250.00
3	TO REMOVE AND REINSTALL AIRCON CONDENSER,ADDITIONAL RADIATOR AND RADIATOR.CHECK ELECTRICAL FANS AND CONTROL UNIT.PRESSURISE COOLING SYSTEM.VACUUM AND REGAS	New	1,700.00	1,700.00
4	TO DISMANTLE AND RENEW FRONT BUMPER,RHS FRONT FENDER,BONNET AND BOTH HEADLIGHTS.TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION.RE-ORGANIZE CRASH MANAGEMENT COMPONENTS.REINSTALL ALL PARTS REMOVED	New	5,600.00	2,250.00
5	TO RESPRAY FRONT BUMPER,BONNET,RHS FRONT FENDER	New	3,500.00	1,650.00
6	TO REMOVE AND TRANSFER REAR PARKING AID.CHECK FUNCTION	New	280.00	280.00
7	TO REMOVE AND TRANSFER REAR LIDS CONVENIENCE LOCK SYSTEM.WIRE HARNESS FOR TAIL LIGHTS AND REAR LID WIPER ASSY	New	480.00	480.00
8	TO DISLodge AND REINSTALL REAR WIRE HARNESS FOR LIGHTS,BATTERY MANAGER,FUSE AND RELAY TRAYS,ELECTRICAL AND AUDIO EQUIPMENT.INSPECT FOR DAMAGE AND RENEW WHERE NECESSARY	New	480.00	480.00
9	TO RENEW REAR WINDSCREEN TO FACILITATE RENEWAL OF REAR LID	New	480.00	480.00
10	TO INSTALL SOLAR FILM FOR REAR WINDSCREEN	New	400.00	0.00
11	TO CARRY OUT WATER SEEPAGE TEST FOR REAR WINDSCREEN	New	200.00	150.00
12	TO DISMANTLE AND RENEW REAR BUMPER AND REAR LID.TO CUT OUT AND WELD REAR END PANELLING.TO REPAIR SPARE WHEEL HOUSING.RE-ORGANIZE MANAGEMENT COMPONENTS.REINSTALL ALL PARTS REMOVED	New	5,200.00	2,500.00
13	TO RESPRAY REAR BUMPER,REAR LID,REAR END PANELLING AND SPARE WHEEL HOUSING LINER	New	4,000.00	1,650.00
14	TO RENEW LHS REAR EXHAUST SILENCER AND CENTER EXHAUST SILENCER.TO ALIGN BACK TO POSITION	New	480.00	480.00
15	TO CARRY OUT PRE/DIAGNOSTIC CHECK	New	384.00	384.00
			Gross Labour Cost (\$\$)	24,344.00
				13,094.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >