

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22000308/KVY3Q2**Date:** 09/03/2022**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMPCSNW00077602100

Claimant Vehicle No : SMG789S **Insured Vehicle No :** SLR6308L

Date of Loss: 06/01/2022 Nature of Claim: TP Claim No: SNM22D200179/C02/TANKL

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMG789S**

Make & Model: TOYOTA WISH, 2.0 (A) Engine No: 3ZRA490470

Reg. Date: 27/08/2010 (Man. Year: 2010) Chassis No: JTDGJ20W705002519

Colour: Metallic Grey Odometer: 215607 km

Engine Capacity: 1987 cc

Market Value/New Car Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 225/45Z R17 Rear Tyre Size: 225/45Z R17

Front Left Side: Michelin 8 mm Rear Left Side: Michelin 8 mm

Front Right Side: Michelin 8 mm Rear Right Side: Michelin 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	13,720.51	7,219.31	6,501.20	47.38
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,230.00	3,020.00	2,210.00	42.26
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	18,950.51	10,239.31	8,711.20	45.97
Approved Total (Overridden) (\$\$)		8,200.00		
Nett Amount (\$\$)	18,950.51	8,200.00	10,750.51	56.73

INSPECTION

Date of Assignment: 10/01/2022

Date Inspected: 11/01/2022 Inspected At: 160 SIN MING DRIVE #03-18/19
SIN MING AUTOCITY
SINGAPORE 575722
Repairer: Em Solution Pte Ltd (HQ)

Estimated Period of Repair: 8.0 days

Adjuster: KENNETH KONG**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 09 Mar 2022)
Parts:	M1-MPV	TOYOTA WISH 2.0 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMG789S)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR TAILGATE	Bent	1,477.30 FL	*1,272.00 FL
2	1		*REAR TAILGATE LAMP L/R	N/S Cracked	588.20 FL	*294.10 FL
3	1		*REAR TAILGATE NO PLATE GARNISH	Serviceable	290.30 FL	*- FL
4	2		*REAR NO PLATE LAMP	Serviceable	159.60 FL	*- FL
5	1		*REAR TAILGATE TOYOTA LOGO	Necessary	68.50 FL	*68.50 FL
6	1		*REAR TAILGATE INNER TRIMBOARD	Mtg Cracked	485.50 FL	*408.10 FL
7	1		*REAR TAILGATE MECHANISM LOCK	Dented	412.70 FL	*368.50 FL
8	1		*REAR BOOT WEATHERSTRIP (50%)	Cut	277.88 FS	*185.25 FS
9	1		*REAR WINDSCREEN INNER SEAL	Necessary	30.98 FS	*30.00 FS
10	1		*REAR LAMP L/R	N/S Broken	881.00 FL	*440.50 FL
11	1		*REAR LAMP PANEL LH	Bent	297.00 FL	*297.00 FL
12	1		*REAR FENDER LH	Bent	1,113.50 FL	*955.00 FL
13	1		*REAR FENDER INNER TRIM LH	Deformed	740.50 FL	*645.00 FL
14	1		*REAR FENDER MUDFLAP LH	Serviceable	78.90 FL	*- FL
15	1		*REAR FENDER PETROL TANK PANEL	Repair	126.50 FL	*- FL
16	1		*REAR FENDER QUARTER MOULDING W/GLASS	Necessary	511.20 FL	*411.00 FL
17	1		*REAR BUMPER	Bent	1,061.40 FL	*591.80 FL
18	1		*REAR BUMPER SIDE HOLDER L/R	N/S Cracked	194.80 FL	*97.40 FL
19	1		*REAR BUMPER BRACKET L/R	N/S Dented	110.80 FL	*55.40 FL
20	2		*REAR BUMPER REFLECTOR L/R	Cracked	2,742.00 FL	*274.20 FL
21	1		*REAR END PANEL	Bent	670.30 FL	*591.40 FL
22	1		*REAR END PANEL TOP GARNISH	Dented	298.20 FL	*298.20 FL
23	1		*REAR CHASSIS MEMBER LH	Repair	211.75 FL	*- FL
24	1		*SET REAR BUMPER CLIPS	Necessary	45.00 FS	*45.00 FS
25	1		*SET REAR END PANEL GARNISH CLIPS	Necessary	35.00 FS	*35.00 FS
26	1		*SET REAR FENDER LINER CLIPS	Necessary	35.00 FS	*35.00 FS
27	1		*SET TAILGATE INNER TRIM CLIPS	Necessary	35.00 FS	*35.00 FS
28	1		*SET REVERSE SENSOR	Dented	300.00 FS	*200.00 FS
29	2		*WINDSCREEN SEALANT	Necessary	100.00 FS	*40.00 FS
30	1		*REAR DOOR LH	Repair	1,087.90 FL	*- FL
31	1		*REAR DOOR PILLAR OUTER GARNISH LH	Serviceable	128.50 FL	*- FL
32	1		*REAR FENDER INNER AIR DUCT LH	Dented	125.45 FL	*125.45 FL
33	1		*REAR FENDER INNER TRIM COVER LH	Serviceable	78.30 FL	*- FL
34	1		*REAR CHASSIS MEMBER BRACKET LH	Bent	65.20 FL	*65.20 FL
35	1		*REAR BOOT COMPARTMENT SIDE PANEL LH	Repair	383.20 FL	*- FL
36	1		*REAR BOOT COMPARTMENT FLOOR PANEL	Repair	1,093.70 FL	*- FL
37	2		*TAILGATE AUTO DAMPER	Punctured	640.00 FS	*640.00 FS
38	1		*SET END PANEL KICK SENSOR	Shorted	280.00 FS	*280.00 FS
39	1		*TAILGATE AUTO CLOSE SWITCH	Scratched	80.00 FS	*- FS
40	1		*TAILGATE CONTROL UNIT	Dented	250.00 FS	*250.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	17,591.06	9,034.00
- List Item Discount on L Items 25.00/25.00% (\$)	3,870.55	1,814.69
Total Parts (\$)	13,720.51	7,219.31

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE & REARRANGE ELECTRICAL WIRINGS ,CHECK LIGHTINGS	New	80.00	20.00
2	TO REMOVE & REPLACE UPHOLSTERY CUSHION SEAT & TRIM GARNISHES	New	150.00	100.00
3	TO REMOVE REINSTAL REAR WINDSCREEN	New	150.00	120.00
4	TO REMOVE,TRANSFER TAILGATE COMPONENTS	New	100.00	60.00
5	TO REMOVE ,REINSTAL REAR FENDER QUARTER GLASS	New	100.00	50.00
6	TO REMOVE ,REINSTAL PETROL TANK TO FACILITATE REPAIRS	New	150.00	50.00
7	TO REMOVE ,REPAIR & REPLACE DAMAGED BODYPARTS AND WHERE CONSISTENT TO THE ACCIDENT	New	2,200.00	1,200.00
8	PUTTY AND RESPRAY PAINTING ON AFFECTED PORTIONS	New	1,800.00	1,200.00
9	TO REMOVE & RENEW REVERSE SENSOR	New	150.00	50.00
10	RUST PROOFING ON AFFECTED PORTIONS	New	100.00	90.00
11	TO REMOVE ,REPLACE AND REPROGRAMME AUTO TAILGATE SYSTEM	New	250.00	80.00
Gross Labour Cost (\$\$)			5,230.00	3,020.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >