

TP China
Veron

FBFG2015 2011 Sept.
Yamaha X-1R 135CC
4S3304523.

Front Number Plate	lt	15 (sn)	✓
Front Number Plate Garnish.	lt	75	✓
Front Wheel Fenders	lt	88	✓
Headlamp	lt	195	✓
Headlamp Bracket	lt	25	X
Headlamp Cowling	lt	182	✓
Headlamp Cowling Centre Black Garnish.	lt	93	X
Handle Bar	Best	134	✓
Handle Bar End (Set)	Best	75	✓
Handle Grip LH.	lt	35	✓
Handle Lever System (Brembo)	lt	400 (sn) 450 (sn)	
Balances LH.	missing	38	✓
Brake Reservoir	Gold	480 (sn) 400 (sn)	
Front Wheel Rim.	lt	380 (sn) 280 (sn)	
Front Wheel Rim Spindle.	Best	50	✓

FBF 6201S.

Front Tyre.	1 1/2 in	180 (SW)	+
Fork Assy.	Damaged	630.	✓
Fork Under Bracket	Damaged	245	✓
Fork Oil	2 in	30 (SW)	✓
Fork Oil Seal.		50 (SW)	✓
Speedometer	cracked	358	✓
Front Basket.	Dented	45	✓
Wing Mirror (Set)	Damaged	55.	✓
Handlap Covering	cracked	108	✓
Inner Garnish LH.			
Side Fairing LH	cut	138	✓
Side Fairing Signal Lamp LH.	cut	38	✓
Foot Lever LH.	Bent	62	✓
Foot Rest Rubber LH	cut	28	✓

FBF6201S

Foot Rest Bracket. Bent 98 ✓

Engine Cover. Lt 288 ✓

Engine Cover Gasket. NH 40(SN) ✓

Rear Foot Rest LH. Lt 28 ✓

Rear Foot Rest Bracket LH. NH 52 X

Rear Swing Arm. Dented 395 ✓

Rear Swing Arm Shaft. Bent 55 ✓

Rear Box Lt ~~280(SN)~~ 250(SN)

Rear Box Bracket Bent. ~~280(SN)~~ 200(SN)

Rear LH Fairing Repair 88 X.

ERP Unit Lt 160(SN) ✓

1764

3463

S.N. 1875

3116.70

FBF62015.

Labour

~~400~~ 300

Spray Painting

~~400~~ 250

870

~~50~~ 30

Wiring.

To repair and straighten body chassis

~~280~~ 250

Towing Charges.

40 ✓
1170

7286

total: 5861.70.

w/e: 4.7K.

05 Days.

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

4.7K