



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2203809

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 20/06/2022
Reference CC6/CTI22000397/Kga3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLP 214Z
Insured Veh. SKC 7803H
Claim No. SNM22D200177
Policy No. DMPCSNW00020752101
Accident Date 07/01/2022
Inspection Date 07/01/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22000397/Kga3q2 Date: 20/06/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SKC 7803H	Veh. Inspected	SLP 214Z	
Policy No.	DMPCSNW00020752101	Coverage (\$)	0.00	
Claim No.	SNM22D200177	Excess (\$)	0.00	
Assign From		Assign Date	07/01/2022	
2. Vehicle Particulars & Condition				
Make & Model	NISSAN QASHQAI (A)	c.c	1197	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	SJNFEAJ11U1939355	Colour	METALLIC GREY	
Odometer	75014 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R17	YOKOHAMA	8 mm	
L/H Front Tyre	215/60 R17	YOKOHAMA	8 mm	
R/H Rear Tyre	215/60 R17	YOKOHAMA	8 mm	
L/H Rear Tyre	215/60 R17	YOKOHAMA	8 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR & FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	07/01/2022	Inspection Date	07/01/2022	
Survey held at	ALAN'S UNITED AUTO PTE LTD BLK 7 SIN MING INDUSTRIAL ESTATE #01-76 SINGAPORE 575642			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLP 214Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET (N)	BENT	1,167.40	1,061.30
1	FRONT GRILLE (N)	DENTED	577.60	577.60
1	FRONT GRILLE LOGO (N)	NECESSARY	79.90	79.90
6	FRONT GRILLE CLIP @\$4.50 (N)	MISSING	27.00	27.00
2	HEADLAMP @\$673.40 (N)	MTG CRACKED	1,346.80	1,346.80
1	FRONT BUMPER FASCIA (N)	BUCKLED	751.20	751.20
1	FRONT BUMPER REINFORCEMENT (N)	TO REPAIR SEE LABOUR	831.40	-
1	FRONT BUMPER SPONGE (N)	CRACKED	240.90	240.90
2	FRONT BUMPER SIDE RETAINER @\$74.20 (N)	SERVICEABLE	148.40	-
1	TAIL GATE (N)	BENT	3,368.90	3,368.90
1	TAIL GATE OUTER GARNISH (N)	SERVICEABLE	352.10	-
1	TAIL GATE GLASS MOULDING (N)	NECESSARY	90.00	90.00
1	REAR BUMPER FASCIA (N)	BUCKLED	796.70	796.70
1	REAR BUMPER REINFORCEMENT (N)	BENT	691.50	691.50
1	REAR BUMPER SPONGE (N)	CRACKED	155.60	155.60
1	REAR BUMPER TOW COVER (N)	MISSING	20.00	20.00
2	REAR BUMPER SIDE RETAINER @\$39.00 (N)	O/S DISTORTED	78.00	39.00
1	REAR END PANEL (N)	BENT	482.60	482.60
1	END PANEL TOP GARNISH (N)	SERVICEABLE	175.00	-
1	REAR O/S FENDER ARCH GARNISH (N)	BUCKLED	540.50	540.50
2	REAR BUMPER REINFORCEMENT BRACKET @\$141.00 (N) (ADDITIONAL)	BENT	282.00	282.00
	LESS 10% DISCOUNT		-1,220.35	-1,055.15
			10,983.15	9,496.35
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NO PLATE WITH BOX (SN)	SERVICEABLE	60.00	-
1	REAR NO PLATE WITH BOX (SN)	SERVICEABLE	60.00	-
1	REAR W/S GLASS SEALANT (SN)	NECESSARY	60.00	40.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	DENTED	300.00	300.00

Report Ref No. CC6/CTI22000397/Kga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET REAR BUMPER CLIP (SN)	NECESSARY	40.00	40.00
			520.00	380.00
	LABOUR			
	TO REWIRE DAMAGED PARTS AND REFOCUS HEADLAMP BEAM.		20.00	20.00
	TO REMOVE & REFIX REAR WINDSCREEN GLASS AND CONDUCT WATER LEAK TEST.		150.00	120.00
	TO REMOVE ROOF LINING ,FRONT AND REAR SEATS ,TRIM BOARD AND CARPET.		120.00	60.00
	TO REMOVE AIR CON CONDENSER ,PIPES AND DRIER ,VACUUM AND TO RECHARGE GAS.	NOT NECESSARY	120.00	-
	TO APPLY UNDERSEALING.		60.00	60.00
	TO PUTTY AND SPRAY REPLACED PARTS.		1,300.00	1,200.00
	TO REMOVE, CUT -OUT DAMAGED PARTS,PANEL BEATING ,WELDING ,ALIGN,REFIX AND TO RENEW ABOVE PARTS.INCLUSIVE OF THE REPAIR OF FRONT BUMPER REINFORCEMENT .		1,000.00	900.00
			2,770.00	2,360.00
GRAND TOTAL			14,273.15	12,236.35

RECOMMENDED COST OF REPAIRS			12,236.35
------------------------------------	--	--	------------------

Report Ref No. CC6/CTI22000397/Kga3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLP 214Z

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLP 214Z

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

