

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22000436/ANY3Q2**Date:** 01/02/2023**REFERENCE**Handling Insurer: China Taiping Insurance
(Singapore) Pte. Ltd.

Policy No: DMCVSNA00155332100

**Claimant Vehicle
No :** GBH7182X**Insured
Vehicle No :** GN6138R

Date of Loss: 07/01/2022

Nature of Claim: TP

Claim
No: SNM22D200293/C02/TOHHS**DESCRIPTION & IDENTIFICATION OF VEHICLE**Reg No: **GBH7182X**

Make & Model: NISSAN NV200, 1.5 MT (M)

Engine No: K9KE628D610260

Reg. Date: 30/08/2018 (Man. Year: 2018)

Chassis No: VSKYBAM20Z0170284

Colour: Grey

Odometer: 0 km

Engine Capacity: 1461 cc

Market Value/New Car

Price: N/A

Sum Insured (S\$): **Market Value/New Car Price****CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 175/70 R14C

Rear Tyre Size: 175/70 R14C

Front Left Side: Dunlop 6 mm

Rear Left Side: Dunlop 6 mm

Front Right Side: Dunlop 6 mm

Rear Right Side: Dunlop 6 mm

The above values represent the remaining tyre tread depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	32,170.83	20,895.16	11,275.67	35.05
Miscellaneous Items	0.00	0.00	0.00	
Labour	7,090.00	3,970.00	3,120.00	44.01
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	39,260.83	24,865.16	14,395.67	36.67
Approved Total (Overridden) (S\$)		19,800.00		
Nett Amount (S\$)	39,260.83	19,800.00	19,460.83	49.57

INSPECTION

Date of Assignment: 12/01/2022

Date Inspected: 12/01/2022 Inspected At:

Ace Autolution Pte Ltd (KAKI BUKIT)
13 Kaki Bukit Road 4, #03-29/30 Bartley Biz Centre
Singapore 417807

Estimated Period of Repair: 16.0 days

Adjuster: ADRIAN LING**Manager:** HUEY YON*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 31 Jan 2023)	
Parts:	N/A	NISSAN NV200 1.5 MT (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GBH7182X)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT GRILLE	Cracked	412.30 FL	*412.30 FL
2	1		*FRONT GRILLE LOGO	Necessary	70.00 FL	*70.00 FL
3	1		*FRONT BUMPER	Distorted	676.20 FL	*676.20 FL
4	2		*FRONT BUMPER SIDE PROTECTOR LH & RH	Distorted	490.00 FL	*490.00 FL
5	2		*FRONT BUMPER BRACKET LH & RH	Not Necessary	190.00 FL	*- FL
6	1		*FRONT BUMPER INNER PAD	Not Necessary	210.00 FL	*- FL
7	2		*FRONT BUMPER SIDE RETAINER LH & RH	Damaged	142.00 FL	*90.00 FL
8	1		*FRONT BUMPER SIDE BRACE BRACKET	Not Necessary	180.60 FL	*- FL
9	1		*FRONT BUMPER REINFORCEMENT	Bent	591.90 FL	*591.90 FL
10	2		*FRONT BUMPER REINFORCEMENT BRACKET LH & RH	Bent	450.00 FL	*183.40 FL
11	1		*FRONT BUMPER LOWER GRILLE	Not Necessary	211.10 FL	*- FL
12	1		*FRONT BUMPER FOGLAMP COVER LH & RH	N/S Damaged	191.00 FL	*95.50 FL
13	1		*FRONT BUMPER SPONGE	Cracked	310.00 FL	*135.00 FL
14	1		*FRONT BUMPER LOWER COVER	Not Necessary	301.60 FL	*- FL
15	1		*FRONT BUMPER TOW COVER	Not Necessary	101.00 FL	*- FL
16	1		*FRONT BONNET	Distorted	860.00 FL	*860.00 FL
17	1		*FRONT BONNET INSULATOR	Crumpled	93.60 FL	*93.60 FL
18	1		*FRONT BONNET RUBBER	Cut	71.00 FL	*71.00 FL
19	2		*FRONT BONNET HINGE LH & RH	Bent	99.60 FL	*99.60 FL
20	1		*FRONT BONNET LOCK	Damaged	75.00 FL	*75.00 FL
21	1		*FRONT SUPPORT PANEL	Distorted	425.00 FL	*425.00 FL
22	1		*FRONT SUPPORT PANEL TOP GARNISH	Not Necessary	73.00 FL	*- FL
23	1		*FRONT TOP SUPPORT PANEL	Distorted	564.90 FL	*564.90 FL
24	1		*FRONT LOWER SUPPORT PANEL	Distorted	494.40 FL	*494.40 FL
25	1		*FRONT HEADLAMP LH & RH	N/S Smashed	910.00 FL	*455.00 FL
26	2		*FRONT HEADLAMP BRACKET LH & RH	Not Necessary	122.00 FL	*- FL
27	1		*FRONT RADIATOR SPARE TANK	Deformed	145.00 FL	*145.00 FL
28	1		*FRONT RADIATOR	Dented	691.00 FL	*691.00 FL
29	1		*FRONT RADIATOR FAN BLADE	Not Necessary	575.00 FL	*- FL
30	1		*FRONT RADIATOR FAN MOTOR W/COWLING	Cracked	610.00 FL	*610.00 FL
31	2		*FRONT RADIATOR SIDE GARNISH LH & RH	Distorted	102.00 FL	*102.00 FL
32	1		*FRONT INNER COOLER	Dented	1,810.30 FL	*1,810.30 FL
33	1		*FRONT AIRCON CONDENSER	Distorted	816.10 FL	*816.10 FL
34	1		*FRONT AIRCON CONDENSER FAN W/COWLING	Not Necessary	135.00 FL	*- FL
35	1		*FRONT AIRCON PIPE-CONDENSOR TO COOLING COIL	Not Necessary	252.70 FL	*- FL
36	1		*FRONT AIRCON PIPE-CONDENSOR TO COMPRESSOR	Not Necessary	221.00 FL	*- FL
37	1		*FRONT AIRCON PIPE-CONDENSOR TO COOLING COIL	Not Necessary	252.70 FL	*- FL
38	1		*FRONT INTAKE COOLER HOSE TO INTAKEMANIFOLD	Not Necessary	250.00 FL	*- FL
39	1		*FRONT INTAKE COOLER HOSE TO TURBO	Damaged	228.10 FL	*228.10 FL
40	1		*FRONT AUTOLATOR	Not Necessary	1,889.80 FL	*- FL
41	1		*FRONT AIRCON COMPRESSOR	Not Necessary	1,035.50 FL	*- FL
42	1		*FRONT BELTING	Not Necessary	55.00 FL	*- FL
43	1		*FRONT AIR DUCT	Cracked	185.00 FL	*185.00 FL
44	1		*SET FRONT ENGINE MOUNTING	Damaged	668.40 FL	*668.40 FL
45	1		*FRONT ENGINE LOWER COVER	Torn	258.00 FL	*258.00 FL
46	1		*SET FRONT TRIM BELT SYSTEM	Not Necessary	180.50 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
47	1		*FRONT FENDER LH & RH	N/S Distorted	1,100.20 FL	*550.10 FL
48	1		*FRONT FENDER INNER SHIELD LH & RH	N/S Torn	430.00 FL	*215.00 FL
49	1		*FRONT WHEEL HOUSE PANEL	Distorted	625.00 FL	*625.00 FL
50	1		*FRONT WASHER TANK	Not Necessary	242.40 FL	*- FL
51	1		*FRONT WASHER TANK MOTOR	Not Necessary	210.00 FL	*- FL
52	1		*FRONT OIL FILTER HOSING	Not Necessary	180.00 FL	*- FL
53	1		*FRONT BELT COOLER ASSY	Not Necessary	580.00 FL	*- FL
54	1		*FRONT DRIVER AIRBAG	Activated	2,320.60 FL	*2,320.60 FL
55	1		*FRONT DRIVER AIRBAG SENSOR	Activated	784.00 FL	*784.00 FL
56	2		*FRONT SAFETY BELT LH & RH	Activated	1,282.00 FL	*1,282.00 FL
57	1		*FRONT WINDSCREEN	Cracked	970.90 FL	*970.90 FL
58	1		*FRONT WINDSCREEN MOULDING	Necessary	215.00 FL	*215.00 FL
59	1		*GEARBOX	Cracked	2,297.00 FL	*2,297.00 FL
60	1		*BATTERY BRACKET	Bent	282.00 FL	*82.00 FL
61	1		*FRONT DASHBOARD	Not Necessary	2,180.00 FL	*- FL
62	1		*SET FRONT BUMPER CLIPS	Necessary	100.00 FS	*30.00 FS
63	1		*SET FRONT GRILLE CLIPS	Necessary	100.00 FS	*20.00 FS
64	1		*SET FRONT BUMPER SIDE PROTECTOR CLIPS	Not Necessary	80.00 FS	*- FS
65	1		*SET FRONT CAR PLATE WITH HOLDERS	Damaged	70.00 FS	*70.00 FS
66	1		*SET FRONT SUPPORT PANEL TOP GARNISH CLIPS	Not Necessary	100.00 FS	*- FS
67	1		*FRONT RADIATOR COOLANT	Necessary	80.00 FS	*40.00 FS
68	1		*SET FRONT BONNET INSULATOR CLIPS	Necessary	100.00 FS	*30.00 FS
69	1		*FRONT ENGINE OIL FILTER	Not Necessary	70.00 FS	*- FS
70	1		*SET FRONT FENDER INNER SHIELD CLIPS	Necessary	80.00 FS	*30.00 FS
71	2		*FRONT APRON GARNISH	Distorted	749.20 FL	*749.20 FL
72	1		*RADIATOR SPARE TANK	Cracked	86.80 FL	*86.80 FL
73	1		*FRONT BUMPER FOG LAMP	N/S Cracked	536.40 FL	*268.20 FL
74	1		*AIR CLEANER ASSY	Cracked	313.50 FL	*313.50 FL
75	1		*ECU BRACKET	Bent	68.90 FL	*68.90 FL
76	1		*AIR BAG ECU	Activated	747.50 FL	*747.50 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) **35,658.70** **23,192.40**

- List Item Discount on L Items 10.00/10.00% (\$\$) **3,487.87** **2,297.24**

Total Parts (\$\$) **32,170.83** **20,895.16**

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS AND REPLACE DAMAGED PARTS	New	2,200.00	1,500.00
2	TO SUPPLY PAINT MATERIALS ,EXPANDABLE ITEMS & PUTTY ,RESPRAY PAINT ON PARTS REPLACED	New	1,800.00	1,000.00
3	TO REMOVE AND REFIX WIRING AT DAMAGED AREAS	New	180.00	50.00
4	TO PERFORM ANTI RUST TREATMENT ON AFFECTED AREAS	New	150.00	100.00
5	TO REMOVE AND REPLACE FRONT RADIATOR AND PRESS TEST	New	180.00	60.00
6	TO REMOVE AND REPLACE AIRCON CONDENSER AND TOP UP A/C GAS	New	150.00	60.00
7	TO REMOVE AND REPLACE INTER COOLER ASSY	New	180.00	50.00
8	TO RESPRAY KUFF TOTE	New	280.00	0.00
9	TO CONDUCT WHEEL ALIGNMENT TEST	New	150.00	80.00
10	TO REMOVE AND REPLACE GEARBOX & ENGINE	New	1,200.00	600.00
11	TO REMOVE AND REPLACE UNDERCARRIAGE PART	New	220.00	220.00
12	TO REMOVE AND REPLACE AIRBAG	New	250.00	250.00
13	TO TOP UP COOLANT	New	150.00	0.00
Gross Labour Cost (S\$)			7,090.00	3,970.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >