

Our Ref : 22/0004/TP
Your Ref : Not Advised

Date: 13 January 2022

Mr Ng Hock Lim
C/o 1 Kaki Bukit Avenue 6
#01-67 Autobay @ Kaki Bukit
Singapore 417883

ACCIDENT DAMAGED VEHICLE INSPECTION REPORT (WITHOUT PREJUDICE)

Detailed accounts of our inspection are as follows:

(1) REFERENCE

Name of Claimant	: Mr. Ng Hock Lim	Date of Request	: 13 January 2022
Policy Number	: 5108807053-02 drivo CLASSIC	Referred By	: Insured
Claim Number	: Not Advised	Date of Inspection	: 13 January 2022
Accident Date	: 12 January 2022	Date of Re-inspection	: 17 Jan 2022 & 20 Jan 2022
Repairer	: M.S LLH Car Services & Panel Beating Workshop 1 Kaki Bukit Avenue 6 #01-67 Autobay @ Kaki Bukit Singapore 417883	Sum Insured	: Not Applicable
		Excess Amount	: Not Applicable
		3 rd Party Vehicle	: GBG 8762 X
		3 rd Party Insurer	: Lonpac Insurance Berhad

(2) PARTICULARS OF VEHICLE

Registration Number	: SJR 5039 T	Mileage	: 350,461 km
Make & Model	: Hyundai HD Avante 1.6 A	Chassis Number	: KMHOU41BR9U771216
Date of Registration	: 26 June 2009	Engine Number	: G4FC9U661672
Colour	: Silver	Engine Capacity	: 1,591 cc

(3) PRE-ACCIDENT CONDITION (STATIC TEST ONLY)

Steering	: Affected	Paint Work	: Good
Footbrake	: In order	Modification	: Sports rim
Handbrake	: In order	General Condition	: Average

(4) TYRE CONDITION

	Remaining Thread Depth (%)	Make	Size
Front right tyre	60%	Arivo	185/65R15
Front left tyre	60%	Arivo	185/65R15
Rear right tyre	70%	Habilead	185/65R15
Rear left tyre	70%	Habilead	185/65R15

ANNEX

REPAIR DETAILS (SJR 5039 T)

Recommended Parts

No	Qty	Particulars	Condition	Repairer's Amount	Adjuster's Amount
1	1	Front Fender Panel - N/s	Badly Dented	521.20	521.20
2	1	Front Fender Inner Shield - N/s	Deformed	48.00	48.00 ✓
3	10	Front Fender Inner Shield Clip - N/s @\$3.00 each	Necessary	30.00	30.00 ✓
4	1	Front Door Assembly - N/s	Badly Dented	1,440.90	1,440.90
5	1	Front Door Outer Window Upper Black Tape - N/s	Necessary	13.00	13.00 ✓
6	1	Front Door Outer Window Sash Black Tape - N/s	Necessary	13.00	13.00 ✓
7	1	Front Door Weather-strip - N/s	Clip Snapped	44.30	44.30 ✓
8	1	Front Door Upper Hinge - N/s	Serviceable	36.10	0.00
9	1	Front Door Lower Hinge - N/s	Serviceable	36.10	0.00
10	1	Front 15" Alloy Wheel Rim - N/s	Grazed	631.20	631.20
11	1	Front Wheel Hub - N/s	Dented/Affected	167.90	167.90 X Svc
12	1	Front Wheel Bearing - N/s	Necessary	135.90	135.90 X Svc ✓
13	1	Front Steering Knuckle - N/s	Bent/Affected	309.00	309.00 X Svc ✓
14	1	Front Suspension Strut Absorber - N/s	Bent/Affected	234.60	234.60 X Svc ✓
15	1	Front Suspension Lower Arm - N/s	Bent/Affected	310.60	310.60 X X
16	1	Front Stabilizer Link - N/s	Bent/Affected	69.10	69.10 X X
17	1	Front Bumper Face	N/s Grazed/Cracked	461.40	461.40 ✓
18	4	Front Bumper Clip @\$3.00 each	Necessary	12.00	12.00 ✓
19	1	Front Bumper Side Retainer - N/s	Holder Deformed	34.70	34.70 ✓
				4,549.00	4,476.80
				Less 20%	909.80
				Sub-Total	3,639.20
					895.36
					3,581.44
<u>Special Nett Items</u>					
20	1	Front Fender Reflector - N/s	Cracked/Grazed	60.00	40.00 30
21	1	Front Door Inner Sealer	Necessary	80.00	60.00 30
Total Parts (S\$)				3,779.20	3,681.44

Recommended Labours

No	Particulars	Repairer's Amount	Adjuster's Amount
1	To panel beat left front wheelhouse reinforcement and replace left front accident damaged parts.	1,250.00	1,000.00
2	To check front lightings and electrical wiring system include focusing both headlights and adjust if necessary.	80.00	50.00
3	To transfer left front door locking mechanism and other components to new front door panel include checking components for proper functions.	150.00	120.00
4	To remove/install left front wheel to transfer tyre to new 15" alloy wheel rim includes balancing the wheel.	45.00	35.00

Our Ref: 22/0004/TP
 Vehicle No: SJR 5039 T

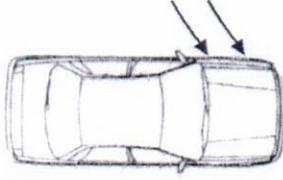
Allied
 Auto Appraisal

5	To remove/install front suspension system to facilitate the replacement of the left front damaged undercarriage parts.	375.00	250.00	60
6	To carry out computerised 4 wheels alignment and adjust if necessary.	150.00	120.00	60
7	To putty and re-spray painting on front bumper face, left front fender and left front door.	840.00	750.00	✓
8	Rustproofing on the left front accident affected portions.	120.00	80.00	30
	Total Labour (S\$)	<u>3,010.00</u>	<u>2,405.00</u>	
	Total Repair Cost (S\$)	6,789.20	6,086.44	4226.44

Adjusted Repair Cost (Lump sum basis)	S\$4,870.00
--	--------------------

3376.35
 3400 ✓
 3140.32
 = 3150 ✓

(5) POINT OF IMPACT

Mainly on the near-side front portion.	
--	--

(6) GENERAL DESCRIPTION OF DAMAGES

The impact of the collision has damaged/affected the left front fender, left front wheelhouse reinforcement, left front door, left front wheel, left front undercarriage and front bumper face etc.
Please refer to the Annex for a detailed account of the damages and photographs taken.

(7) RECOMMENDATION

We have inspected thoroughly the actual damages found on the vehicle before we conclude as to whether the parts needed replacement or repairs. The estimated cost of repair submitted by the repairer is \$6,789.20. We have adjusted the cost to \$6,086.44 and recommend that the repairs to be taken on a lump sum basis of \$4,870.00. In our opinion, the damaged parts are consistent with that caused by the accident.

3400 3150

(8) REMARKS

We have not authorised the repairs. However, for information, under normal circumstances, the period of repair should not exceed 6 working days.

This inspection was conducted on a "Without Prejudice" basis.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Appraisal Report and photographs.

Allied Auto Appraisal



H. C. Ng
Motor Vehicle Appraiser

