



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2202158

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 14/04/2022
Reference CC4/LPC22000452/Upa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SJE 7925R
Insured Veh. GBK 2864D
Claim No. 21/22/22/VC05/025343
Policy No. Z21VC05007165
Accident Date 06/01/2022
Inspection Date 14/01/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22000452/Upa3q2 Date: 14/04/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBK 2864D	Veh. Inspected	SJE 7925R	
Policy No.	Z21VC05007165	Coverage (\$)	0.00	
Claim No.	21/22/22/VC05/025343	Excess (\$)	0.00	
Assign From	KENNY	Assign Date	12/01/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA VIOS (A)	c.c	1497	
Engine No.	HIDDEN	Year of Reg.	2008	
Chassis No.	MR053HY9305061107	Colour	BLUE	
Odometer	320184 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/60 R15	YOKOHAMA	5 mm	
L/H Front Tyre	185/60 R15	YOKOHAMA	5 mm	
R/H Rear Tyre	185/60 R15	YOKOHAMA	5 mm	
L/H Rear Tyre	185/60 R15	YOKOHAMA	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION,N/S BODY AND O/S RIM. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	06/01/2022	Inspection Date	14/01/2022	
Survey held at	ABWIN SERVICE PTE LTD 17 KAKI BUKIT ROAD 4 #01-60 BARTLEY BIZ CENTRE SINGAPORE 417809			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJE 7925R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	DISTORTED	599.90	483.30
1	FRONT BUMPER LH SIDE RETAINER	BENT	78.80	66.50
1	FRONT BUMPER LH SIDE BRACKET	NOT NECESSARY	179.90	-
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	352.70	-
1	FRONT LH FENDER	DISTORTED	850.95	388.50
1	FRONT LH FENDER INNER SHIELD	TORN	195.40	166.20
1	FRONT LH FENDER BRACKET	TO REPAIR SEE LABOUR	123.73	-
1	FRONT LH FENDER PANEL	REPEATED	655.95	-
1	HEADLAMP LH	CRACKED	512.60	407.20
1	HEADLAMP BRACKET LH (NPA)	NOT NECESSARY	-	-
1	HEADLAMP INNER PANEL LH	TO REPAIR SEE LABOUR	165.40	-
1	FRONT LH DOOR	DISTORTED	820.88	820.88
1	FRONT LH DOOR HINGE UPPER	TWISTED	98.70	98.70
1	FRONT LH DOOR HINGE LOWER	TWISTED	98.70	98.70
1	FRONT LH DOOR WEATHERSTRIP	NECESSARY	175.60	175.60
1	FRONT LH DOOR BOARD	NOT NECESSARY	678.75	-
1	FRONT LH INNER TRIM BOARD (NPA)	NOT NECESSARY	-	-
1	FRONT LH DOOR LOCK	NOT NECESSARY	388.70	-
1	DOOR MOTOR REGULATOR	NOT NECESSARY	175.85	-
1	B PILLAR	TO REPAIR SEE LABOUR	366.70	-
1	REAR LH DOOR	DENTED / BENT	890.90	811.10
1	REAR LH DOOR HINGE UPPER	TWISTED	98.70	98.70
1	REAR LH DOOR HINGE LOWER	TWISTED	98.70	98.70
1	REAR LH DOOR WEATHERSTRIP	NECESSARY	175.60	175.60
1	REAR LH DOOR BOARD	NOT NECESSARY	766.40	-
1	REAR LH DOOR LOCK	NOT NECESSARY	378.70	-
1	REAR LH FENDER	TO REPAIR SEE LABOUR	1,033.75	-
1	REAR LH FENDER INNER SHIELD	NOT NECESSARY	89.40	-

Report Ref No. CC4/LPC22000452/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR LH FENDER BRACKET (NPA)	NOT NECESSARY	-	-
1	REAR LH FENDER PANEL (NPA)	REPEATED	-	-
1	FRONT LH KNUCKLE ARM	NOT NECESSARY	511.60	-
1	FRONT LH KNUCKLE BEARING	NOT NECESSARY	133.70	-
1	FRONT LH LOWER ARM	NOT NECESSARY	877.60	-
1	FRONT LH LOWER ARM TIE ROD (NPA)	NOT NECESSARY	-	-
1	FRONT LH STABILIZER BAR (NPA)	NOT NECESSARY	-	-
1	FRONT LH STABILIZER LINKS	NOT NECESSARY	187.60	-
1	FRONT LH STABILIZER BUSHING	NOT NECESSARY	45.70	-
1	FRONT LH STEERING RACK	NOT NECESSARY	221.45	-
1	FRONT LH SHOCK ABSORBER	NOT NECESSARY	366.80	-
1	FRONT RH SHOCK ARM (NPA)	NOT NECESSARY	-	-
1	FRONT RH KNUCKLE BEARING	NOT NECESSARY	87.50	-
1	FRONT RH LOWER ARM	NOT NECESSARY	200.00	-
1	FRONT RH LOWER ARM TIE ROD (NPA)	NOT NECESSARY	-	-
1	FRONT RH STABILIZER BAR (NPA)	NOT NECESSARY	-	-
1	FRONT RH STABILIZER LINKS	NOT NECESSARY	187.60	-
1	FRONT RH STABILIZER BUSHING	NOT NECESSARY	47.50	-
1	FRONT RH STEERING RACK	NOT NECESSARY	179.90	-
1	FRONT RH SHOCK ABSORBER	NOT NECESSARY	272.90	-
1	SIDE MIRROR LH }	CUT	799.75	680.50
1	SIDE MIRROR COVER LH }	CUT	103.30	-
1	SIDE MIRROR STAY LH	NOT NECESSARY	49.60	-
1	SIDE MIRROR SIGNAL LAMP LH	CRACKED	89.60	89.60
	LESS 25% DISCOUNT		-	-1,164.95
			14,413.46	3,494.83
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT LH RIM (SN)	CUT	600.00	280.00
1	FRONT RH RIM (SN)	CUT	600.00	280.00
10	FRONT BUMPER CLIPS (SN)	NECESSARY	50.00	50.00
10	HEADLAMP CLIPS (SN)	NOT NECESSARY	50.00	-
10	FRONT FENDER INNER SHIELD LH CLIPS (SN)	NECESSARY	50.00	50.00

Report Ref No. CC4/LPC22000452/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
10	REAR FENDER INNER SHIELD LH CLIPS (SN)	NOT NECESSARY	50.00	-
			1,400.00	660.00
	LABOUR			
	TO CONDUCT PANEL BEATING AND STRAIGHTEN PARTS ON DAMAGED AREAS.INCLUSIVE OF THE REPAIR OF FRONT LH FENDER BRACKET,HEADLAMP INNER PANEL LH,B PILLAR AND REAR LH FENDER .		1,800.00	800.00
	TO SPRAY PAINT ON AFFECTED AREAS .		2,000.00	1,200.00
	TO APPLY UNDERCOATING FOR RUST PROOFING .}		180.00	90.00
	TO APPLT TUFF COAT ON AFFECTED AREAS .}		150.00	-
	TO DISMANTLE ,REPLACE AND /OR REPAIR FRONT LH DOOR COMPONENTS.		150.00	50.00
	TO DISMANTLE ,REPLACE AND /OR REPAIR REAR LH DOOR COMPONENTS.		150.00	50.00
	TO CHECK WIRING.		120.00	20.00
	TO CONDUCT WHEEL ALIGNMENT.		200.00	100.00
			4,750.00	2,310.00
GRAND TOTAL			20,563.46	6,464.83
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,150.00

Report Ref No. CC4/LPC22000452/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJE 7925R

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

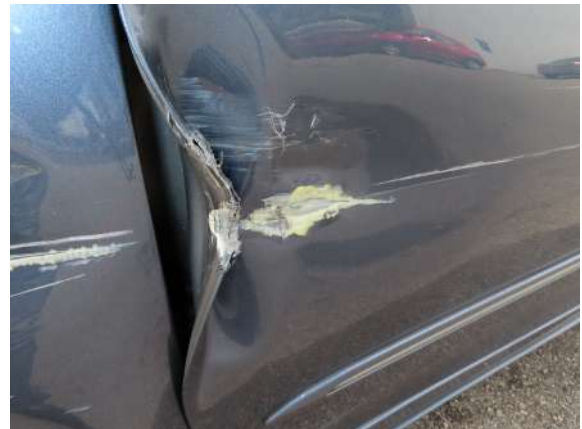



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

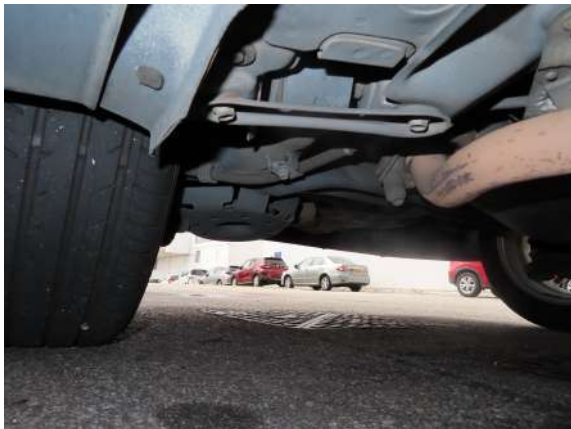



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJE 7925R

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

