

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/GRB22000523/DYA3Q2**Date:** 27/03/2023REFERENCE

Handling Insurer: India International Insurance Pte Ltd Policy No: D21MFL0000447_01

Claimant Vehicle No : SH7227A **Insured Vehicle No :** SML5487D

Date of Loss: 12/01/2022 Nature of Claim: TP Claim No: MFL2022D0000289

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SH7227A**
 Make & Model: TOYOTA PRIUS, 1.8 HYBRID CVT (A) Engine No: 2ZRS043576
 Reg. Date: 30/05/2017 (Man. Year: 2017) Chassis No: JTDKB3FU103557092
 Colour: Blue Odometer: 0 km
 Engine Capacity: 1798 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195/65 R15 Rear Tyre Size: 195/65 R15
 Front Left Side: West Lake 5 mm Rear Left Side: West Lake 5 mm
 Front Right Side: West Lake 5 mm Rear Right Side: West Lake 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	41,892.51	24,127.03	17,765.48	42.41
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,010.00	3,330.00	2,680.00	44.59
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	47,902.51	27,457.03	20,445.48	42.68
Approved Total (Overridden) (S\$)		21,900.00		
(S\$)	47,902.51	21,900.00	26,002.51	54.28
+ GST 7.00/7.00% (S\$)	3,353.18	1,533.00	1,820.18	54.28
Nett Amount (S\$)	51,255.69	23,433.00	27,822.69	54.28
+ Loss of Use (12.0 x S\$40.00/day) (S\$)		480.00		
+ Car Rental (12.0 x S\$125.40/day) (S\$)		1,504.80		
+ Doc/Search Fee (S\$)		7.45		
+ Other Costs (S\$)		80.00		
Nett Liability (S\$)		25,505.25		

INSPECTION

Date of Assignment: 14/01/2022

Date Inspected: 14/01/2022 Inspected At:

Bifrost Auto Pte Ltd (Kaki Bukit)
8 Kaki Bukit Ave 4, #01-49, Premier @ Kaki Bukit
Singapore 415875

Estimated Period of Repair: 14.0 days

Adjuster: BRYAN TANI**Manager:** Ezlyna

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 22 Sep 2022)
Parts:	144	TOYOTA PRIUS 1.8 HYBRID CVT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SH7227A)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR TRUNK LID COVER	Dented	1,126.60 FL	*1,126.60 FL
2	1		*REAR TRUNK LID LOCK	Damaged / Bent	457.90 FL	*457.90 FL
3	1		*REAR TRUNK LID COVER TRIM BOARD	Mtg Broken	254.40 FL	*254.40 FL
4	1		*BOOT LID TRIMBOARD ,CENTRE	Not Necessary	159.60 FL	*- FL
5	2		*BOOT LID TRIMBOARD SIDE (LH/RH)	Not Necessary	185.00 FL	*- FL
6	1		*BOOT LID TRIMBOARD REAR	Not Necessary	124.80 FL	*- FL
7	1		*REAR TRUNK LID RUBBER	Torn	365.20 FL	*365.20 FL
8	1		*GARNISH SUB-ASSY ,BACK DOOR ,OUTSIDE	Cut / Mtg Broken	896.30 FL	*896.30 FL
9	1		*REAR TRUNK LID LOGO (PRIUS)	Necessary	60.80 FL	*60.80 FL
10	1		*REAR TRUNK LID LOGO (HYBRID)	Necessary	52.40 FL	*52.40 FL
11	1		*REAR TRUNK LID LOGO (TOYOTA STAR)	Necessary	52.90 FL	*52.90 FL
12	2		*REAR TRUNK LID HINGE (LH/RH)	Not Necessary	379.00 FL	*- FL
13	2		*REAR TRUNK LID ABSORBER (LH/RH)	Not Necessary	575.00 FL	*- FL
14	2		*REAR TRUNK LID ABSORBER BRACKET (LH/RH)	Not Necessary	255.80 FL	*- FL
15	2		*REAR TRUNK LID STOPPER (LH/RH)	Not Necessary	169.60 FL	*- FL
16	2		*REAR NO PLATE LAMP LH/RH	Not Necessary	163.50 FL	*- FL
17	1		*REAR BUMPER	Dented / Torn	458.60 FL	*458.60 FL
18	1		*REAR BUMPER REINFORCEMENT	Buckled	318.80 FL	*318.80 FL
19	1		*REAR BUMPER LOWER COVER	Torn	552.60 FL	*552.60 FL
20	1		*REAR BUMPER SIDE RETAINER	Serviceable	225.40 FL	*- FL
21	1		*REAR BUMPER TOWING COVER	Dislodged	82.70 FL	*82.70 FL
22	1		*REAR BUMPER CLIPS	Necessary	22.00 FL	*22.00 FL
23	2		*REAR BUMPER SIDE CLIP	Not Necessary	50.00 FL	*- FL
24	2		*REAR BUMPER UPPER STOPPER (LH/RH)	Not Necessary	152.80 FL	*- FL
25	2		*SEAL ,REAR BUMPER SIDE ,LH/RH	Mtg Cracked	296.80 FL	*296.80 FL
26	2		*REAR BUMPER UNDER SIDE COVER (LH/RH)	Deformed / Torn	464.00 FL	*464.00 FL
27	2		*ARM SUB-ASSY ,REAR BUMPER (LH/RH)	Not Necessary	279.20 FL	*- FL
28	1		*REAR BUMPER REVERSE SENSOR	Damaged	188.56 FS	*135.70 FS
29	2		*TAIL LAMP ASSY (UPPER)	Mtg Cracked	1,115.80 FL	*1,115.80 FL
30	2		*TAIL LAMP ASSY (LOWER)	Mtg Cracked	1,096.80 FL	*1,096.80 FL
31	2		*TAIL LAMP QUARTER PANEL	Repair	432.00 FL	*- FL
32	2		*TAIL LAMP SIDE COVER	Not Necessary	512.00 FL	*- FL
33	4		*REAR TAILLAMP GUIDE -WHITE	Not Necessary	381.20 FL	*- FL
34	1		*REAR END PANEL	Buckled	602.10 FL	*602.10 FL
35	1		*REAR END PANEL GARNISH	Mtg Deformed	165.80 FL	*165.80 FL
36	1		*REAR WIRING ASSY	Not Necessary	582.40 FL	*- FL
37	1		*REAR SPARE TYRE PANEL	Buckled	667.70 FL	*667.70 FL
38	1		*REAR SPARE TYRE CUSHION (FLR BOARD CENTRE)	Bent / Torn	101.40 FL	*101.40 FL
39	2		*REAR FIBER TOOL BOX TRIM (LH/RH)	Deformed / Dented	1,196.00 FL	*1,196.00 FL
40	1		*REAR FIBER TOOL BOX CENTER	Not fitted	186.20 FL	*- FL
41	1		*SPARE TYRE LOCK NUT	Bent	88.40 FL	*88.40 FL
42	1		*SPARE TYRE LOCK NUT BRACKET	Not Necessary	113.50 FL	*- FL
43	2		*SPARE TYRE SIDE PANEL (LH/RH)	Not Necessary	574.60 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
44	1		*REAR EXHAUST PIPE RH	Serviceable	1,163.40 FL	*- FL
45	1		*REAR EXHAUST PIPE HANGER	Not Necessary	40.70 FL	*- FL
46	1		*REAR EXHAUST PIPE INSULATOR	Torn	314.60 FL	*314.60 FL
47	2		*REAR FENDER SHIELD (LH/RH)	Not Necessary	348.40 FL	*- FL
48	2		*REAR FENDER AIR DUCT	Not Necessary	330.20 FL	*- FL
49	1		*BONNET	Dented	950.50 FL	*950.50 FL
50	1		*INSULATOR HOOD	Crumpled	398.10 FL	*398.10 FL
51	10		*INSULATOR CLIPS	Necessary	36.80 FL	*36.80 FL
52	1		*BONNET RUBBER	Not Necessary	35.50 FL	*- FL
53	1		*BONNET CABLE	Not Necessary	83.20 FL	*- FL
54	2		*BONNET HINGE (RH)	Bent (1 PCS ONLY)	175.40 FL	*87.70 FL
55	2		*BONNET HINGE (LH)	Bent (1 PCS ONLY)	175.40 FL	*87.70 FL
56	1		*BONNET LOCK	Bent	132.60 FL	*132.60 FL
57	1		*RADIATOR GRILLE	Torn	438.00 FL	*438.00 FL
58	1		*RADIATOR GRILLE EMBLEM	Cracked	88.00 FL	*88.00 FL
59	1		*FRONT BUMPER COVER	Torn	499.90 FL	*499.90 FL
60	1		*FRONT BUMPER REINFORCEMENT	Bent	696.40 FL	*696.40 FL
61	1		*FRONT BUMPER REINFORCEMENT ABSORBER	Serviceable	115.70 FL	*- FL
62	1		*FRONT BUMPER LOWER REINFORCEMENT	Not Necessary	364.20 FL	*- FL
63	2		*FRT BUMPER LOWER REINFORCEMENT BRACKET LH/RH	Not Necessary	660.00 FL	*- FL
64	1		*ABSORBER FRONT BUMPER LOWER	Not Necessary	127.70 FL	*- FL
65	2		*FRONT SIDE MEMBER REINFORCEMENT PANEL(LH/RH)	Not Necessary	641.40 FL	*- FL
66	1		*FRONT SIDE MEMBER SIDE COVER	Not Necessary	172.50 FL	*- FL
67	1		*FRONT BUMPER SPONGE	Torn	78.80 FL	*78.80 FL
68	1		*FRONT BUMPER LOWER GRILLE	Deformed	166.90 FL	*166.90 FL
69	1		*LAMP ASSY ,FOG ,RH	Not Necessary	920.00 FL	*- FL
70	1		*LAMP ASSY ,FOG ,LH	Not Necessary	920.00 FL	*- FL
71	1		*FRONT NO PLATE GARNISH	Cracked	99.00 FL	*99.00 FL
72	2		*FRONT BUMPER SIDE RETAINER	Not Necessary	154.00 FL	*- FL
73	1		*FRONT BUMPER TOP GARNISH	Cracked / Broken	225.40 FL	*225.40 FL
74	1		*COVER FRONT BUMPER HOLE RH	Serviceable	28.38 FL	*- FL
75	1		*COVER FRONT BUMPER HOLE LH	Serviceable	28.38 FL	*- FL
76	1		*UNIT ASSY ,HEADLAMP ,RH (LED)	Cracked	3,455.00 FL	*2,637.60 FL
77	1		*UNIT ASSY ,HEADLAMP ,LH (LED)	Broken	3,455.00 FL	*2,637.60 FL
78	1		*HEADLAMP ECU	O/S Not Necessary/N/SMtgBroken	1,365.20 FL	*486.40 FL
79	1		*HEAD LAMP PANEL (RH)	Bent	240.10 FL	*240.10 FL
80	1		*HEAD LAMP PANEL (LH)	Bent	240.10 FL	*240.10 FL
81	1		*TOP PANEL CENTRE	Bent	364.98 FL	*364.98 FL
82	1		*TOP PANEL SIDE (N/S)	Bent	145.90 FL	*145.90 FL
83	1		*BRACE PANEL	Bent	75.20 FL	*75.20 FL
84	1		*RADIATOR ASSY	Bent / Punctured	1,841.80 FL	*1,841.80 FL
85	1		*RADIATOR FAN GRILLE	Not Necessary	632.40 FL	*- FL
86	1		*GUIDE RADIATOR AIR NO.3	Not Necessary	299.70 FL	*- FL
87	1		*DEFLECTOR RADIATOR SIDE ,RH	Deformed	83.50 FL	*83.50 FL
88	1		*DEFLECTOR RADIATOR SIDE ,LH	Deformed	83.50 FL	*83.50 FL
89	1		*RADIATOR TOP HOSE	Not Necessary	43.03 FL	*- FL
90	1		*RADIATOR TOP HOSE	Not Necessary	42.60 FL	*- FL
91	1		*RADIATOR SPARE TANK HYBRID	Mtg Cracked	225.80 FL	*225.80 FL
92	1		*STAY ,RADIATOR SUPPORT ,RH	Not Necessary	65.70 FL	*- FL
93	1		*STAY ,RADIATOR SUPPORT ,LH	Not Necessary	65.70 FL	*- FL
94	1		*RADIATOR FAN BLADE (RH)	Cracked	233.10 FL	*233.10 FL
95	1		*RADIATOR FAN BLADE (LH)	Cracked	233.10 FL	*233.10 FL
96	1		*RADIATOR FAN MOTOR (RH)	Not Necessary	543.70 FL	*- FL
97	1		*RADIATOR FAN MOTOR (LH)	Not Necessary	543.70 FL	*- FL
98	2		*RADIATOR FAN COWLING (LH/RH)	Cracked / Deformed	902.60 FL	*902.60 FL
99	1		*RESERVE TANK ASSY ,RADIATOR W/O CAP	Not Necessary	395.30 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
100	1		*PIPE RADIATOR	Not Necessary	126.50 FL	*- FL
101	2		*HORN	Serviceable	225.42 FL	*- FL
102	1		*AIR CLEANER HOSE	Deformed	62.12 FL	*62.12 FL
103	1		*AIR DUCT	Mtg Cracked	129.40 FL	*129.40 FL
104	1		*AIR DUCT HOSE	Not Necessary	169.20 FL	*- FL
105	1		*AIR DUCT CENTRE	Mtg Cracked	94.03 FL	*94.03 FL
106	1		*CONDENSER ASSY ,W/RECEIVER	Punctured / Bent	1,336.60 FL	*1,336.60 FL
107	1		*FENDER SUB-ASSY ,FRONT RH	Repair	945.30 FL	*- FL
108	1		*FENDER SUB-ASSY ,FRONT LH	Dented	945.30 FL	*945.30 FL
109	2		*FRONT FENDER SHIELD	Not Necessary	76.00 FL	*- FL
110	2		*FRONT FENDER SHIELD CLIP	Not Necessary	29.80 FL	*- FL
111	1		*FRONT FENDER HYBRID EMBLEM ,RH/LH	O/S Not Necessary/N/SNecessary	173.00 FL	*86.50 FL
112	1		*BRACKET FRONT SIDE PANEL RH	Not Necessary	86.30 FL	*- FL
113	1		*BRACKET FRONT SIDE PANEL LH	Not Necessary	86.30 FL	*- FL
114	1		*EXTENSION FRONT FENDER RH	Not Necessary	47.20 FL	*- FL
115	1		*EXTENSION FRONT FENDER LH	Not Necessary	47.20 FL	*- FL
116	1		*WIPER SPARE TANK ASSY	Not Necessary	486.70 FL	*- FL
117	1		*WIPER TANK NECK	Not Necessary	89.40 FL	*- FL
118	1		*REAR TRUNK LOWER W/S MOULDING	Not Necessary	180.00 FS	*- FS
119	1		*REAR LOWER W/S SEALANT	Necessary	46.00 FS	*46.00 FS
120	1		*REAR WINDSCREEN MOULDING	Not Necessary	160.00 FS	*- FS
121	1		*REAR WINDSCREEN SEALANT	Necessary	46.00 FS	*46.00 FS
122	1		*REAR NO PLATE WITH COVER	Bent	100.00 FS	*45.00 FS
123	1		*REAR TRUNK LID APPS STICKER	Necessary	40.00 FS	*40.00 FS
124	1		*REAR TRUNK LID COMFORT & TEL NO.STICKER	Necessary	60.00 FS	*60.00 FS
125	1		*REAR BUMPER ADVERTISEMENT	Necessary	120.00 FS	*120.00 FS
126	2		*REAR FENDER ADVERTISEMENT LOGO (LH/RH)	Necessary	240.00 FS	*240.00 FS
127	1		*FRONT NO PLATE }	Dislodged	25.00 FS	*45.00 FS
128	1		*FRONT NO PLATE TRIM COVER }	Damaged / Dislodged	35.00 FS	*- FS
129	1		*COOLANT	Not Necessary	45.00 FS	*- FS
130	2		*REAR FENDER TRIMBOARD (LH/RH)	Deformed	1,450.00 FL	*1,450.00 FL
131	1		*FRONT LOWER PANEL	Bent / Dented	320.65 FL	*320.65 FL
132	1		*AIR CLEANER HOUSING ASSY	Broken	986.10 FL	*986.10 FL
133	1		*INTAKE AIR FLOW (AIR FLOW SENSOR)	Broken	344.60 FL	*344.60 FL
134	1		*TRAY ,BATTERY	Cracked	42.80 FL	*42.80 FL
135	1		*BATTERY (50%)	Dented	220.00 FS	*80.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) 51,989.25 31,883.48
- List Item Discount on L Items 20.00/25.00% (\$\$) 10,096.74 7,756.45

Total Parts (\$\$) 41,892.51 24,127.03

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING	New	2,200.00	1,400.00
2	SPRAY PAINTING CHARGE	New	2,000.00	1,400.00
3	WIRING CHARGE	New	100.00	30.00
4	TUFF KOTE	New	100.00	40.00
5	TOWING CHARGE	New	80.00	0.00
6	REMOVE/REFIX WINDSCREEN GLASS	New	240.00	80.00
7	REMOVE/REFIX REVERSE SENSOR	New	120.00	40.00
8	REMOVE/REFIX FUEL TANK	New	80.00	0.00
9	REMOVE/REFIX EXHAUST PIPE	New	80.00	60.00
10	FOUR WHEEL ALIGNMENT	New	120.00	0.00
11	REMOVE/REFIX RADIATOR	New	90.00	50.00
12	REMOVE/REFIX AIRCON & REFILL GAS	New	130.00	80.00
13	REMOVE/REFIX FUSE BOX	New	120.00	0.00
14	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE	New	550.00	150.00
Gross Labour Cost (S\$)			6,010.00	3,330.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >