LKK Auto Consultants #01-25 Paya Ubi Industrial Park, 51 Ubi Avenue 1 408933

Insurer Reference: SMG7954K Repairer Reference: SMG7954K

Repairer Reference: SMG7954K Registration: SMG7954K Date calculated: 11/05/2022 9:04 AM Printed: 11/05/2022 9:04 AM

Summary Information

Claim

Location: Singapore (SG) Work Provider: China Taiping Insurance

(Singapore) Pte Ltd SGD

15/01/22

Full Report

Printed by: KK LAU Currency: Claim Reference: SMG7954K Date of Incident:

Estimated Repair Time: 21 Hire Car Start: Actual Repair Days: Hire Car End:

Vehicle Details

Vehicle

Manufacturer: NISSAN

Model: SYLPHY (B17T)
Sub Model: BASE MODEL
Model Sheet Number: 71 PT 01
Registration: SMG7954K

VIN number: MNTBBAB17Z0033943

Odometer: 43606

Model Specs

FROM 09.2018 XENON HEADLAMPS LEATHER TRIM DOOR WOOD INSERT

EQUIPMENT PREMIUM RR PARK DIST CONTROL 1.6 LTR 85 KW GEARBOX CVT

ABS WHEELS 5.5J X 15 WHEEL COVER 15" TWO COAT METALLIC

PREPARE OFF VEHICLE


Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

All	
Underbody	

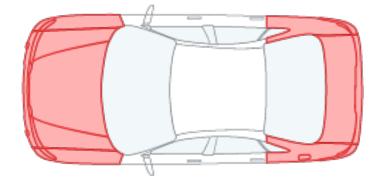

Tyres Condition

Tyre Brand Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Outer),

mm mm mm mm Middle), mm

Spare Tyre Brand

Tread (Spare), mm

Labour

	Time Base 10 WU/h	Price = 42.	00 SGD/h
Code	Description	WU	Price SGD
NO NUMBER	JOB ALLOWANCE	5.0	21.00
UA10A1)	R + R FRONT BUMPER INCLUDES: R + R FRONT GRILL	6.0	25.20
UA18A1	R + R FRONT BUMPER GRILLE	5.0	21.00
NO NUMBER	R + R FRONT NUMBER PLATE	1.0	4.20
VB10A1)	R + R L/R DOOR SILL COVER	1.0	4.20
VB10A1)	R + R R/R DOOR SILL COVER	1.0	4.20
UT20A1	R + R LEFT ROOF MOULDING	2.0	8.40
UT20A1	R + R RIGHT ROOF MOULDING	2.0	8.40
NO NUMBER	RENEW L/R SIDE PANEL AND END PANEL INCLUDES: R + R REAR SEAT, SEAL, TAIL LAMPS, REAR BUMPER AND ALL TRIMS IN THE REPAIR SECTION	90.0	378.00
NO NUMBER	RENEW R/R SIDE PANEL (ADD/WORK) INCLUDES: R + R TRIMS AND NECESSARY ATTACHED PARTS	50.0	210.00
8004A1)	R + R L/R QTR GLASS	7.0	29.40
8004A1)	R + R R/R QTR GLASS	7.0	29.40

Code	Description		WU	Price SGD
UC10A1)	RENEW REAR BUMPER (REMOVED)		2.0	8.40
NO NUMBER	R + R L/R PARKING SYSTEM SENSOR		1.0	4.20
NO NUMBER	R + R REAR CENTRE PARKING AID SENSOR		1.0	4.20
NO NUMBER	R + R R/R PARKING SYSTEM SENSOR		1.0	4.20
7700A1)	R + R FUEL TANK		11.0	46.20
UM10AÍ	RENEW BOOTLID INCLUDES: LOAD COMP COVER, BOTH INNER TAILLAMPS AND REQUIRED ATTACHED PARTS R + R		20.0	84.00
8002A1)	R + R REAR WINDOW INCLUDES: R + R ADDITIONAL BRAKE LAMP		20.0	84.00
NO NUMBER	RENEW BOOT FLOOR		40.0	168.00
7712A1)	R + R REAR SILENCER		1.0	4.20
PW10A1)	R + R LEFT REAR WHEEL		1.0	4.20
PW10A1)	R + R RIGHT REAR WHEEL		1.0	4.20
PC10A1)	R + R LEFT REAR BRAKE DRUM (WHEEL REMOVED)		1.0	4.20
PC10A1)	R + R RIGHT REAR BRAKE DRUM (WHEEL REMOVED)		1.0	4.20
PC11A1)	R + R REAR BRAKE DRUMS ADD WORK		1.0	4.20
7604A1)	L/R COIL SPRING DETACH + REFIT		2.0	8.40
7604A1)	R/R COIL SPRING DETACH + REFIT		2.0	8.40
7604A1)	R + R LEFT REAR SHOCK ABSORBER		2.0	8.40
7604A1)	R + R RIGHT REAR SHOCK ABSORBER		2.0	8.40
7605A1)	ADD/WORK FOR R + R REAR SHOCK ABSORBER		2.0	8.40
0281	FRONT BUMPER REPAIR		20.0*	84.00
1781	L/R DOOR REPAIR		10.0*	42.00
1782	R/R DOOR REPAIR		10.0*	42.00
3931	REAR FLOOR C-MEMBER REPAIR		30.0*	126.00
3961	RR FLOOR CTR C-MEMB REPAIR		30.0*	126.00
3992	R/R SIDE MEMBER CPL REPAIR		20.0*	84.00
4001	L/S-MEMBER END PANEL REPAIR		25.0*	105.00
4002	R/S-MEMBER END PANEL REPAIR		25.0*	105.00
4285	PARCEL SHELF PANEL REPAIR		20.0*	84.00
	Labour Cost	Hrs	wu	
	Panel / Mechanical Labour	47.90	479.0	2,011.80
	Total of Labour			2,011.80

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	L/R BUMPER BRACKET SURFACE PAINT	4.0
	R/R BUMPER BRACKET SURFACE PAINT	4.0
	REAR PANEL NEW PART PAINTING	21.0
	BOOTLID NEW PART PAINTING	13.0
	L/R SIDE PANEL CPL NEW PART PAINTING	29.0
	R/R SIDE PANEL CPL NEW PART PAINTING	29.0
	BOOTFLOOR SURFACE PAINT	8.0
	L/R SIDE MEMBER CPL SURFACE PAINT	4.0
	R/R SIDE MEMBER CPL SURFACE PAINT	4.0
	L/R OUTER WHEELHOUSE SURFACE PAINT	6.0
	R/R OUTER WHEELHOUSE SURFACE PAINT	4.0

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	FRONT BUMPER NEW PART PAINT K1G/P	32.0
	REAR BUMPER NEW PART PAINT K1R	11.0
	L/R DOOR REPAIR PAINTING <50%	15.0
	R/R DOOR REPAIR PAINTING <50%	15.0
	REAR FLOOR C-MEMBER SURFACE PAINT	4.0
	RR FLOOR CTR C-MEMB SURFACE PAINT	5.0
	PARCEL SHELF PANEL SURFACE PAINT	7.0

Paint Material Per Part

Code	Description	Price SGD
2627	L/R BUMPER BRACKET SURFACE PAINT	1.25
2628	R/R BUMPER BRACKET SURFACE PAINT	1.25
2711	REAR PANEL NEW PART PAINTING	25.85
2931	BOOTLID NEW PART PAINTING	32.51
3481	L/R SIDE PANEL CPL NEW PART PAINTING	40.70
3482	R/R SIDE PANEL CPL NEW PART PAINTING	40.70
3901	BOOTFLOOR SURFACE PAINT	20.17
3991	L/R SIDE MEMBER CPL SURFACE PAINT	3.74
3992	R/R SIDE MEMBER CPL SURFACE PAINT	3.74
4161	L/R OUTER WHEELHOUSE SURFACE PAINT	9.96
4162	R/R OUTER WHEELHOUSE SURFACE PAINT	2.99
0281	FRONT BUMPER NEW PART PAINT K1G/P	129.60
2581	REAR BUMPER NEW PART PAINT K1R	51.17
1781	L/R DOOR REPAIR PAINTING <50%	25.19
1782	R/R DOOR REPAIR PAINTING <50%	25.19
3931	REAR FLOOR C-MEMBER SURFACE PAINT	2.99
3961	RR FLOOR CTR C-MEMB SURFACE PAINT	4.98
4285	PARCEL SHELF PANEL SURFACE PAINT	17.43

Labour Cost - Paint		Hrs	WU	Price SGD
Factor	42.00 SGD/h			
Time Paint			215.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.80	8.0	33.60
Total	10 WU/h	24.80	248.0	1,041.60

Material Cost - Paint	Price SGD
New Part Painting	139.76
New Part Painting - Plastic K1R	51.17
New Part Painting - Plastic K1G/PUR	129.60
Repair Painting	50.38
Surface-/Blend Paint	68.50
Material-constant Metal Preparation	28.60
Material-constant Plastic	12.70
Total	480.71

Spare Parts

prices as at 2015-06-01/01

Code	Description	Part Number	Part Source	Price SGD
3016	BADGE MODEL	84890 3RA1A	Original	0.00
2977	BOOT/TAILGATE LOCK	84630 3AW0A*	Original	60.00
3901	BOOTFLOOR	G4514 3STMA*	Original	500.00
2931	BOOTLID	H430M 3SMMA*	Original	550.00
2987	BOOT LID MOULDING	84810 3ST1A*	Original	150.00
1005	bootlidweatherstrip	SUPPLEMENTARY	Original	65.00
3018	EQUIPMENT BADGE	84898 3RA0A*	Original	0.00
0257	FRONT NUMBER PLATE	KNPL3	Original	35.00
3861	L/QTR WDW BOND KIT	KNGKWI1	_	0.00
2627	L/R BUMPER BRACKET	85213 EE530*	Original	30.00
3307	L/R BUMPER REFLECTOR	26565 5C000	Original	50.00
3295	L/R INNER LAMP	26559 3SB3A	Original	90.00
3291	L/R OUTER LAMP	26559 3SB0A*	Original	260.00
1831	L/R QUARTER GLASS	83301 3SB1A	-	0.00
3481	L/R SIDE PANEL CPL	G8101 3RAMA	Original	800.00
3862	R/QTR WDW BOND KIT	KNGKWI1	-	0.00
2628	R/R BUMPER BRACKET	85212 EE530*	Original	30.00
2620	R/R INN BUMPER BRKT	85226 3ST1A*	Original	30.00
3296	R/R INNER LAMP	26554 3SB3A	Original	90.00
3292	R/R OUTER LAMP	26554 3SB0A*	Original	260.00
1830	R/R QUARTER GLASS	83300 3SB1A	Original	0.00
3482	R/R SIDE PANEL CPL	G8100 3RAMA	Original	800.00
3015	REAR BADGE	84890 3RA0A	Original	0.00
2581	REAR BUMPER	85022 3ST6H*	Original	550.00
2711	REAR PANEL	G9110 3SBMA*	Original	280.00
3160	REAR SCREEN BOND KIT	G2891 89925		0.00
3161	REAR SCREEN SEAL	G2716 89900		0.00
2624	RR CTR BUMPER ABSORB	85090 3ST0A*	Original	100.00
1004	RR FENDER VENTILATOR	COVER	Original	40.00
1003	SPARE TYRE PANEL TOP	SPONGE	Original	160.00
4985	UPP REAR PANEL TRIM	84921 3SB1A*	Original	60.00
3017	VERSION BADGE	84895 3SH7B*	Original	0.00
f: OEM Parts	Savings			0.00
n: Non-OEM Parts	Subtotal			4,990.00
u: Used parts	Fixed Sundry Parts I	Price		100.00
	Total			5,090.00

Extras

Code	Description	Price SGD
1000	REVERSE SENSOR SENSOR	200.00*
	Total Extras	200.00

Final Calculation

	SGD	SGD
Parts	4,990.00	
Fixed Sundry Parts Price	100.00	
Total Parts		5,090.00
Labour Time Base 10 WU/h		
Total 479.0 WU X 42.00 SGD/h	2,011.80	
Total of Labour	,	2,011.80
Total Of Extras		200.00
Paint Work Time Base 10 WU/h		
Labour Cost 248.0 WU X 42.00 SGD/h	1,041.60	
Material Cost	480.71	
Total Paint Including Material		1,522.31
Repair Cost Excludes GST		8,824.11
GST (+7.00%)		617.69
Repair Cost Included GST		9,441.80

Comments

* - USER SUPPLIED DATA NN - NO MANUFACTURERS CODE EXISTS) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.