

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22000814/KQY3Q2**Date:** 01/04/2022**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMCVSNW00106592102
Claimant Vehicle No :	SMV5937U	Insured Vehicle No :	YN6371U
Date of Loss:	20/01/2022	Nature of Claim:	TP
		Claim No:	SNM22D200547/C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMV5937U		
Make & Model:	VOLKSWAGEN TIGUAN, 1.4 HIGHLINE 280 TSI (A)	Engine No:	CZE820931
Reg. Date:	28/12/2018 (Man. Year: 2018)	Chassis No:	WVGZZZ5NZJW973640
Colour:	White	Odometer:	62043 km
Engine Capacity:	1395 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	235/55 R18	Rear Tyre Size:	235/55 R18
Front Left Side:	Pirelli 8 mm	Rear Left Side:	Pirelli 8 mm
Front Right Side:	Pirelli 8 mm	Rear Right Side:	Pirelli 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	42,118.00	14,323.91	27,794.09	65.99
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,170.00	3,390.00	2,780.00	45.06
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	48,288.00	17,713.91	30,574.09	63.32
Approved Total (Overridden) (\$\$)		14,000.00		
(\$\$)	48,288.00	14,000.00	34,288.00	71.01
+ GST 7.00/7.00% (\$\$)	3,380.16	980.00	2,400.16	71.01
Nett Amount (\$\$)	51,668.16	14,980.00	36,688.16	71.01

INSPECTION

Date of Assignment:	24/01/2022	
Date Inspected:	24/01/2022 Inspected At:	S Three Automotive Recovery Pte Ltd (HQ) Blk 8 Sin Ming Industrial Estate, #01-64/66 Sector C Singapore 575643
Estimated Period of Repair:	10.0 days	

Adjuster: KENNETH KONG**Manager:** SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 01 Apr 2022)

Parts: M1-SUV VOLKSWAGEN TIGUAN 1.4 HIGHLINE 280 TSI (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SMV5937U)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Buckled	1,475.00 F	*1,132.50 FL
2	1		*FRONT BUMPER SIDE RETAINER LH	Distorted	60.00 F	*60.00 FL
3	1		*FRONT BUMPER SIDE RETAINER RH	Distorted	60.00 F	*60.00 FL
4	1		*FRONT BUMPER BRACKET LH	Repair	45.00 F	*- FL
5	1		*FRONT BUMPER BRACKET RH	Repair	45.00 F	*- FL
6	1		*FRONT BUMPER TOWING COVER	Serviceable	180.00 F	*- FL
7	1		*FRONT BUMPER FOG LAMP LH	Serviceable	250.00 F	*- FL
8	1		*FRONT BUMPER FOG LAMP RH	Serviceable	250.00 F	*- FL
9	1		*FRONT BUMPER FOGLAMP COVER LH	Serviceable	95.00 F	*- FL
10	1		*FRONT BUMPER FOGLAMP COVER RH	Serviceable	95.00 F	*- FL
11	1		*FRONT BUMPER LOWER CENTRE GRILLE	Dented	240.00 F	*240.00 FL
12	1		*FRONT BUMPER REINFORCEMENT UPPER	Bent	650.00 F	*366.10 FL
13	1		*FRONT BUMPER REINFORCEMENT LOWER	Repair	270.00 F	*- FL
14	1		*FRONT GRILLE ASSY (WITH LOGO)	Cracked	490.00 F	*490.00 FL
15	1		*FRONT BONNET	Buckled	1,065.00 F	*1,065.00 FL
16	1		*FRONT BONNET SIDE RUBBER SEAL LH	Serviceable	30.00 F	*- FL
17	1		*FRONT BONNET SIDE RUBBER SEAL RH	Serviceable	30.00 F	*- FL
18	1		*FRONT BONNET INSULATOR	Serviceable	380.00 F	*- FL
19	1		*FRONT BONNET LOCK ASSY	Repair	185.00 F	*- FL
20	1		*FRONT BONNET HINGE LH	Repair	230.00 F	*- FL
21	1		*FRONT BONNET HINGE RH	Repair	230.00 F	*- FL
22	1		*FRONT BONNET LOCK CATCH	Repair	105.00 F	*- FL
23	1		*FRONT HEADLAMP ASSY LH HID	Serviceable	1,880.00 F	*- FL
24	1		*FRONT HEADLAMP ASSY RH HID	Serviceable	1,880.00 F	*- FL
25	1		*FRONT HEADLAMP LOWER BRACKET RH	Serviceable	25.00 F	*- FL
26	1		*FRONT HEADLAMP LOWER BRACKET LH	Serviceable	25.00 F	*- FL
27	1		*FRONT HEADLAMP HID BULB LH	Serviceable	300.00 F	*- FL
28	1		*FRONT HEADLAMP HID BULB RH	Serviceable	300.00 F	*- FL
29	1		*FRONT SUPPORT PANEL ASSY	Cracked	990.00 F	*902.00 FL
30	1		*FRONT SUPPORT PANEL TOP GARNISH	Cracked	770.00 F	*310.00 FL
31	1		*FRONT BRACE PANEL	Repair	300.00 F	*- FL
32	1		*FRONT FENDER LH	Repair	650.00 F	*- FL
33	1		*FRONT FENDER RH	Repair	650.00 F	*- FL
34	1		*FRONT FENDER INNER SHIELD LH	Serviceable	130.00 F	*- FL
35	1		*FRONT FENDER INNER SHIELD RH	Serviceable	130.00 F	*- FL
36	1		*FRONT FENDER WHEELARCH GARNISH LH	Buckled	280.00 F	*280.00 FL
37	1		*FRONT FENDER WHEELARCH GARNISH RH	Buckled	280.00 F	*280.00 FL
38	1		*FRONT DOOR LOWER GARNISH LH	Serviceable	270.00 F	*- FL
39	1		*FRONT DOOR LOWER GARNISH RH	Serviceable	270.00 F	*- FL
40	1		*RADIATOR ASSY	Punctured	390.00 F	*390.00 FL
41	1		*RADIATOR FAN ASSY	Cracked	1,330.00 F	*1,210.00 FL
42	1		*RADIATOR TOP HOSE	Serviceable	247.00 F	*- FL
43	1		*AC CONDENSOR ASSY	Bent / Punctured	810.00 F	*615.00 FL
44	1		*AC FAN ASSY	Serviceable	1,230.00 F	*- FL
45	1		*WIPER TANK	Serviceable	180.00 F	*- FL
46	1		*REAR BUMPER TOP	Buckled	1,520.00 F	*1,345.60 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
47	1		*REAR BUMPER CENTRE	Bent	230.00 F	*230.00 FL
48	1		*REAR BUMPER LOWER	Bent	450.00 F	*450.00 FL
49	1		*REAR BUMPER SIDE CHROME MOULDING LH	Necessary	195.00 F	*195.00 FL
50	1		*REAR BUMPER SIDE CHROME MOULDING RH	Necessary	195.00 F	*195.00 FL
51	1		*REAR BUMPER CENTRE CHROME MOULDING	Dented	255.00 F	*255.00 FL
52	1		*REAR BUMPER REFLECTOR SMALL LH	Serviceable	65.00 F	*- FL
53	1		*REAR BUMPER REFLECTOR SMALL RH	Serviceable	65.00 F	*- FL
54	1		*REAR BUMPER REFLECTOR BIG LH	Serviceable	65.00 F	*- FL
55	1		*REAR BUMPER REFLECTOR BIG RH	Serviceable	65.00 F	*- FL
56	1		*REAR BUMPER RETAINER LH	Serviceable	45.00 F	*- FL
57	1		*REAR BUMPER RETAINER RH	Serviceable	45.00 F	*- FL
58	1		*REAR BUMPER BRACKET LH	Repair	45.00 F	*- FL
59	1		*REAR BUMPER BRACKET RH	Repair	45.00 F	*- FL
60	1		*REAR BUMPER REINFORCEMENT	Bent	480.00 F	*450.00 FL
61	1		*REAR BUMPER SPONGE	No such part	280.00 F	*- FL
62	1		*REAR BUMPER TOWING COVER	Dented	36.00 F	*36.00 FL
63	1		*REAR END PANEL	Bent	530.00 F	*530.00 FL
64	1		*REAR END PANEL GARNISH	Serviceable	330.00 F	*- FL
65	1		*REAR BUMPER LOWER COVER	Dented	320.00 F	*320.00 FL
66	1		*TAILGATE	Bent	2,490.00 F	*1,552.30 FL
67	1		*TAILGATE EMBLEM TIGUAN	Necessary	120.00 F	*120.00 FL
68	1		*TAILGATE LOGO	Necessary	130.00 F	*130.00 FL
69	1		*TAILGATE RUBBER BEARING	Serviceable	240.00 F	*- FL
70	1		*TAILGATE INNER TRIMBOARD	Serviceable	380.00 F	*- FL
71	1		*REAR NO PLATE LAMP LH	Serviceable	90.00 F	*- FL
72	1		*REAR NO PLATE LAMP RH	Serviceable	90.00 F	*- FL
73	1		*TAILLAMP RH	Serviceable	650.00 F	*- FL
74	1		*TAILLAMP LH	Serviceable	650.00 F	*- FL
75	1		*TAILLAMP INNER PANEL LH	Repair	325.00 F	*- FL
76	1		*TAILLAMP INNER PANEL RH	Repair	325.00 F	*- FL
77	1		*TAILLAMP INNER RH	Repair	485.00 F	*- FL
78	1		*TAILLAMP INNER LH	Repair	485.00 F	*- FL
79	1		*TAILGATE LOCK	Repair	180.00 F	*- FL
80	1		*TAILGATE REFLECTOR RH	Scratched	480.00 F	*385.20 FL
81	1		*TAILGATE REFLECTOR LH	Scratched	480.00 F	*385.20 FL
82	1		*TAILGATE CATCH	Repair	70.00 F	*- FL
83	1		*TAILGATE OUTER HANDLE GARNISH	Serviceable	180.00 F	*- FL
84	1		*TAILGATE INNER HANDLE GARNISH	Serviceable	180.00 F	*- FL
85	1		*TAILGATE AUTO SWITCH	Serviceable	930.00 F	*- FL
86	1		*KEYLESS SENSOR	Serviceable	450.00 F	*- FL
87	1		*REAR WIPER ARM	Serviceable	85.00 F	*- FL
88	1		*REAR WIPER MOTOR	Serviceable	375.00 F	*- FL
89	1		*REAR WINDSCREEN GLASS WITH MOULDING	Not Necessary	1,030.00 F	*- FL
90	1		*SPARE TYRE PANEL	Repair	1,680.00 F	*- FL
91	1		*SPARE TYRE TOP BOARD	Serviceable	1,260.00 F	*- FL
92	2		*REAR EXHAUST PIPE MOUNTING LH & RH	Serviceable	55.00 F	*- FL
93	1		*REAR EXHAUST PIPE SILENCER	Bent	1,080.00 F	*1,080.00 FL
94	1		*REAR EXHAUST HEAT SHIELD	Repair	185.00 F	*- FL
95	1		*FRONT NO PLATE	Cracked	50.00 FS	*45.00 FS
96	1		*FRONT NO PLATE GARNISH	Dented	50.00 FS	*50.00 FS
97	1		*FRONT PARKING SENSOR	Serviceable	480.00 FS	*- FS
98	1		*FRONT BUMPER CLIPS	Necessary	50.00 FS	*50.00 FS
99	1		*FRONT GRILLE CLIPS	Necessary	50.00 FS	*50.00 FS
100	1		*FRONT SUPPORT PANEL GARNISH CLIPS	Not Necessary	50.00 FS	*- FS
101	1		*FRONT DOOR LOWER GARNISH CLIPS	Not Necessary	50.00 FS	*- FS
102	1		*COOLANT	Necessary	50.00 FS	*25.00 FS
103	1		*TAILGATE INNER TRIM CLIPS	Not Necessary	50.00 FS	*- FS
104	1		*REAR BUMPER CLIPS	Necessary	50.00 FS	*50.00 FS
105	1		*REAR BUMPER LOWER COVER CLIPS	Necessary	50.00 FS	*50.00 FS
106	1		*REAR PANEL SEALANT	Necessary	80.00 FS	*30.00 FS

Report was unsubmitted during this print-out.

4/1/22, 12:44 PM				Adjuster Report		
No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
107	1		*REAR PANEL INNER GARNISH CLIPS	Not Necessary	50.00 FS	*- FS
108	1		*REAR REVERSE SENSOR	Shorted	480.00 FS	*320.00 FS
109	1		*REAR NO PLATE	Serviceable	50.00 FS	*- FS
110	1		*REAR NO PLATE GARNISH	Serviceable	50.00 FS	*- FS
111	1		*SPARE TYRE PANEL SEALANT	Not Necessary	80.00 FS	*- FS
112	1		*REAR WINDSCREEN INNER SEAL	Necessary	50.00 FS	*30.00 FS
113	1		*REAR WINDSCREEN CLEANER & PRIMER	Necessary	50.00 FS	*30.00 FS
114	1		*REAR WINDSCREEN SEALANT	Necessary	50.00 FS	*40.00 FS
F=Franchise part. S=SpcNett. L=ListItemDisc.						
Sub Total (S\$)					42,118.00	15,829.90
- List Item Discount on L Items 0.00/10.00% (S\$)					0.00	1,505.99
Total Parts (S\$)					42,118.00	14,323.91
Report was unsubmitted during this print-out.						

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	STRAIGHTEN & PANEL BEAT ACCIDENT AREA -FRONT	New	1,200.00	600.00
2	STRAIGHTEN & PANEL BEAT ACCIDENT AREA -REAR	New	1,200.00	600.00
3	SPRAY PAINTING ON ACCIDENT AREA-FRONT	New	1,200.00	660.00
4	SPRAY PAINTING ON ACCIDENT AREA-REAR	New	1,200.00	1,100.00
5	CHECK & REPAIR WIRING SYSTEM	New	120.00	40.00
6	R&R AIRCON CONDENSOR & CHARGE UP GAS	New	120.00	100.00
7	R&R RADIATOR ASSY TO ASSIST REPAIR	New	120.00	50.00
8	RESPRAY TUFF KOTE ON ACCIDENT AREA	New	120.00	60.00
9	R&R REVERSE SENSOR AND CALIBRATION SYSTEM	New	120.00	0.00
10	R&R FRONT PARKING SENSOR AND CALIBRATION SYSTEM	New	120.00	60.00
11	R&R TAILGATE COMPONENTS	New	120.00	60.00
12	R&R CARPET AND INNER TRIM TO ASSIST REPAIR	New	150.00	0.00
13	LABOUR TO REMOVE AND REFIT EXHAUST PIPE WITH INSTALL	New	380.00	60.00
Gross Labour Cost (\$\$)			6,170.00	3,390.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >