

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG22001008/KYA3Q2**Date:** 20/03/2023REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2070146541
Claimant Vehicle No :	SLP5539D	Insured Vehicle No :	SCN5259D
Date of Loss:	26/01/2022	Nature of Claim:	TP
		Claim No:	1138902088SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLP5539D		
Make & Model:	HONDA HR-V, 1.5 LX CVT (A)	Engine No:	L15B4532205
Reg. Date:	09/06/2017 (Man. Year: 2017)	Chassis No:	JHMRU1830GX202206
Colour:	Metallic Pearl White	Odometer:	33498 km
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	215/60 R16	Rear Tyre Size:	215/60 R16
Front Left Side:	Yokohama 9 mm	Rear Left Side:	Yokohama 9 mm
Front Right Side:	Yokohama 9 mm	Rear Right Side:	Yokohama 9 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	8,762.56	8,345.00	417.56	4.77
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,940.00	1,520.00	420.00	21.65
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	10,702.56	9,865.00	837.56	7.83
+ GST 7.00/7.00% (S\$)	749.18	690.55	58.63	7.83
Nett Amount (S\$)	11,451.74	10,555.55	896.19	7.83
+ Car Rental (8.0 x S\$100.00/day) (S\$)		800.00		
+ Doc/Search Fee (S\$)		2.00		
Nett Liability (S\$)		11,357.55		

INSPECTION

Date of Assignment:	27/01/2022	
Date Inspected:	27/01/2022	Inspected At: Alan's United Auto Pte Ltd (HQ) Blk 7 Sin Ming Industrial Estate, #01-76 Singapore 575642
Estimated Period of Repair:	5.0 days	

Adjuster: KENNETH KONG**Manager:** Ezlyna

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BONNET	Bent	856.00 FL	*856.00 FL
2	2		*BONNET HINGE	Distorted / Bent	97.00 FL	*97.00 FL
3	1		*BONNET LOCK	Repair	98.50 FL	*- FL
4	2		*HEADLAMP	O/S Mtg Broken / N/SMtgCracked	3,905.40 FL	*3,905.40 FL
5	1		*FRONT GRILLE BASE	Cracked	381.80 FL	*381.80 FL
6	1		*FRONT GRILLE OUTER GARNISH	Cracked	425.00 FL	*385.00 FL
7	1		*FRONT GRILLE LOGO	Necessary	28.20 FL	*28.20 FL
8	1		*FRONT GRILLE CHROME MOULDING	Serviceable	75.00 FL	*- FL
9	1		*FRONT GRILLE TOP COVER	Distorted	125.00 FL	*125.00 FL
10	1		*FRONT BUMPER FASCIA	Buckled / Cracked	801.70 FL	*801.70 FL
11	1		*FRONT BUMPER REINFORCEMENT	Bent	340.10 FL	*321.00 FL
12	2		*BUMPER REINFORCEMENT TOP RUBBR	Distorted	48.40 FL	*48.40 FL
13	1		*FRONT BUMPER SIDE TOP BRACKET	O/S Cracked / N/S Serviceable	39.20 FL	*19.60 FL
14	1		*FRONT BUMPER TOW COVER	Serviceable	22.00 FL	*- FL
15	1		*W/S GLASS WASHER TANK	Serviceable	75.00 FL	*- FL
16	1		*WASHER TANK NECK	Serviceable	28.30 FL	*- FL
17	1		*FRONT SUPPORT PANEL	Bent	576.20 FL	*576.20 FL
18	1		*AIR CON CONDENSER	Bent / Punctured	568.00 FL	*568.00 FL
19	1		*AIR CON FAN COWLING	Cracked	98.00 FL	*98.00 FL
20	1		*AIR CON FAN BLADE	Serviceable	68.00 FL	*- FL
21	1		*AIR CON FAN MOTOR	Dented	332.20 FL	*332.20 FL
22	1		*RADIATOR	Bent / Punctured	1,250.00 FL	*1,250.00 FL
23	1		*RADIATOR FAN COWLING	Cracked	125.00 FL	*125.00 FL
24	1		*RADIATOR FAN BLADE	Serviceable	57.70 FL	*- FL
25	1		*RADIATOR FAN MOTOR	Jammed	298.00 FL	*298.00 FL
26	1		*FRT CENTRE BRACKET	Cracked	45.80 FL	*45.80 FL
27	2		*HEADLAMP LOWER BRACKET	Cracked	75.20 FL	*75.20 FL
28	1		*FRONT NO PLATE WITH BOX	Bent	60.00 FS	*45.00 FS
29	1		*RADIATOR COOLANT	Necessary	30.00 FS	*30.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	10,930.70	10,412.50
- List Item Discount on L Items 20.00/20.00% (\$)	2,168.14	2,067.50
Total Parts (\$)	8,762.56	8,345.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REWIRE DAMAGED PARTS AND REFOCUS HEADLAMP BEAM	New	20.00	20.00
2	TO REMOVE AIR CON CONDENSER ,PIPES AND DRIER ,VACUUM AND TO RECHARGE GAS	New	120.00	100.00
3	TO PUTTY AND SPRAY REPLACED PARTS	New	1,000.00	800.00
4	TO REMOVE ,CUT -OUT DAMAGED PARTS ,PANEL BEATING ,WELDING ,ALIGN ,REFIX AND TO RENEW ABOVE PARTS	New	800.00	600.00
Gross Labour Cost (\$\$)			1,940.00	1,520.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >