

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22001012/RQY3N2**Date:** 07/04/2022**REFERENCE**Handling Insurer: China Taiping Insurance
(Singapore) Pte. Ltd.

Policy No: DMPCSNW00051372100

Claimant Vehicle No : SKV3556Y**Insured Vehicle No :** SKV5279J

Date of Loss: 25/01/2022

Nature of Claim: TP

Claim No: SNM22D200684/C02/TANKL

DESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **SKV3556Y**

Make & Model: VOLKSWAGEN TIGUAN, 1.4 TDI BMT 5N223R (A)

Engine No: CFFN22033

Reg. Date: 14/09/2015 (Man. Year: 2015)

Chassis No: WVGZZZ5NZFW102877

Colour: Red

Odometer: 177073 km

Engine Capacity: 1968 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price****CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	235/50R18	Rear Tyre Size:	235/50R18
Front Left Side:	Pirelli 6 mm	Rear Left Side:	Pirelli 6 mm
Front Right Side:	Pirelli 6 mm	Rear Right Side:	Pirelli 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,505.00	243.00	1,262.00	83.85
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,360.00	290.00	1,070.00	78.68
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	2,865.00	533.00	2,332.00	81.40
+ GST 7.00/7.00% (S\$)	200.55	37.31	163.24	81.40
Nett Amount (S\$)	3,065.55	570.31	2,495.24	81.40

INSPECTION

Date of Assignment: 28/01/2022

Date Inspected: 22/03/2022

Inspected At:

SC Auto Industries (S) Pte Ltd (HQ)
51 Senoko Road, #03-01
Singapore 758133

Estimated Period of Repair: 1.0 days

Adjuster: MOHD RASUL**Manager:** SHIAU CHAN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 06 Apr 2022)

Parts: M1-SUV VOLKSWAGEN TIGUAN 1.4 TDI BMT 5N223R (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SKV3556Y)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Not Necessary	960.00 F	*- FL
2	1		*REAR BUMPER SPOILER	Cut	270.00 F	*270.00 FL
3	1		*REVERSE SENSOR	Not Necessary	225.00 F	*- FL
4	1		*TOWING COVER	Not Necessary	50.00 F	*- FL

F=Franchise part. L=ListItemDisc.

Sub Total (S\$)	1,505.00	270.00
- List Item Discount on L Items 0.00/10.00% (S\$)	0.00	27.00
Total Parts (S\$)	1,505.00	243.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR FOR REAR PORTION	New	1,280.00	250.00
2	LABOUR FOR WIRING	New	80.00	40.00
Gross Labour Cost (S\$)			1,360.00	290.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >