

ASS. REC. BY: SteveREF: CS/LPC22001042/ERY3**ASSIGNMENT**

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

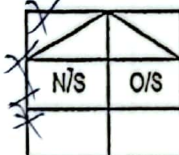
Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: YN2040B Yr Regn: 27/1/11

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer orMake: Hino FDBJPKA c.c. 12,913Colour: White A/C: Insured / Std / NI / NASp. Reading: 280325 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: FDBJPKA 12162Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 295/80R17-5R: 11BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO orFrontR/Bal. 4 mmL/Bal. 4 mmD.O.A. 26/1/22Survey held at Wah HongDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop orFront LH

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

MV-108K

Date/Time, File Pass to?

☐ : Prell. Report

1)

☐ : Final Report

Date/Time, File Return to?

2)

Report Format :

Lump Sum / I.B.I: (\$ _____)

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee:

☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

Survey Fee:

Transportation:

\$ + RS. \$ _____

Photos

Others

TOTAL



Wah Hong Motors & Credit Pte Ltd

Enterprise Hub 38 Toh Guan Road East #01-57 S(608581)

Email: motor@wahhong.sg

Contact: 6773 7377 / 8778 3338

ROC NO. & GST REG NO.: (199806235M)

Page No. 1

Our Ref : WH0909				
Vehicle No. : YN2040B				
Make & Model : HINO FD8JPKA				
QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE(\$)	SURVEYOR'S ADJUSTMENT
PARTS (LIST ITEMS)				
1	Front windscreen / BR		2282.00	
1	Front windscreen rubber seal / CUT		304.00	
1	Front door window glass LH / BR		532.00	
1	Front door LH / OD		2887.00	
1	Front door upper hinge LH X m		198.00	
1	Front door lower hinge LH X n		198.00	
1	Front door assist grip assembly LH X / m		179.00	
1	Front door window run channel LH / CUT		172.00	
1	Front door window outer lower rubber seal LH / CUT		87.00	
2	Front door side signal lamp LH / CUT		218.00	109
1	Front bumper / OD		1405.00	
1	Front bumper lower extension / OD		712.00	
1	Front top corner panel garnish LH / BR		660.00	
1	Side mirror round LH / MIS		141.00	
1	Side mirror LH / MIS		169.00	
1	Side mirror upper stay LH / BT		237.00	
1	Side mirror upper stay cushion LH / MIS		8.00	
1	Side mirror lower stay LH / BR		486.00	
1	Side mirror bracket with motor LH / BR		150.00	
1	Front side lamp LH / MIS		169.00	
1	Step up garnish LH / CUT		348.00	
1	Front door outer pillar LH / OD		647.00	
1	Front door quarter outer panel LH X R		1121.00	
1	Front door side mudguard LH X n		195.00	
1	Side mirror lower stay LH cover RH / MIS		15.00	
1	Side mirror lower stay LH cover LH / MIS		15.00	
Part Items Total:			10%	
				13535.00
				1353.50
				14888.50
SPECIAL NETT ITEMS				
1	Side mirror stay nuts LH / m		15	50.00
1	Front door pillar panel LH sealant / m		20	60.00

1	Front side lamp light bulb LH	✓ <i>nk</i>	10	20.00	
1	IU sticker	✓ <i>nk</i>		10.00	
1	Rear construct box with sliding door & rear doors		14000	15000.00	
1	Metal step up assy LH	✓ <i>00</i>		300.00	200
SN Items Total:				15440.00	
Total Parts:				30328.50	

Steve (LKK)
4/2/22, 11:00a

00- M AL
Excess - ?
L/S
by AL by
15 by



Wah Hong Motors & Credit Pte Ltd

Enterprise Hub 38 Toh Guan Road East #01-57 S(608581)

Email: motor@wahhong.sg

Contact: 6773 7377 / 8778 3338

ROC NO. & GST REG NO.: (199806235M)

Page No. 2

Our Ref : WH0909			
Vehicle No. : YN2040B			
Make & Model : HINO FD8JPKA			
S/N	DESCRIPTION	REPAIRER'S ESTIMATE (\$)	SURVEYOR'S ADJUSTMENT
1	LABOUR To remove the affected parts & fittings to commence repairs; panel beat & reshape the affected areas and replace the damaged parts and components	2000.00	1000
2	To supply paint materials, expandable items & putty, respray paint on parts replaced & repaired	3400.00	1800 2500
3	To remove and refix wiring system at accident damaged area and check for all electrical proper function	60.00	30
4	To remove and refit/replace Front door LH fitting, trimmings, garnish, window glass and lock mechanism	120.00	50
5	To remove and replace front windscreen	150.00	120
6	To remove and refix passenger seats	200.00	X
7	To remove and replace/refit roots lining & upholster garnish	200.00	80
8	To carried out repair on roof top panel	200.00	X
9	To carried out repair on rear floor panel side railing track LH	200.00	100
Labour Total :		6530.00	
TOTAL (PARTS & LABOUR):		36858.50	

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: