

PAR Automotive Consultancy

Regn. No: 52986974L

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel : 64531173, Fax : 64536131.
Consultants: Vehicle appraisal & inspection, accident investigation, expert witness

Report No: 0046-20-HLm

30 October 2020

ACCIDENT VEHICLE SURVEY REPORT

Tan Shen Ching (Chen Xianjun)
c/o 160 Sin Ming Drive #05-17 Sin Ming Autocity
Singapore 575722

VEHICLE INFORMATION:

<i>Vehicle Reg No.:</i>	SLH5812G	<i>Odometer:</i>	093238km
<i>Make & Model:</i>	Honda Vezel Hybrid 1.5X A	<i>Colour:</i>	White
<i>Chassis number:</i>	RU31218255	<i>Date of accident:</i>	12/08/2020
<i>Year of Regn.:</i>	10/11/2016	<i>Date inspected:</i>	13/08/2020
<i>Repairer at:</i>	Hiap Lek Automobile Trading	<i>Date inspected (After Repair):</i>	25/08/2020
	c/o 160 Sin Ming Drive #05-17 Sin Ming Autocity		
	Singapore 575722		

STATIC CHECKS, where applicable:

<i>Steering :</i>	serviceable
<i>Footbrake :</i>	serviceable
<i>Handbrake :</i>	serviceable
<i>Paintwork :</i>	Good
<i>General condition :</i>	Good

TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
<i>Front:</i>	5mm/Dunlop	5mm/Dunlop	215/60R16
<i>Rear:</i>	5mm/Dunlop	5mm/Dunlop	215/60R16

POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the front LH portion.
Please see details as described in the Annex for parts and labour.

REMARKS:

We have inspected the above-mentioned vehicle on a "**Without Prejudice**" basis.

PAR Automotive Consultancy**Parts and Labour Assessment**

Report No: 0046-20-HLm

Vehicle No: SLH5812G

Description of part	Qty	Condition as inspected	Repairer's estimate	Our adjustment
Front bonnet	1	buckled	1,020.00	1,020.00
Front bonnet side moulding RH/LH	2	necessary	75.00	75.00
Front bonnet centre moulding	1	necessary	85.00	85.00
Front bonnet insulator clip	10	necessary	35.00	35.00
Front bonnet hinge	2	bent	100.00	100.00
Front bonnet lock	1	bent	128.00	128.00
Front bonnet lock bracket	1	bent	76.00	76.00
Front radiator grille	1	fractured	270.00	270.00
Front radiator grille garnish	1	fractured	285.00	285.00
Front radiator grille emblem 'H' logo	1	necessary	28.20	28.20
Front radiator grille support bracket	1	bent	52.00	52.00
Front head lamp (HID) RH/LH	2	fractured	3,718.80	3,718.80
Front head lamp lower bracket RH/LH	2	bent	70.00	70.00
Front head lamp clip RH/LH	6	necessary	23.40	23.40
Front bumper	1	deformed	927.50	927.50
Front bumper tow cover	1	deformed	20.00	20.00
Front bumper LED daylight LH	1	fractured	587.10	587.10
Front bumper fog lamp cover LH	1	deformed	45.00	45.00
Front bumper fog lamp LH	1	fractured	327.70	327.70
Front bumper lower grille	1	fractured	150.00	150.00
Front bumper lower moulding	1	deformed	146.30	146.30
Front bumper lower diffuser	1	deformed	195.50	195.50
Front bumper side retainer RH/LH	2	necessary	46.00	46.00
Front bumper inner garnish	2	deformed	70.00	70.00
Front bumper reinforcement	1	bent	321.00	321.00
Front fender LH	1	buckled	580.00	580.00
Front fender emblem 'Hybrid' RH	1	necessary	42.50	42.50
Front fender wheel arch garnish LH	1	deformed	153.00	153.00
Front support panel	1	bent	520.00	520.00
Horn	2	distortion	110.00	110.00
Radar sensor	1	shorted	2,887.00	2,887.00
Radar sensor bracket	1	bent	45.60	45.60
Air intake duct	1	deformed	65.00	65.00
Air con condenser	1	bent	750.00	750.00
Air con condenser side air guide RH/LH	2	deformed	50.00	50.00
Air con fan blade	1	warped	58.00	58.00

Air con fan motor	1	shorted	298.00	298.00
Radiator assy	1	bent	1,250.00	1,250.00
Radiator top mounting	2	bent	18.00	18.00
Radiator fan cowling	1	deformed	125.00	125.00
Radiator fan blade	1	warped	60.00	60.00
Radiator fan motor	1	shorted	298.00	298.00
Radiator spare tank	1	deformed	60.00	60.00
Front chassis LH	1	repair	514.00	0.00
<i>Subtotal before discount</i>			16,686.60	16,172.60
<i>Percentage discount 0% and 20%</i>			0.00	3,234.52
Sub-total 1			16,686.60	12,938.08
Front bumper chrome cover trim set	1	fractured	250.00	250.00
Front bumper clip set	1	necessary	35.00	35.00
Front tyre LH	1	abraded	350.00	350.00
<i>Subtotal before discount</i>			635.00	635.00
<i>Percentage discount 0% and 0%</i>			0.00	0.00
Sub-total 2			635.00	635.00
Parts-total			17,321.60	13,573.08

LABOUR

1. To straighten and panel beating LH front fender inner panel, LH front door pillar and front frame members. To cut/weld front support panel. To remove and refit above parts.	1,500.00	1,250.00
2. To putty, re-spray painting and polish affected areas.	1,250.00	1,000.00
3. To check and rectify wiring system.	80.00	50.00
4. To rust proof affected areas.	120.00	60.00
5. To remove, refit air-con condenser and recharge air con gas.	150.00	120.00
6. To remove, refit front LH tyre/sport rim and balancing.	50.00	40.00
7. To conduct electronic wheel alignment test.	180.00	150.00
Labour total	3,330.00	2,670.00
Parts & Labour total	20,651.60	16,243.08

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on LUMP SUM repairs is : \$12,900.00
and the recommended number of working days for the repairs is : 8



B J Loi (I Eng. MIMI, AIRTE)
Automotive Appraiser

































































































