

# WG APPRAISAL SERVICES

Blk 224B, Compassvale Walk, #07-647, Singapore 542224  
Email: winsongkk@hotmail.com Contact: 9747 0063  
Company Register No. 53326249J

## ACCIDENT DAMAGED VEHICLE INSPECTION REPORT

M/S : LIM GHIM CHANG  
C/O RIGHT CLICK AUTOWORKS  
7 SOON LEE ST, ISPACE,  
#01-27, SINGAPORE 627608

Date : 11 August 2021  
Our Ref : WG/TP/2021-138

### REFERENCE PARTICULARS

Date of Accident : 09 July 2021  
Date of Inspection : 27 July 2021

Type of Inspection : Third Party Claim  
Date of Re-Inspn : 28 July 2021

### VEHICLE PARTICULARS

Registration No : SKR10181  
Make : AUDI  
Model : A6 2.0 TFSI MU (NAVIGATION)  
Year : 2013

Engine No : CDN375604  
Chassis No : WAUZZZ4G1EN0  
Odometer : 89170km  
Colour : Black

### CONDITION OF VEHICLE (STATIC CHECKS AT TIME OF INSPECTION ONLY)

Engine condition : Good  
Foot Brake : Serviceable  
Hand Brake : Serviceable

General Body Work : Good  
Steering : Serviceable  
Lightings : Serviceable

### TYRE CONDITION (Remaining estimated life of tyre in mm)

	Make	Size
Front Near side	Pirelli	255/35ZR20
Front Off Side	Pirelli	255/35ZR20
Rear Near Side	Pirelli	255/35ZR20
Rear off Side	Pirelli	255/35ZR20

Thread Balance
5 mm
5 mm
5 mm
5 mm

### GENERAL DESCRIPTION OF DAMAGES

The vehicle sustained damage at the rear right portion.  
For details, refer to assessment for repairs and photographs attached.

### ASSESSMENT SUMMARY

Our assessment of the repair costs to pre-accident condition was **SS10,700.00** nett at lump sum basis.(Subject to GST if applicable)

Under normal circumstances, estimated period required for repairs : Nine ( 09 ) working days.

Enclosed Sixty-seven ( 67 ) photographs depicting damage to the vehicle.

Inspection conducted at : RIGHT CLICK AUTOWORKS  
7 SOON LEE ST, ISPACE, #01-27, SINGAPORE 627608

In accordance to your instruction, we have **not authorise** repairs and inspection was conducted strictly on a "**WITHOUT PREJUDICE BASIS**".

VEHICLE NO : SKR1018T  
MODEL : A6 2.0 TFSI MU (NAVIGATION)

Our Ref : WG/TP/2020-209

**ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS**

**DESCRIPTION OF PARTS AND NATURE OF REPAIRS**

A)	SPARE PARTS	QTY PC/SET	ASSESSED CONDITION		ORIGINAL QUOTATION	REVISED QUOTATION
01	REAR BUMPER	1	CRACKED	\$	2,290.00	\$ 2,290.00
02	REAR BUMPER RETAINER LH	1	NOT NECESSARY	\$	291.00	\$ -
03	REAR BUMPER RETAINER RH	1	CRACKED	\$	291.00	\$ 291.00
04	REAR PDC SENSOR	1	MALFUNCTION	\$	331.00	\$ 331.00
05	PDC SENSOR HOLDER	1	NECESSARY	\$	30.00	\$ 30.00
06	REAR FENDER RH	1	DENTED	\$	2,833.00	\$ 2,833.00
07	REAR FENDER INNER SHIELD	1	TORN/DEFORMED	\$	211.00	\$ 211.00
08	REAR SHOCK ABSORBER RH	1	BENT	\$	959.00	\$ 959.00
09	REAR KNUCKLE ARM RH	1	BENT	\$	868.00	\$ 868.00
10	REAR UPPER ARM RH	1	BENT	\$	385.00	\$ 385.00
11	REAR LOWER ARM RH	1	BENT	\$	470.00	\$ 470.00
12	REAR WHEEL BEARING RH	1	NECESSARY	\$	579.00	\$ 579.00
13	REAR RIM	1	GRAZED	\$	1,293.00	\$ 1,293.00
				\$	10,831.00	\$ 10,540.00
				Less 10%	\$ 1,083.10	\$ 1,054.00
					<b>\$ 9,747.90</b>	<b>\$ 9,486.00</b>

**B) S/NETT ITEM**

14	REAR BUMPER CLIP	1 SET	NECESSARY	\$	40.00	\$ 30.00
15	REAR FENDER INNER SHIELD CLIP	1 SET	NECESSARY	\$	30.00	\$ 20.00
16	BRAKE FULID	1 BOT	NECESSARY	\$	70.00	\$ 60.00
17	JOINT SELANT	1	NECESSARY	\$	120.00	\$ 100.00
18	WINDSCREEN SEALANT	1	NECESSARY	\$	120.00	\$ 100.00
				\$	<b>380.00</b>	<b>\$ 310.00</b>

**Parts Total :**

\$	<b>10,127.90</b>	\$	<b>9,796.00</b>
----	------------------	----	-----------------

**C) LABOUR CHARGES & MISC**

19	CHECK REAR WIRING AND LIGHTNING SYSTEM	\$	90.00	\$	80.00
20	REMOVE, REFIT REAR LINING, TRIM AND GARNISH	\$	150.00	\$	130.00
21	REMOVE , RENEW REAR REVERSE SENSOR	\$	120.00	\$	100.00
22	REMOVE AND REFIT REAR WINDSCREEN SEALANT	\$	150.00	\$	130.00
23	COMPUTERISED AND CHECK REAR WHEEL ALIGNMENT	\$	200.00	\$	180.00
24	REMOVE AND RENEW REAR UNDERCARRIAGE PARTS	\$	300.00	\$	250.00
25	PANEL BEATING ON AFFECTD AREAS AND RENEW DAMAGE PARTS	\$	1,500.00	\$	1,400.00
26	SPRAY PAINTING ON AFFECTED AREAS	\$	1,400.00	\$	1,200.00
27	APPLY ANTI RUST ON AFFECTED AREAS	\$	150.00	\$	120.00
	<b>Labour Total :</b>	\$	<b>4,060.00</b>	\$	<b>3,590.00</b>

**Total Parts and Laboure :**

\$	<b>14,187.90</b>	\$	<b>13,386.00</b>
----	------------------	----	------------------

**FINAL LUMP SUM ADJUSTMENT**

\$	<b>10,700.00</b>
----	------------------

#### POINT OF IMPACT

The impact was confined to the rear right portion of the vehicle.  
The damages appeared to be consistent as per the accident report statement.  
Please refer the attached schedule and photographs for details.

#### ADJUSTMENT/RECOMMENDATIONS

We have thoroughly inspected each and every item on the repairer's estimates against the actual damaged found on the vehicle. We have listed the breakdown of our findings and recommendations as per assessment above.

#### CONCLUSION

The repairer has agreed to undertake repair the vehicle at a lump sum basis of **SS10,700.00 nett** corresponding to replacement of parts, spray painting and labour charges. We now revert for your decision on the above claim.

Yours faithfully,  
WG APPRAISAL SERVICES



Winson Goh  
Automotive Appraiser



































































