

CARLINK CONSULTANCY


60 Hillside Drive
Singapore 549009

Tel : 62856178

Fax : 62874788

ACCIDENT VEHICLE INSPECTION / ASSESSMENT REPORT

Our Ref: CL 12360 YN 8208 X

1 REFERENCE			
Date of request	:	11th February 2022	
Requested by	:	M/S Power-Vac Industrial Services Pte Ltd C/o Blk 5032 Ang Mo Kio Industrial Park 2, #01-291, SE 569535	
Type of claim	:	Third party	
Workshop	:	M/S Bak Heng Motor Repairing Co Blk 5032 Ang Mo Kio Industrial Park 2, #01-291 Singapore 569535	
Accident date	:	28th January 2022	
Date of survey	:	11th February 2022	
Date of dismantle parts	:	18th February 2022	
Date of after repair	:	18th February 2022	
2 DETAILS OF VEHICLE			
Registration No.	:	YN 8208 X	
Make & Model	:	Isuzu FVR34SUQDC	
Date of registration	:	22nd May 2015	
Engine No.	:	6HK1664526	
Chassis No.	:	JALFVR347E700078	
Speedometer reading	:	372461 Km	
Transmission	:	Manual	
Colour	:	Blue	
3 STATIC CHECK			
Steering	:	see annex(es)	Paintwork : Good
Footbrake	:	see annex(es)	Modification : Nil
Handbrake	:	see annex(es)	General condition : Good
4 TYRE CONDITION			
		<u>Nearside/Make</u>	<u>Offside/Make</u> <u>Size</u>
Front tyre	:	8mm/Firenza	8mm/Firenza : 275/70 R22.5
Centre tyre	:	8mm/SSROSA	8mm/SSROSA : 275/70 R22.5
5 POINT OF IMPACT			
See Annex(es) and Motor Accident Reports			
6 REMARK			
This inspection was conducted entirely on a "WITHOUT PREJUDICE" basis and we have not authorised any repair.			

Annex A : Assesement / Adjustment on Spare Parts

YN 8208 X

Item	Vehicle Parts Description	Condition	Qty	W/shop Est. (\$)	Disc (%)	Adjusted Cost (\$)
S/Nett Items						
1	Rear LH lamp support bracket	Bent	1	\$650.00		\$650.00 X SVC
2	Rear LH tail lamp assy	Grazed/cracked	1	\$210.00		\$210.00 X NC
-3	Rear RH lamp support bracket	Slack/bent/cut	1	\$650.00		\$650.00 400
4	Rear RH tail lamp assy	Cracked	1	\$230.00		\$230.00 210
5	Rear RH number plate lamp	Cracked	1	\$71.00		\$71.00
6	Rear RH number plate lamp bracket	Bent	1	\$85.00		\$85.00
7	Rear RH number plate	Crumpled/cut	1	\$38.00		\$38.00
8	Rear RH number plate bracket	Bent/cut	1	\$80.00		\$80.00
-9	Rear centre disposal splash shield panel	Buckled/cut	1	\$2,100.00		\$2,100.00 1300
-10	Rear bumper assy	Buckled	1	\$1,800.00		\$1,800.00 900
11	Rear bumper support bracket L/R	Bent - RH, LH-R	2	\$1,400.00		\$1,400.00 1400
12	Rear bumper "caution" sticker	Necessary	1	\$180.00		\$180.00 90
13	Reverse buzzer.	Torn/cracked	1	\$195.00		\$195.00 150
14	Rear RH wheel mud flap	Torn	1	\$180.00		\$180.00 120
Total for Spare Parts :				\$7,869.00		\$7,869.00

Annex B : Adjustment on Labour and Spray Painting

YN 8208 X

Item	Job Description	Workshop Est. (\$)	Adjusted Cost (\$)	
1	To spray undercarriage & chassis frame with anti rust undercoating	\$200.00	\$180.00	50
2	To check wiring system and lights	\$150.00	\$100.00	30
3	To mount vehicle on jig bench to check, straighten & align rear L/R chassis and rear cross member	\$1,400.00	\$950.00	X
4	To putty and respray paint on affected area	\$1,200.00	\$900.00	300
5	To renew damaged parts, straighten/repair and aligned all parts.	\$2,000.00	\$1,800.00	400
TOTAL FOR LABOUR & SPRAY PAINTING :		\$4,950.00	\$3,930.00	

Summary

4 days

	Workshop Est. (\$)	Adjusted Cost (\$)
TOTAL FOR SPARE PARTS :	\$7,869.00	\$7,869.00
TOTAL FOR LABOUR & SPRAY PAINTING :	\$4,950.00	\$3,930.00
TOTAL REPAIR COSTS :	\$12,819.00	\$11,799.00