

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CS/CTI22001239/KQY3N2**Date:** 01/04/2022**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMCVSNW00100192100

**Claimant Vehicle No :** SND7566B **Insured Vehicle No :** GBB2733X

Date of Loss: 06/02/2022 Nature of Claim: TP Claim No: SNM22D200860/C02/TOHHS

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

Reg No: **SND7566B**

Make & Model: TOYOTA NOAH HYBRID, 1.8 X CVT (A) Engine No: 2ZR2M61284

Reg. Date: 24/01/2022 (Man. Year: 2021) Chassis No: ZWR800503103

Colour: Metallic Pearl White Odometer: 4112 km

Engine Capacity: 1797 cc

Market Value/New Car Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price**

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

**CONDITION OF TYRES**

Front Tyre Size: 195/65R15 Rear Tyre Size: 195/65R15

Front Left Side: Goodyear 9 mm Rear Left Side: Goodyear 9 mm

Front Right Side: Goodyear 9 mm Rear Right Side: Goodyear 9 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	13,414.00	6,319.84	7,094.16	52.89
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,350.00	1,520.00	1,830.00	54.63
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Gross Total (\$\$)</b>	<b>16,764.00</b>	<b>7,839.84</b>	<b>8,924.16</b>	<b>53.23</b>
<b>+ GST 7.00/7.00% (\$\$)</b>	<b>1,173.48</b>	<b>548.79</b>	<b>624.69</b>	<b>53.23</b>
<b>Nett Amount (\$\$)</b>	<b>17,937.48</b>	<b>8,388.63</b>	<b>9,548.85</b>	<b>53.23</b>

**INSPECTION**

Date of Assignment: 09/02/2022

Date Inspected: 09/02/2022 Inspected At: Optima Werkz Pte Ltd (HQ)  
10 Ang Mo Kio Industrial Park 2A, #01-05 AMK  
Autopoint  
Singapore 568047

Estimated Period of Repair: 6.0 days

**Adjuster:** KENNETH KONG**Manager:** SHIAU CHAN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Reference

<b>Part Source:</b>	MRM-SG	Version: 1.0 (Last Synchronised: 01 Apr 2022)
<b>Parts:</b>	M1-MPV	TOYOTA NOAH HYBRID 1.8 X CVT (A) (Catalogue:Merimen Singapore 1.0)
<b>Labour:</b>	Repairer's	(Price-denominated Standard List)
<b>Print Code:</b>	(Unsubmitted, no print-code for SND7566B)	
<b>Validity:</b>	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
<b>Further Info:</b>	Items/values not in reference catalogue are prefixed with an asterisk *.	

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR TAILGATE	Bent	1,988.80 FL	*1,645.25 FL
2	1		*REAR TAILGATE WINDSCREEN GLASS	Shattered	1,290.10 FL	*1,290.10 FL
3	1		*REAR TAILGATE WINDSCREEN MOULDING	Necessary	116.30 FL	*116.30 FL
4	1		*REAR TAILGATE WIPER ARM	Serviceable	149.80 FL	*- FL
5	1		*REAR TAILGATE WIPER MOTOR	Serviceable	873.20 FL	*- FL
6	1		*REAR TAILGATE LOGO EMBLEM	Necessary	87.60 FL	*87.60 FL
7	1		*REAR TAILGATE OUTER CHROME GARNISH	Cracked	832.10 FL	*680.90 FL
8	1		*REAR TAILGATE HYBRID EMBLEM	Necessary	85.80 FL	*85.80 FL
9	1		*REAR TAILGATE MECHANISM LOCK	Dented	495.20 FL	*455.10 FL
10	1		*REAR TAILGATE INNER HANDLE COVER	Serviceable	52.40 FL	*- FL
11	1		*REAR TAILGATE INNER TRIM BOARD	Mtg Cracked	570.10 FL	*570.10 FL
12	1		*REAR TAILGATE INNER TRIM BOARD TOP	Serviceable	427.10 FL	*- FL
13	1		*REAR TAILGATE INNER TRIM BOARD LH	Serviceable	342.00 FL	*- FL
14	1		*REAR TAILGATE INNER TRIM BOARD RH	Serviceable	342.00 FL	*- FL
15	1		*REAR TAILGATE WEATHERSTRIP	Dented/Distorted	380.70 FL	*322.10 FL
16	1		*REAR TAILLAMP LH	Cracked	820.80 FL	*781.00 FL
17	1		*REAR TAILLAMP RH	Serviceable	820.80 FL	*- FL
18	1		*REAR TAILLAMP LOWER GARNISH LH	Serviceable	176.20 FL	*- FL
19	1		*REAR TAILLAMP LOWER GARNISH RH	Serviceable	176.20 FL	*- FL
20	1		*REAR TAILLAMP LOWER BRACKET LH	Repair	115.20 FL	*- FL
21	1		*REAR TAILLAMP LOWER BRACKET RH	Repair	115.20 FL	*- FL
22	1		*REAR SIDE GARNISH LH	Serviceable	197.80 FL	*- FL
23	1		*REAR SIDE GARNISH RH	Serviceable	197.80 FL	*- FL
24	1		*REAR BUMPER	Buckled	823.20 FL	*798.20 FL
25	1		*REAR BUMPER SIDE RETAINER LH	Serviceable	156.70 FL	*- FL
26	1		*REAR BUMPER SIDE RETAINER RH	Serviceable	156.70 FL	*- FL
27	1		*REAR BUMPER TOW HOOK COVER	Serviceable	55.80 FL	*- FL
28	1		*REAR BUMPER REFLECTOR LH	Serviceable	124.80 FL	*- FL
29	1		*REAR BUMPER REFLECTOR RH	Serviceable	124.80 FL	*- FL
30	1		*REAR BUMPER ANTENNA SENSOR	Cracked	150.90 FL	*150.90 FL
31	1		*REAR END PANEL	Bent	914.60 FL	*715.80 FL
32	1		*REAR END PANEL INNER TOP GARNISH	Dented	207.30 FL	*207.30 FL
33	1		*REAR FLOOR PANEL	Repair	698.10 FL	*- FL
34	1		*REAR FLOOR PANEL INNER TOP CARPET	Serviceable	630.70 FL	*- FL
35	1		*REAR FLOOR PANEL INNER TOP CARD BOARD	Serviceable	830.20 FL	*- FL
36	1		*REAR FENDER INNER TRIM BOARD LH	Serviceable	482.50 FL	*- FL
37	1		*REAR FENDER INNER TRIM BOARD RH	Serviceable	482.50 FL	*- FL
38	1		*REAR TAILGATE WINDSCREEN SEALANT	Necessary	100.00 FS	*40.00 FS
39	1		*REAR TAILGATE OUTER CHROME GARNISH CLIPS	Necessary	20.00 FS	*20.00 FS
40	1		*REAR TAILGATE REVERSE CAMERA	Serviceable	300.00 FS	*- FS
41	1		*REAR NUMBER PLATE WITH HOLDER	Serviceable	65.00 FS	*- FS
42	1		*REAR TAILGATE INNER TRIM BOARD CLIPS	Necessary	30.00 FS	*30.00 FS
43	1		*REAR TAILLAMP CLIPS LH	Not Necessary	20.00 FS	*- FS
44	1		*REAR TAILLAMP CLIPS RH	Not Necessary	20.00 FS	*- FS
45	1		*REAR BUMPER CLIPS	Necessary	50.00 FS	*50.00 FS
46	1		*REAR BUMPER REVERSE SENSOR	Wire Torn	300.00 FS	*200.00 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
47	1		*REAR END PANEL JOINT SEALANT	Necessary	80.00 FS	*30.00 FS
48	1		*REAR END PANEL INNER TOP GARNISH CLIPS	Necessary	20.00 FS	*20.00 FS
49	1		*REAR FENDER INNER TRIM BOARD CLIPS LH	Not Necessary	20.00 FS	*- FS
50	1		*REAR FENDER INNER TRIM BOARD CLIPS RH	Not Necessary	20.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

<b>Sub Total (\$)</b>	<b>17,537.00</b>	<b>8,296.45</b>
<b>- List Item Discount on L Items 25.00/25.00% (\$)</b>	4,123.00	1,976.61
<b>Total Parts (\$)</b>	<b>13,414.00</b>	<b>6,319.84</b>

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	LABOUR CHARGES TO REMOVE,REPLACE,REPAIR,REFIX & READJUST ACCIDENT AREAS	New	1,400.00	600.00
2	LABOUR CHARGES FOR PAINTING & FURNISHING MATERIALS AT ACCIDENT AREAS	New	1,400.00	660.00
3	TO TUFF KOTE & UNDERSEAL MATERIALS	New	100.00	60.00
4	TO DISMANTLE & REPLACED REAR TAILGATE INNER COMPONENT MECHANISM TO FACILITATE REPAIR WITH CHECK FOR FUNCTION	New	120.00	60.00
5	TO REMOVE & REPLACE REAR WINDSCREEN GLASS & ETC.TO EFFECT AT ACCIDENT AREA	New	150.00	120.00
6	TO DIAGNOSIS FAULT CODE & RESET MEMORY	New	100.00	0.00
7	TO CHECK WIRING & ELECTRICAL SYSTEM & ETC	New	80.00	20.00
<b>Gross Labour Cost (\$\$)</b>			<b>3,350.00</b>	<b>1,520.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >