

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/EG122001702/UTF3N2**Date:** 10/03/2022REFERENCE

Handling Insurer: ERGO Insurance Pte. Ltd.

Policy No:

Claimant Vehicle No : GBD9721Z**Insured Vehicle No :** YQ3153L

Date of Loss: 20/02/2022

Nature of Claim:

TP

Claim No: CDMCG22000333

DESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **GBD9721Z**

Make & Model: NISSAN NV350, 2.5 (A)

Engine No: YD25376568A

Reg. Date: 05/08/2015 (Man. Year: 2015)

Chassis No: JN1MC2E26Z0004844

Colour: Grey

Odometer: 166737 km

Engine Capacity: 2488 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes

Footbrake (Serviceable):

Yes

Handbrake (Serviceable): Yes Engine Modification:

No

Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195R15

Rear Tyre Size:

195R15

Front Left Side: Yokohama 6 mm

Rear Left Side:

Yokohama 6 mm

Front Right Side: Yokohama 6 mm

Rear Right Side:

Yokohama 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	11,233.27	5,342.45	5,890.82	52.44
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,560.00	2,170.00	1,390.00	39.04
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	14,793.27	7,512.45	7,280.82	49.22
Approved Total (Overridden) (S\$)		6,000.00		
(S\$)	14,793.27	6,000.00	8,793.27	59.44
+ GST 7.00/7.00% (S\$)	1,035.53	420.00	615.53	59.44
Nett Amount (S\$)	15,828.80	6,420.00	9,408.80	59.44

INSPECTION

Date of Assignment: 22/02/2022

Date Inspected: 22/02/2022 Inspected At:

Fastech Auto Pte Ltd (HQ)

1 Kaki Bukit Ave 6, #01-46/48/50 Autobay

Singapore 417883

Estimated Period of Repair: 6.0 days

Adjuster: MARCUS CHUA**Manager:** DENISE TAY KWEE CHENG*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 10 Mar 2022)	
Parts:	N/A	NISSAN NV350 2.5 (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GBD9721Z)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR WINDSCREEN	Not Necessary	1,288.20 FL	*- FL
2	1		*TAILGATE	Badly Dented	2,116.70 FL	*1,998.30 FL
3	2		*TAILGATE INNER STOPPERS	Not Necessary	42.00 FL	*- FL
4	1		*TAILGATE INNER LOCK	Dented/Jammed	287.10 FL	*287.10 FL
5	1		*TAILGATE LOCK ACTUATOR	Shorted	355.10 FL	*355.10 FL
6	1		*TAILGATE NISSAN LOGO	Necessary	64.90 FL	*64.90 FL
7	1		*TAILGATE NV350 EMBLEM	Necessary	110.00 FL	*110.00 FL
8	1		*TAILGATE URVAN EMBLEM	Necessary	55.00 FL	*55.00 FL
9	1		*TAILGATE INNER TRIM	Deformed/Torn	217.80 FL	*217.80 FL
10	1		*TAILGATE RUBBER	Twisted	134.40 FL	*134.40 FL
11	1		*TAILGATE OUTER CHROME MOULDING	Cracked	482.30 FL	*482.30 FL
12	1		*REAR BUMPER	Distorted	667.20 FL	*667.20 FL
13	2		*REAR BUMPER SIDE RETAINERS	Bent	54.00 FL	*54.00 FL
14	2		*REAR BUMPER SIDE HOLDERS	Necessary	56.00 FL	*56.00 FL
15	1		*REAR END PANEL	Badly Dented	247.10 FL	*247.10 FL
16	1		*REAR END PANEL INNER	Repair	1,110.20 FL	*- FL
17	1		*REAR END PANEL TOP PLATE	Distorted	122.80 FL	*122.80 FL
18	1		*REAR STEP PANEL	Bent	178.90 FL	*178.90 FL
19	2		*TAILLAMPS	Cracked	449.60 FL	*449.60 FL
20	2		*TAILLAMP HOUSING PANELS	Repair	916.00 FL	*- FL
21	1		*REAR FENDER	Repair	2,915.00 FL	*- FL
22	1		*REAR WINDSCREEN SEALANT	Necessary	50.00 FS	*40.00 FS
23	1		*REAR WINDSCREEN INNER SEAL	Necessary	50.00 FS	*40.00 FS
24	1		*SET TAILGATE INNER TRIM CLIPS	Necessary	50.00 FS	*40.00 FS
25	1		*SET REAR BUMPER CLIPS	Necessary	50.00 FS	*30.00 FS
26	1		*SET REAR BUMPER REVERSE SENSOR	Shorted	280.00 FS	*200.00 FS
27	1		*REAR END PANEL SEALANT	Necessary	50.00 FS	*40.00 FS
28	1		*SET TAILGATE 70KM/H & 8 PAX STICKER	Necessary	20.00 FS	*20.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	12,420.30	5,890.50
- List Item Discount on L Items 10.00/10.00% (\$\$)	1,187.03	548.05
Total Parts (\$\$)	11,233.27	5,342.45

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CHECK WIRING	New	50.00	20.00
2	TO DISMANTLE & REPLACED REVERSE SENSOR	New	80.00	50.00
3	TO DISMANTLE & REFIX REAR WINDSCREEN	New	150.00	100.00
4	TO TRANSFER TAILGATE MECHANISM	New	100.00	60.00
5	TO SPRAY RUST PROOFING	New	100.00	60.00
6	LABOUR FOR PANEL BEATING & REPLACED PARTS	New	1,500.00	880.00
7	TO PUTTY & SPRAY PAINTING	New	1,580.00	1,000.00
Gross Labour Cost (\$\$)			3,560.00	2,170.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >