

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG22001947/AES3Q2**Date:** 23/06/2022REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1700037921
Claimant Vehicle No :	SMM3530U	Insured Vehicle No :	SLR3094Y
Date of Loss:	26/02/2022	Nature of Claim:	TP
		Claim No:	3074544256SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMM3530U	Engine No:	L15B5568786
Make & Model:	HONDA VEZEL, 1.5 (A)	Chassis No:	RU11318748
Reg. Date:	26/06/2019 (Man. Year: 2019)	Odometer:	105341 km
Colour:	White		
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	215/55 R17	Rear Tyre Size:	215/55 R17
Front Left Side:	Goodyear 6 mm	Rear Left Side:	Goodyear 6 mm
Front Right Side:	Goodyear 6 mm	Rear Right Side:	Goodyear 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	9,068.90	4,764.00	4,304.90	47.47
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,930.00	1,240.00	690.00	35.75
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	10,998.90	6,004.00	4,994.90	45.41
Approved Total (Overridden) (S\$)		4,800.00		
Nett Amount (S\$)	10,998.90	4,800.00	6,198.90	56.36
Global Sum Settlement (S\$)		0.00		

INSPECTION

Date of Assignment:	28/02/2022	Advance Auto Garage (HQ)
Date Inspected:	28/02/2022 Inspected At:	23 KAKI BUKIT AVENUE 4 #04-01 AAS KAKI BUKIT CENTRE
Estimated Period of Repair:	5.0 days	Singapore 415933

Adjuster: ADRIAN LING**Manager:** Asher Sng Rong Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed	745.60 F	*745.60 FL
2	1		*FRONT BUMPER CLIPS	Necessary	30.00 FS	*30.00 FS
3	1		*FRONT BUMPER SIDE HOLDER RH	Damaged	26.50 F	*26.50 FL
4	1		*FRONT BUMPER REINFORCEMENT	Not Necessary	321.00 F	*- FL
5	1		*FRONT BUMPER FOG LAMP RH	Not Necessary	327.20 F	*- FL
6	1		*FRONT BUMPER FOG LAMP COVER RH	Not Necessary	85.10 F	*- FL
7	1		*FRONT BUMPER LOWER GARNISH	Deformed	386.20 F	*386.20 FL
8	1		*HEADLAMP RH	Cracked	1,784.50 F	*1,784.50 FL
9	1		*HEADLAMP LOWER BRACKET RH	Cracked	39.00 F	*39.00 FL
10	1		*FRONT RH FENDER	Dented	582.00 F	*582.00 FL
11	1		*FRONT RH FENDER INNER SHIELD	Deformed	132.40 F	*132.40 FL
12	1		*FRONT RH FENDER INNER SHIELD CLIPS	Necessary	30.00 FS	*30.00 FS
13	1		*FRONT RH FENDER WHEEL ARC GARNISH	Deformed	185.40 F	*185.40 FL
14	1		*FRONT RH FENDER WHEEL ARC GARNISH CLIPS	Necessary	20.00 FS	*20.00 FS
15	1		*FRONT RH WHEEL RIM	Cut	850.00 FS	*400.00 FS
16	1		*FRONT RH TYRE	Not Necessary	300.00 FS	*- FS
17	1		*FRONT RH LOWER ARM	Bent	399.20 F	*399.20 FL
18	1		*FRONT RH SHOCK ABSORBER	Bent	398.40 F	*398.40 FL
19	1		*FRONT RH KNUCKLE ARM	Damaged	482.30 F	*482.30 FL
20	1		*FRONT RH WHEEL HUB C/W BEARING	Damaged	193.50 F	*193.50 FL
21	1		*STEERING RACK AND PINION	Not Necessary	1,750.60 F	*- FL
F=Franchise part. S=SpcNett. L=ListItemDisc.						
Sub Total (S\$)					9,068.90	5,835.00
- List Item Discount on L Items 0.00/20.00% (S\$)					0.00	1,071.00
Total Parts (S\$)					9,068.90	4,764.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING	New	600.00	500.00
2	SPRAY PAINTING	New	600.00	400.00
3	WIRING	New	50.00	30.00
4	TO SPRAY TUFF COAT	New	150.00	30.00
5	TO DISMANTLE FRONT UNDERCARRIAGE	New	380.00	200.00
6	TO PERFORM WHEEL ALIGNMENT	New	150.00	80.00
Gross Labour Cost (\$)			1,930.00	1,240.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >