



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2204269

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 12/07/2022
Reference CC6/CTI22001993/Apa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMP 4266K
Insured Veh. SKW 6067S
Claim No. SNM22D201506
Policy No. DMPCSNW00198542100
Accident Date 01/03/2022
Inspection Date 01/03/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD			Ref:	CC6/CTI22001993/Apa3q2
3 ANSON ROAD #16-00			Date:	12/07/2022
SPRINGLEAF TOWERSINGAPORE 079909			Code:	CTI
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SKW 6067S	Veh. Inspected	SMP 4266K	
Policy No.	DMPCSNW00198542100	Coverage (\$)	0.00	
Claim No.	SNM22D201506	Excess (\$)	0.00	
Assign From		Assign Date	01/03/2022	
2. Vehicle Particulars & Condition				
Make & Model	HONDA FREED	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	GB71099516	Colour	BLUE	
Odometer	209326 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	RAPID	6 mm	
L/H Front Tyre	195/65 R15	RAPID	6 mm	
R/H Rear Tyre	195/65 R15	RAPID	6 mm	
L/H Rear Tyre	195/65 R15	RAPID	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.				
DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	01/03/2022	Inspection Date	01/03/2022	
Survey held at	MG SOLUTION PTE LTD 23 KAKI BUKIT AVE 4 (SOUTH WING) #02-03B VICOM INSPECTION CENTRE, SINGAPORE 415933			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMP 4266K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	TAIL GATE	DISTORTED	1,460.30	1,193.00
1	TAIL GATE LOGO	NECESSARY	72.30	72.30
1	TAIL GATE EMBLEM 'FREED	NECESSARY	76.40	76.40
1	TAIL GATE EMBLEM 'HYBRID'	NECESSARY	76.40	76.40
1	TAIL GATE INNER HOLDER	DEFORMED	80.00	80.00
1	TAIL GATE INNER TRIM	CRACKED	460.00	460.00
1	TAIL GATE TOP LOCK	DAMAGED	255.90	255.90
1	TAIL GATE WEATHERSTRIP	CUT	241.70	241.70
1	TAIL GATE WINDSCREEN MOULDING	NECESSARY	194.20	194.20
1	NUMBER PLATE LAMP CHROME	NOT NECESSARY	320.00	-
1	SET NUMBER PLATE LAMP	NOT NECESSARY	168.50	-
1	REAR BUMPER	DISTORTED	1,155.60	981.00
2	REAR BUMPER SIDE RETAINER @\$69.70	NECESSARY	139.40	139.40
1	REAR BUMPER TOW HOOK COVER	NOT NECESSARY	55.90	-
2	REAR BUMPER INNER HOLDER @\$80.50	CRACKED	161.00	161.00
2	REAR FENDER INNER TRIM @\$655.50	CRACKED	1,311.00	936.00
1	REAR END PANEL(OUTER)	DENTED	655.50	655.50
1	REAR END PANEL (INNER)	TO REPAIR SEE LABOUR	530.80	-
1	TAILLAMP LH	CRACKED	630.50	630.50
1	REAR END PANEL TOP GARNISH	DEFORMED	190.00	190.00
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	1,350.60	-
1	REAR FLOOR PANEL TOP BOARD	NOT NECESSARY	1,180.60	-
	LESS 20% DISCOUNT		-2,153.32	-1,268.66
			8,613.28	5,074.64
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NUMBER PLATE (SN)	DEFORMED	50.00	50.00
1	SET TAIL GATE INNER TRIM CLIP (SN)	NECESSARY	20.00	20.00
1	TAIL GATE WINDSCREEN SEALANT (SN)	NECESSARY	80.00	60.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	20.00	20.00

Report Ref No. CC6/CTI22001993/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR END PANEL INSULATOR SEAL (OUTER) (SN)	NECESSARY	120.00	60.00
1	REAR END PANEL INSULATOR SEAL (INNER) (SN)	NOT NECESSARY	120.00	-
1	SET REAR END PANEL TOP GARNISH CLIPS (SN)	NECESSARY	20.00	20.00
1	REAR FLOOR PANEL INSULATOR SEAL (SN)	NOT NECESSARY	120.00	-
1	REAR REVERSE SENSOR (SN)	DAMAGED	220.00	200.00
1	REAR REVERSE CAMERA (SN)	NOT NECESSARY	550.00	-
			1,320.00	430.00
	LABOUR			
	PANEL BEATING ,WELDING ,CUTTING ,GRAZING ADJUST KNOCK STRAIGHTEN .INCLUSIVE OF THE REPAIR OF REAR END PANEL (INNER) AND REAR FLOOR PANEL .		1,800.00	900.00
	TO PUTTY ,SRPAY PAINT ,POLISH WAX.		1,800.00	800.00
	TO APPLY RUST PROOFING /UNDER COAT.		250.00	60.00
	WIRNING ,BULB CHECKING.		80.00	30.00
	REMOVE AND REFIX UPHOLSTERY CUSHION SEAT TO FACILITATE REPAIR.		250.00	60.00
	REMOVE AND REFIX TAILGATE WINDSCREEN .		120.00	120.00
	TO TRANSFER TAIL GATE MECHANISM .		80.00	80.00
	CONDUCT WATER LEAKAGE TEST .	NOT NECESSARY	100.00	-
	REMOVE AND REIX REAR REVERSE SENSOR AND DISTANCE SETTING.		80.00	50.00
	REMOVE AND REFIX REAR REVERSE CAMERA AND DISTANCE SETTING.		80.00	50.00
			4,640.00	2,150.00
GRAND TOTAL			14,573.28	7,654.64
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,100.00

Report Ref No. CC6/CTI22001993/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 4266K

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

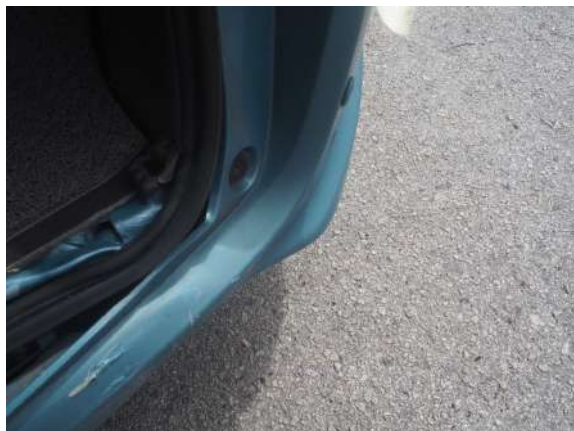



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 4266K

RE-INSPECTION

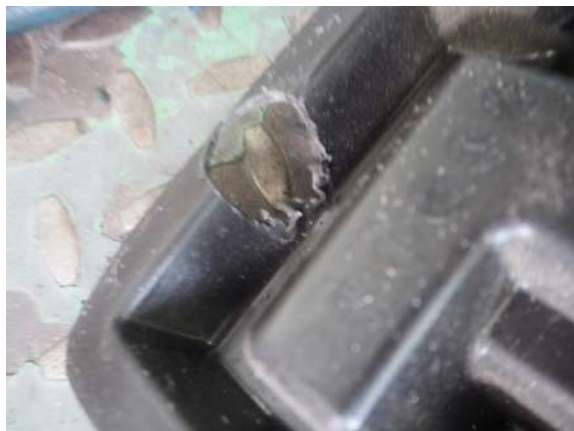



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 4266K

RE-INSPECTION

