

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CS/CTI22002228/ETY3E2**Date:** 04/04/2022**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMB1SNA00006272102

**Claimant Vehicle No :** SBS6513Z **Insured Vehicle No :** PC3921S

Date of Loss: 03/03/2022 Nature of Claim: TP Claim No: SNM22D201630/C02/THAMYL

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

Reg No: **SBS6513Z**

Make & Model: MERCEDES-BENZ CITARO O530, 6.4 D (A) Engine No: 902926C1070395

Reg. Date: 01/12/2014 (Man. Year: 2014) Chassis No: WEB62808323127658

Colour: Multi-colour Odometer: 499681 km

Engine Capacity: 6374 cc

Market Value/New Car Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price**

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

**CONDITION OF TYRES**

Front Tyre Size: 295/80 R22.5 Rear Tyre Size: 295/80 R22.5 (D)

Front Left Side: Bridgestone 4 mm Rear Left Side: Bridgestone 4/4 mm

Front Right Side: Bridgestone 4 mm Rear Right Side: Bridgestone 4/4 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	1,546.00	1,546.00	0.00	0.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	600.00	600.00	0.00	0.00
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Gross Total (\$\$)</b>	<b>2,146.00</b>	<b>2,146.00</b>	<b>0.00</b>	<b>0.00</b>
<b>+ GST 7.00/7.00% (\$\$)</b>	150.22	150.22	0.00	0.00
<b>Nett Amount (\$\$)</b>	<b>2,296.22</b>	<b>2,296.22</b>	<b>0.00</b>	<b>0.00</b>

**INSPECTION**

Date of Assignment: 09/03/2022

Date Inspected: 14/03/2022 Inspected At: Boxfresh Pte Ltd (HQ)  
154 GUL CIRCLE  
Singapore 629611

Estimated Period of Repair: 1.0 days

**Adjuster:** CHEN TSUE YEE**Manager:** DENISE TAY KWEE CHENG

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 04 Apr 2022)	
Parts:	N/A	MERCEDES-BENZ CITARO O530 6.4 D (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SBS6513Z)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*NO 5 GLASS PANEL P/N: 628 675 3110	Broken	1,546.00 F	*1,546.00 F
F=Franchise part.						
Total Parts (S\$)					1,546.00	1,546.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	LABOR FOR DISMANTLING AND REPLACEMENT OF GLASS PANEL	New	600.00	600.00
<b>Gross Labour Cost (\$\$)</b>			<b>600.00</b>	<b>600.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >