

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22002327/UVY3N2**Date:** 24/03/2022**REFERENCE**Handling Insurer: China Taiping Insurance
(Singapore) Pte. Ltd.

Policy No: DMPCSNW00059922100

Claimant Vehicle No : SMX2501C**Insured Vehicle No :** SKZ7443S

Date of Loss: 11/03/2022

Nature of Claim: TP

Claim No: SNM22D201717/C02/IRENE

DESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **SMX2501C**

Make & Model: LEXUS ES250, 2.5 (A)

Engine No: A25A5455419

Reg. Date: 04/01/2021 (Man. Year: 2020)

Chassis No: JTHB11B1902031395

Colour: Blue

Odometer: 11594 km

Engine Capacity: 2487 cc

Market Value/New Car Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price****CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 235/45R18

Rear Tyre Size: 235/45R18

Front Left Side: Dunlop 6 mm

Rear Left Side: Dunlop 6 mm

Front Right Side: Dunlop 6 mm

Rear Right Side: Dunlop 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,050.53	1,840.59	3,209.94	63.56
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,180.00	660.00	520.00	44.07
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (\$\$)	6,230.53	2,500.59	3,729.94	59.87
+ GST 7.00/7.00% (\$\$)	436.14	175.04	261.10	59.87
Nett Amount (\$\$)	6,666.67	2,675.63	3,991.04	59.87

INSPECTION

Date of Assignment: 14/03/2022

Date Inspected: 16/03/2022

Inspected At:

Tan Lim Motor Pte Ltd (Defu)
1 Defu Lane 6
Singapore 539365

Estimated Period of Repair: 2.0 days

Adjuster: MARCUS CHUA**Manager:** VERON CHEN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 22 Mar 2022)
Parts:	143	LEXUS ES250 2.5 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMX2501C)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPET TOW COVER	Deformed / Twisted	57.50 FN	*57.50 FN
2	1		*FRONT BUMPER	Repair	1,106.70 FN	*- FN
3	1		*FRONT RADIATOR GRILLE SUB ASSEMBLY }	Cracked	1,763.00 FN	*1,763.00 FN
4	1		*FRONT BUMPER TOP CHROME MOULDING O/S }		220.80 FN	*- FN
5	1		*FRONT DISTANCE SENSOR O/S (ORIGINAL)	Not Necessary	490.80 FN	*- FN
6	1		*FRONT BUMPER CAMERA	Not Necessary	1,748.30 FN	*- FN
7	1		*RADIATOR GRILLE INNER BASE	Cut	224.60 FN	*224.60 FN

F=Franchise part. N=NettItemDisc.

Sub Total (\$\$)	5,611.70	2,045.10
- Nett Item Discount on N Items 10.00/10.00% (\$\$)	561.17	204.51
Total Parts (\$\$)	5,050.53	1,840.59

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PUTTY AND SPRAY PAINTING FRONT OF THE AFFECTED PORTION	New	400.00	250.00
2	PANEL BEATING,KNOCKING AND STRAIGHTEN FRONT OF THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME	New	500.00	350.00
3	TO REINSTALL OF FRONT BUMPER DISTANCE SENSOR }	New	80.00	40.00
4	TO REINSTALL FRONT BUMPER CAR CAMERA }	New	120.00	0.00
5	TO CHECK ELECTRICAL LIGHTING CONCERNED	New	80.00	20.00
Gross Labour Cost (\$)			1,180.00	660.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >